


Access Audit Site Reports

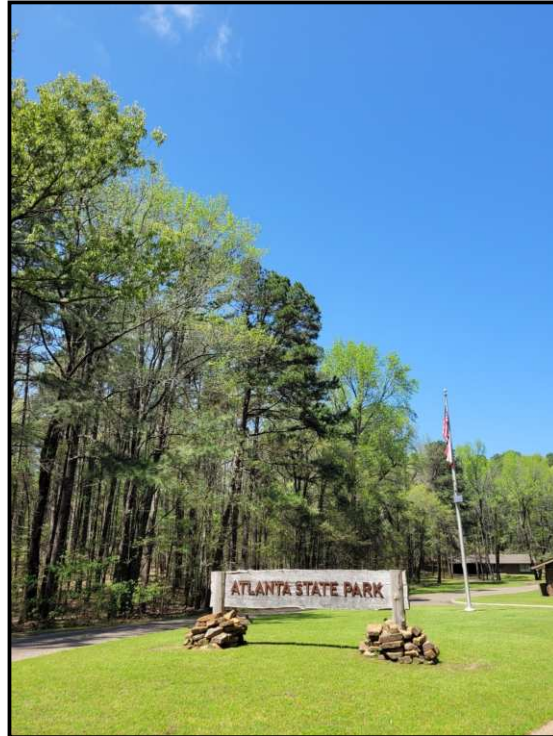

Atlanta State Park

927 Park Rd 42

Atlanta, TX 75551

Accessibility Evaluation

Inspection Date: 04/05/2022

Inspectors: Tanya Scheibe

Prepared By

WT Group

Engineering with Precision, Pace & Passion.

(224) 293 - 6451

www.wtengineering.com

Table of Contents

Cover Letter	3
Findings	5
Headquarters Area	5
Employee Areas	18
Knights Bluff Boat Ramp Area	25
Knights Bluff Camping Area	28
Day Use Area	46
Trails	62
Wilkins Creek Camping Area	64
White Oak Camping Area	83
Wilkins Creek Boat Ramp Area	103
ATLANTA STATE PARK PROGRAM REPORT 202301	105

July 28, 2023

Jessica Burke, ADA Coordinator
Support Resources
Texas Parks and Wildlife Department
4200 Smith School Road
Austin, TX 78744

Dear Jessica,

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the Atlanta State Park located at 927 Park Rd 42, Atlanta, TX 75551. The facility was inspected on 04/05/2022.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.

2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and findings new to the technical standards such as recreation elements

3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.

4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.

5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.


Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.

If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.


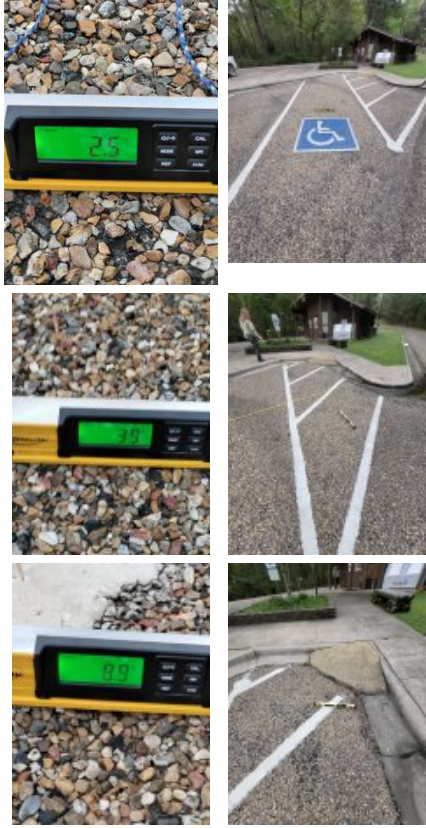
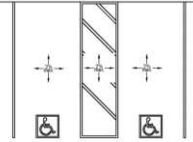
Legend of Abbreviations:


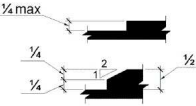

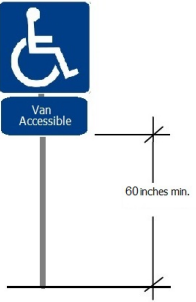

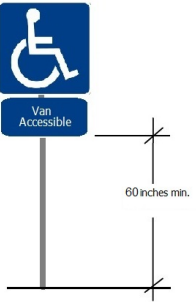
AFF... Above the finished floor
AGL... Above Ground Level
AR... Accessible Route
CIL... Change in Level
CFS... Clear Floor Space
EPC... Elevated Play Component
GLPC... Ground Level Play Component


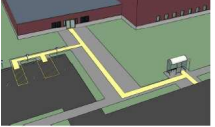
Sincerely,




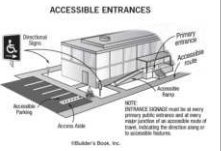
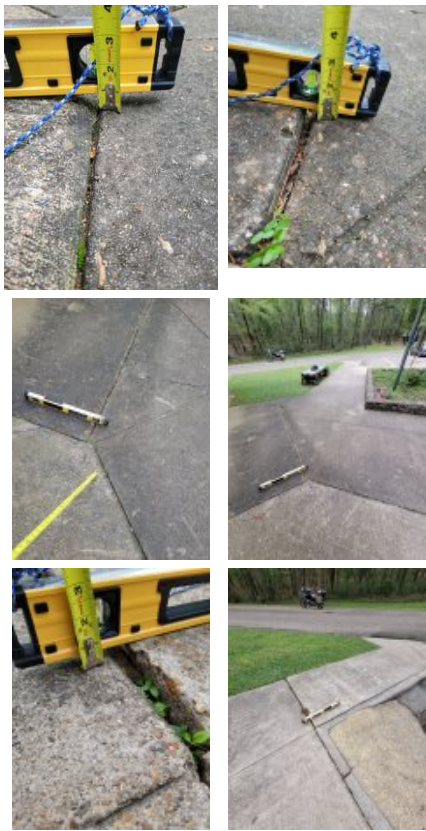
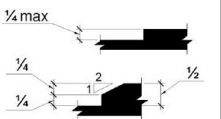
Tanya Scheibe, RAS #1369


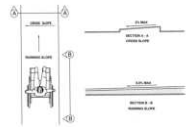

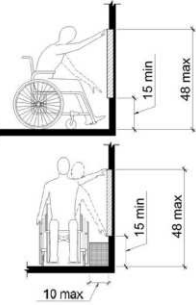

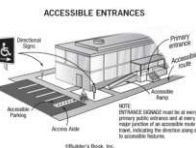
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
1	Headquarters Area: HQ - Parking	[33.2309548 , -94.249727 6]	Element meets all standards and requirements	Parking lot meets scoping - 8 standard spaces, 1 accessible space	None	2010 ADAS Section: N/A		
2	Headquarters Area: HQ - Parking	[33.2309167 , -94.249700 7]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.5% slope in stall, 3.9% and 8.9% slope in access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
3	Headquarters Area: HQ - Parking	[33.2309234, -94.2497007]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	.75" Change in Level (CIL) along curb	Repair, bevel and ramp CIL in stalls and access aisles	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
4	Headquarters Area: HQ - Parking	[33.230892, -94.2497007]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	43" Above Grade Level (AGL) to sign bottom	Raise existing accessible parking signs so lowest end of bottom sign is min 60" above ground level (AGL) measured from the surface of the stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
5	Headquarters Area: HQ - Parking	[33.2308606, -94.2496967]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Space lacks van sign	Add one van parking sign to one accessible stall and assure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
6	Headquarters Area: HQ - Parking	[33.2308875 , -94.249771 8]	The access aisle is not located on an accessible route of travel to the accessible building entrance. Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.	Ramp in access aisle	Remove built up ramp and provide a curb ramp at the head of each access aisle to connect to AR	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
7	Headquarters Area: HQ - Exterior Accessible Route	[33.2307877 , -94.2497336]	The running slope of walking surfaces shall not be steeper than 1:20.	7.2% slope to ice machine, 8.9% slope on route from parking to entry	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
8	Headquarters Area: HQ - Exterior Accessible Route	[33.2307111 , -94.249753 3]	There is no accessible route to the ice machine At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks AR to ice machine, 33.5" wide	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the ice machine	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
9	Headquarters Area: HQ - Exterior Accessible Route	[33.2307731 , -94.249701 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	.5" near apparent ramp, .75" and .5" CIL on Route from parking to entry	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
10	Headquarters Area: HQ - Exterior Accessible Route	[33.2306924 , -94.249643 8]	The accessible path of travel has cross slopes greater than 2%. Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as a ramp.	9.5% slope at pay station on Route from drive to side entry	Correct slope to be 2.08% max. in any direction for a level clear ground space.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
11	Headquarters Area: HQ - Exterior Accessible Route	[33.2307271 , -94.249645 1]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground.	55" AGL to envelopes at pay station on route from drive to side entry	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
12	Headquarters Area: HQ - Public Spaces	[33.2316929 , -94.251487 1]	There is no accessible route to the fish cleaning station. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Old fish cleaning across maintenance- no longer in use, no AR	Leave as is unused fish cleaning station. Make access corrections if reinstated.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		

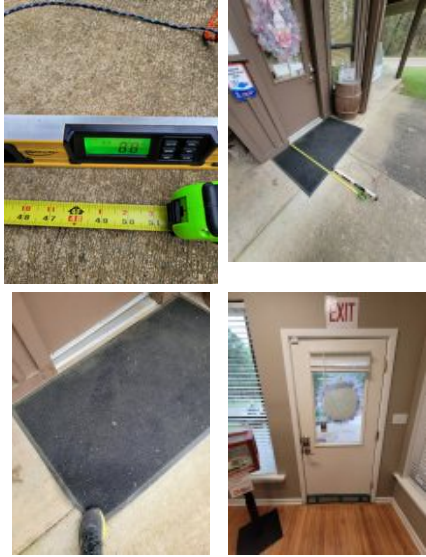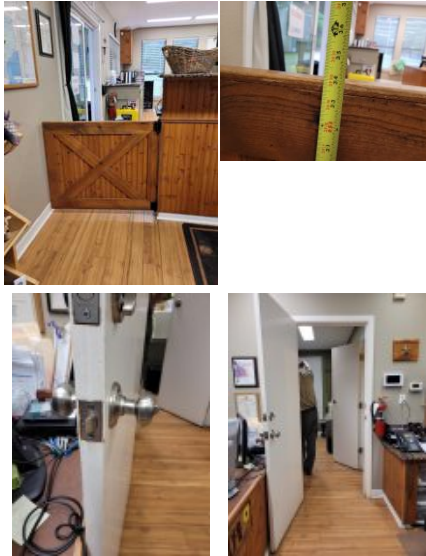


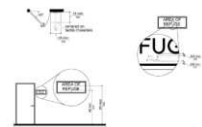
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
13	Headquarters Area: HQ - Public Spaces	[33.230726, -94.2496927]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Store - top shelf of merchandise is 54.75" AFF	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
14	Headquarters Area: HQ - Public Spaces	[33.2307192, -94.2497088]	The transaction counter is too high. A portion of the counter surface that is 36 inches long minimum and 36 inches high maximum above the finish floor shall be provided. Knee and toe space must be provided for a forward approach. A 30 inch by 48 inch clear floor space on an accessible route must be provided for either a forward or parallel approach.	Store - service counter 47.5" AFF	Lower 36" wide segment of service counter to max 36" aff	2015 ABAAS Section: 904.4.2, 904.4.1 2012 TAS Section: 904.4.1, 904.4.2 2010 ADAS Section: 904.4.2, 904.4.1		
15	Headquarters Area: HQ - Public Spaces	[33.2307114, -94.2496444]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	no close AR to pay box, reach from road is 73" plus, you'd have to drive all the way around parking to get to ramp	Provide a curb ramp for access to the pay station.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
16	Headquarters Area: HQ - Public Spaces	[33.2307058 , -94.249703 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Egress doors shall provide a continuous and unobstructed way of egress travel from any point in a building or facility that provides an accessible route to an area of refuge, a horizontal exit, or a public way.	8.8% slope on push side, loose mat, lacks accessible exit signage	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. Provide require egress signage having Braille and raised lettering.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
17	Headquarters Area: HQ - Employee Spaces	[33.2307069 , -94.249668 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	employee area, half door to area from check in counter - lacks clearance on both sides; from open work space to office area - knob; sliding door - 6" clearance on interior side, loose rug not secured, 2" CIL, 15 LBF, 9% slope	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space, replace hardware with lever hardware where indicated, provide required maneuvering clearance on push and pull side of doors, secure loose floor mat, repair, bevel, or ramp CIL at door entries to max .25", inspect, adjust, and maintain 8.5 LBF to open exterior doors as a smart practice, correct or repair slope at doorway landing to max 2.08% in any direction for level CFS	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

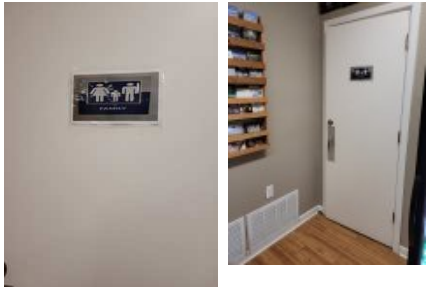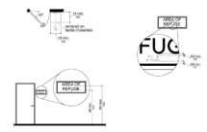
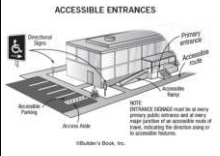

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

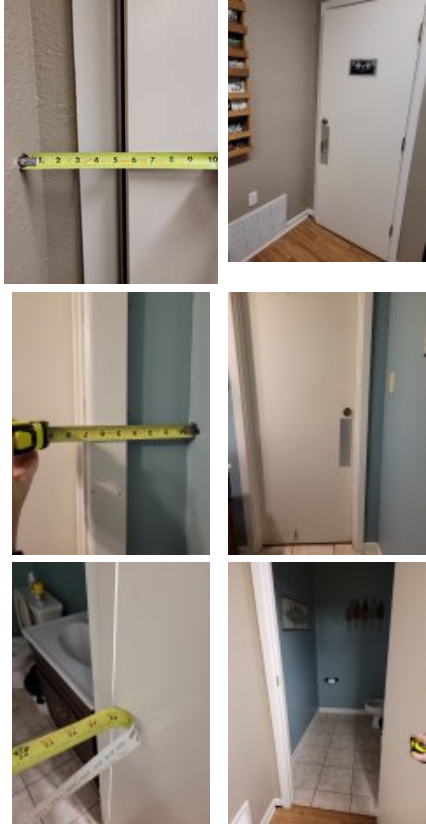






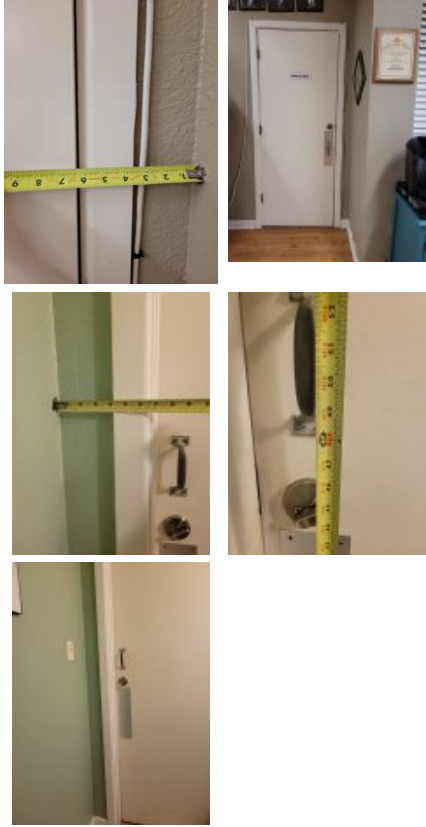


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
18	Headquarters Area: HQ - Family Restroom	[33.2307316 , -94.249706 1]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	No directional signage	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom.	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		
19	Headquarters Area: HQ - Family Restroom	[33.2307417 , -94.249711 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Non compliant signage, non compliant location	Acquire and mount signage, including Braille and raised lettering mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
20	Headquarters Area: HQ - Family Restroom	[33.2307304 , -94.249707 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm).	Restroom door - 5.25" clearance on the pull side, clearance on push side 7.5", 28" width	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

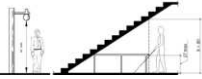





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
21	Headquarters Area: HQ - Employee Restroom	[33.2307293 , -94.249696 7]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply, the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	Lacks directional signage	Restroom not accessible, acquire and mount signage directing employees to accessible restroom	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		
22	Headquarters Area: HQ - Employee Restroom	[33.2307237 , -94.249711 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Non compliant signage	Replace sign with one of contrasting colors that includes Braille and raised characters, mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


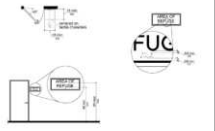

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
23	Headquarters Area: HQ - Employee Restroom	[33.2307215, -94.2497007]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Relocate hardware to be 34 inches minimum and 48 inches maximum above the finish floor or ground.	6" clearance on pull, 7" clearance on push, handle 49" AFF	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. Relocate hardware to be 34 inches minimum and 48 inches maximum above the finish floor or ground.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


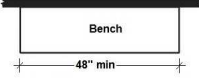

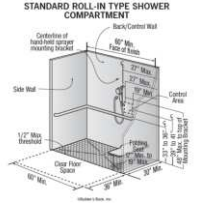
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
24	Employee Areas: Maintenance	[33.2338277 , -94.2498308]	There is no accessible route to the car ports. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No accessible route (AR) to 2 of 2 exterior car ports	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the car ports	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
25	Employee Areas: Maintenance	[33.2336942 , -94.2497544]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Shed office at maintenance- 12"CIL, knob, clearance on pull 3.5"	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
26	Employee Areas: Maintenance	[33.2337435 , -94.249947 5]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Break room - Eye wash projects 19"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	 	
27	Employee Areas: Maintenance	[33.2337346 , -94.249979 7]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Doors within break room - by fridge - knob, 2.5" CIL, clearance on push reduced by shelf, door by bathroom-10" clearance due to tool box, interior door has fast closer, 10# push, main entry-opener on bottom 10", 1.5" CIL, 10.8% slope	For employee spaces, relocate storage, shelving, furniture, and other obstacles (toolbox) at doorways to provide approach, enter and exit at the employee space. For all doors along the public circulation route, replace hardware with lever hardware where indicated Repair, bevel, or ramp CIL along AR Remove door hold open from push side For all doors along the public circulation route, inspect, adjust, and maintain 8.5 LBF to open exterior doors as a smart practice For all doors along the public circulation route, correct or repair slope at doorway landing to max 2.08% in any direction for level CFS	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	      	




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								





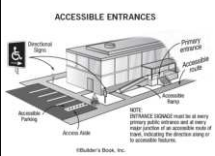
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
28	Employee Areas: Maintenance	[33.237913, -94.2552194]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	No AR to closet at day use restroom building, 23" wide door opening	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Create AR with crushed and compacted stone or similar outdoor material from parking or sidewalk to the building For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	  	
29	Employee Areas: Maintenance	[33.2337525, -94.2499368]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility.	Restroom is not accessible	Restroom not accessible, acquire and mount signage directing employees to accessible restroom	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8	  	

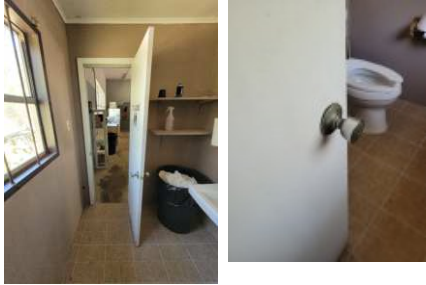




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
30	Employee Areas: Maintenance	[33.2338781, -94.249926]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Restroom signage is not compliant	Replace sign with one of contrasting colors that includes Braille and raised characters, and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
31	Employee Areas: Maintenance	[33.2337727, -94.249985]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308.	71" AFF to hook in restroom	Remount at least one hook to max 48" AFF	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
32	Employee Areas: Maintenance	[33.2337525 , -94.250009 2]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Shower lacks bench	Acquire and install bench in dressing area having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
33	Employee Areas: Maintenance	[33.2337974 , -94.249990 4]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Shower lacks accessible features	Create an accessible shower in locker/bathing room	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		

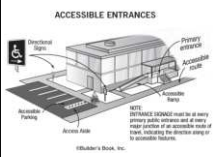


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
34	Employee Areas: Maintenance	[33.2338064 , -94.249840 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Restroom door - Lacks clearance on pull side of door, knob hardware	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
35	Employee Areas: Residence	[33.2314731 , -94.250215 7]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Residence by HQ - sloped entry, gravel lot	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Create one parking stall, on a firm and stable surface Install ramp at patio CIL	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

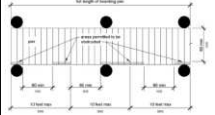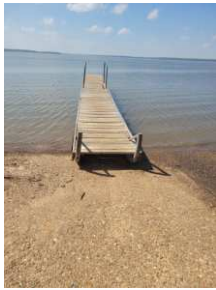



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure																		
36	Knights Bluff Boat Ramp Area: Boat Ramp - Picnic Area	[33.2343594 , -94.256269 5]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	3 of 3 tables, 1 of 1 grill lack route - dirt surface	Repair or add surface or ORAR that is firm and stable as a smart practice.	2015 ABAAS Section: 1016.2																				
37	Knights Bluff Boat Ramp Area: Boat Ramp - Parking	[33.2342124 , -94.256792 5]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (56) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (3) accessible stalls with a minimum of (1) being designed as van accessible.	0 of 56 stalls accessible	Create two 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls. Create one 8' accessible parking stalls, with one 8' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2	 <table border="1" data-bbox="2298 581 2505 678"> <thead> <tr> <th>Total Number of Parking Spaces Provided in Parking Facility</th> <th>Minimum Number of Required Accessible Parking Spaces</th> </tr> </thead> <tbody> <tr> <td>2015 ABAAS</td> <td>3</td> </tr> <tr> <td>2012 TAS</td> <td>3</td> </tr> <tr> <td>2010 ADAS</td> <td>3</td> </tr> <tr> <td>2015 ABAAS</td> <td>3</td> </tr> <tr> <td>2012 TAS</td> <td>3</td> </tr> <tr> <td>2010 ADAS</td> <td>3</td> </tr> <tr> <td colspan="2">Source of Code</td> </tr> <tr> <td colspan="2">30' clear for each stall in parallel format per 2010</td> </tr> </tbody> </table>	Total Number of Parking Spaces Provided in Parking Facility	Minimum Number of Required Accessible Parking Spaces	2015 ABAAS	3	2012 TAS	3	2010 ADAS	3	2015 ABAAS	3	2012 TAS	3	2010 ADAS	3	Source of Code		30' clear for each stall in parallel format per 2010		
Total Number of Parking Spaces Provided in Parking Facility	Minimum Number of Required Accessible Parking Spaces																									
2015 ABAAS	3																									
2012 TAS	3																									
2010 ADAS	3																									
2015 ABAAS	3																									
2012 TAS	3																									
2010 ADAS	3																									
Source of Code																										
30' clear for each stall in parallel format per 2010																										
38	Knights Bluff Boat Ramp Area: Boat Ramp - Swimming	[33.2340015 , -94.257083 5]	Beach access routes shall connect an entry point to the beach to the: 1. High tide level at tidal beaches; 2. Mean high water level at river beaches; or 3. Normal recreation water level at lake, pond, and reservoir beaches	No AR to swimming, no AR to safety float	Create a beach access route to normal recreational water level of a firm and stable material as a smart practice and extend to safety float.	2015 ABAAS Section: 1018.2																				




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
39	Knights Bluff Boat Ramp Area: Boat Ramp - Boat Launch	[33.234605, -94.257178 7]	There is no accessible route to/on the boating facility. Accessible routes serving recreational boating facilities, including gangways and floating piers, shall comply with accessible route requirements except as modified by section Recreational Boating Facilities - Accessible Routes.	Accessible Route (AR) has steps	Create an accessible route to the boat pier or make corrections for a compliant route.	2015 ABAAS Section: 1003.2 2010 ADAS Section: 1003.2		
40	Knights Bluff Boat Ramp Area: Boat Ramp - Boat Launch	[33.2342855, -94.256973 1]	There is no accessible route to the the canoes At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No route to canoes	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the canoes	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
41	Knights Bluff Boat Ramp Area: Boat Ramp - Boat Launch	[33.2344548, -94.256872 5]	There is no accessible route to fishing line disposal At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No route to fishing line disposal	Create an accessible route with crushed stone or other outdoor material from parking or walkway to fishing line disposal.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
42	Knights Bluff Boat Ramp Area: Boat Ramp - Boat Launch	[33.2346443 , -94.2574054]	The boat slip/pier is not wide enough. Boat slips and boarding piers shall provide clear pier space 60 inches wide minimum and at least as long as the boat slips/boarding pier. Each 10 feet maximum of linear pier edge serving boat slips and boarding piers shall contain at least one continuous clear opening 60 inches wide minimum. The clear width shall be permitted to be reduced to 36 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 60 inches long minimum and 60 inches wide minimum.	38" wide pier, 40' long	Provide 60" wide clearance at accessible slips and a 60" wide opening every 10'.	2015 ABAAS Section: 1003.3.1 2012 TAS Section: 1003.3.1 2010 ADAS Section: 1003.3.1	 	
43	Knights Bluff Boat Ramp Area: Boat Ramp - Boat Launch	[33.2346499 , -94.2574174]	The minimum number of boarding piers are not accessible. Where boarding piers are provided at boat launch ramps, at least 5 percent, but no fewer than one, of the boarding piers be accessible.	13.5" CIL to pier	Provide 5%, but not less than one accessible boarding pier at boat launches. Ramp entry for access.	2015 ABAAS Section: F235.3 2010 ADAS Section: 235.3	 	


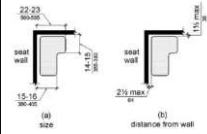

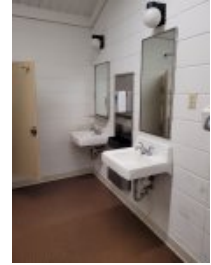
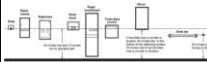
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
44	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350033 , -94.254487 1]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Across from restroom, no AR to picnic area amenities	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity as a smart practice.	2015 ABAAS Section: F244.5.1		
45	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350358 , -94.254571 6]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	site 22 - Non compliant table	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
46	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2349909 , -94.254582 3]	Picnic tables are required to have clear ground space 36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches.	site 22 - 26" around side of table	Provide required 36" clear ground space around all usable portions of the table as a smart practice.	2015 ABAAS Section: 1011.2.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
47	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350178 , -94.254507 2]	Clear ground space 48 inches (1220 mm) by 48 inches (1220 mm) should be provided on all usable sides of the fire ring, grill, fireplace, and woodstove. Center the space on each usable side of the grill, fireplace, and woodstove.	site 22 - Non compliant surface	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice.	2015 ABAAS Section: 1011.2		
48	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2349999 , -94.254485 8]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground.	Site 22 - Fire building surface at ground level	Correct fire building surface to be 9" min above the ground as a smart practice. In the alternative, replace fire ring with a compliant accessible fire ring.	2015 ABAAS Section: 1011.5.1		
49	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350313 , -94.254501 9]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground	Site 22 - spout 20" Above Ground Level (AGL)	Remount water spouts to 28" min or 36" max above the ground as a smart practice	2015 ABAAS Section: 1011.6		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
50	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.23045, -94.24969]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	No accessible sites, 0 of 23 camp sites	Create the required number of accessible camp sites (two) per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		
51	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350448, -94.2545126]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum.	Site 22, RV parking space - 11 ft 1' width-pull through	Correct RV parking space to be 20' wide minimum as a smart practice.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION	 	
52	Knights Bluff Camping Area: Knights Bluff - Campsite	[33.2350268, -94.2546038]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Site 22 - 5.9% slope	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION	 	


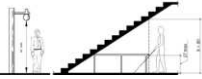

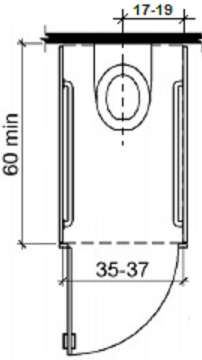
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
53	Knights Bluff Camping Area: Knights Bluff - Parking	[33.23513, -94.2542015]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (8) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	0 of estimated 8 stalls at restroom building with showers are accessible	Create one 8' accessible parking stalls, with one 8' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
54	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.235121, -94.2542015]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground.	Door - Wall to shower blocks door pull clearance, door sweep broken	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, provide kick plate on push side of door from floor to 10" AFF.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


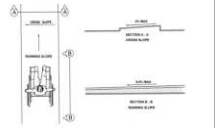

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
55	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.235121, -94.254212 2]	The bench is not deep enough and not long enough Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Bench does not comply, 12" deep, 34" wide	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
56	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351076, -94.254190 7]	Alternate roll-in type shower compartments shall be 36 inches (915 mm) wide and 60 inches (1525 mm) deep minimum clear inside dimensions measured at center points of opposing sides. A 36 inch (915 mm) wide minimum entry shall be provided at one end of the long side of the compartment.	34" wide stall	Enlarge shower stall, if feasible, to compliant dimensions for an alternate roll in shower of 36" deep by 60" wide with a 36" opening on the long dimension	2015 ABAAS Section: 608.2.3 2012 TAS Section: 608.2.3 2010 ADAS Section: 608.2.3		
57	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351166, -94.254196 1]	The side grab bar is missing In alternate roll-in type shower compartments, grab bars shall be provided on the back wall and the side wall farthest from the compartment entry. Grab bars shall not be provided above the seat. Grab bars shall be installed 6 inches maximum from adjacent walls.	Lacks side wall bars	Provide grab bars in the shower mounted in the correct locations for the shower type	2015 ABAAS Section: 608.3.3 2012 TAS Section: 608.3.3 2010 ADAS Section: 608.3.3		

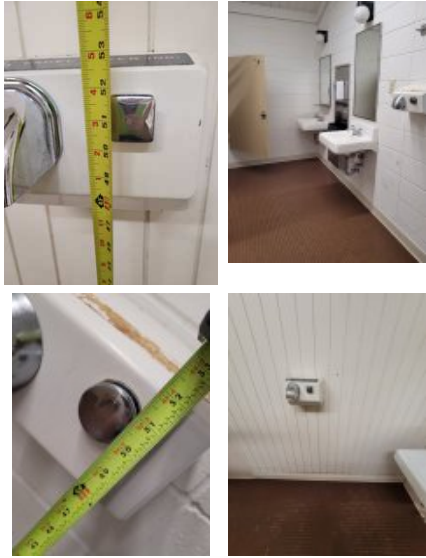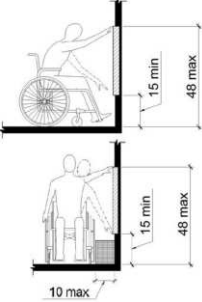Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
58	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351166 , -94.254185 4]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Rear edge of seat 21.5" from wall, takes more than 5 LBF to operate	Remount shower seat to the correct location and height in the shower. Adjust seat so operating force is less than 5 LBF	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2		
59	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350537 , -94.254153 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	0 of 2 mirrors complies, bottom of left mirror surface is 40.25" AFF, right mirror is 42" AFF	Raise one mirror so top of reflective surface is min. 74" AFF (and bottom of reflecting surface is max 40" AFF)	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	 	



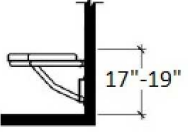
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
60	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350986 , -94.254131 7]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Dryer button 51" AFF	Remount operable parts to be in reach range of 15" min to 48" max. In the alternative, leave as is citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
61	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350807 , -94.254206 8]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair accessible stall, ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

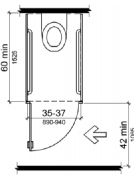
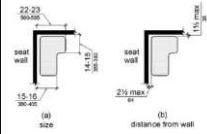
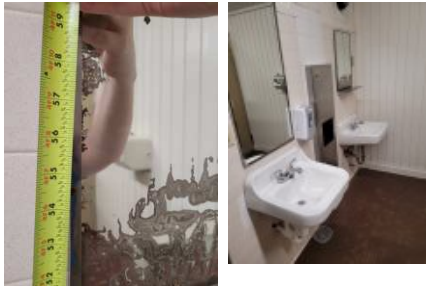
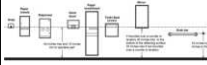
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
62	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350986 , -94.254196 1]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hooks 67" and 65.25" AFF	Remount at least one hook to max 48" AFF	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
63	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351166 , -94.254217 6]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	31" width	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing stall to create required wheelchair stall.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		
64	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351255 , -94.254185 4]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars too high	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		






Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
65	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2351031 , -94.254196 1]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sink projects 16" and Dryer projects 9.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of items.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
66	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350986 , -94.254196 1]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20" from flusher side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		


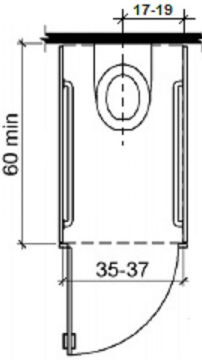


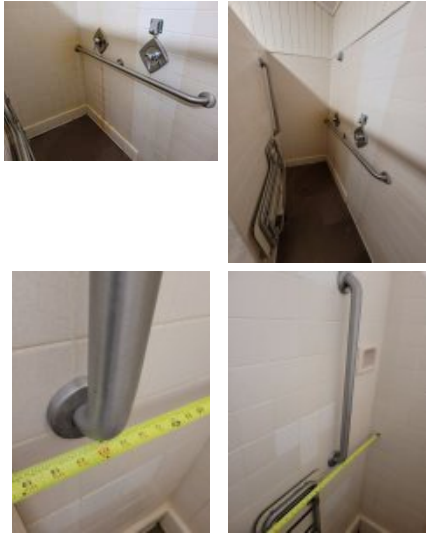
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
67	Knights Bluff Camping Area: Knights Bluff - Men's Restroom	[33.2350627 , -94.254174 7]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.9% cross slope at ambulatory stall	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
68	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351143 , -94.254193 4]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hooks 67" AFF	Remount at least one hook to max 48" AFF	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		


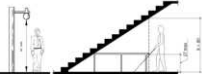
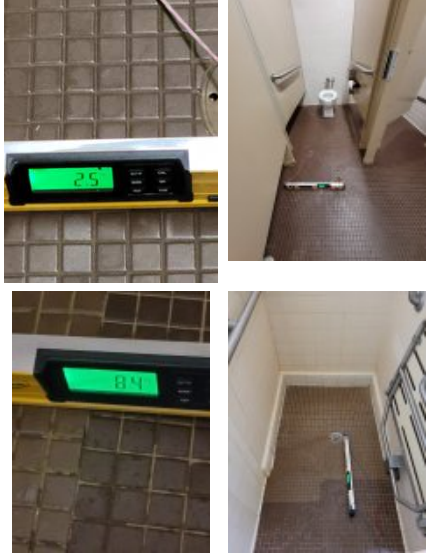
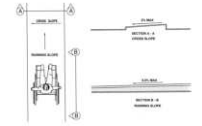
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
69	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351883 , -94.254153 2]	The bench is not deep enough and not long enough Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Bench 12" x 34", lacks side Clear Floor Space (CFS)	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
70	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2350717 , -94.254163 9]	Alternate roll-in type shower compartments shall be 36 inches (915 mm) wide and 60 inches (1525 mm) deep minimum clear inside dimensions measured at center points of opposing sides. A 36 inch (915 mm) wide minimum entry shall be provided at one end of the long side of the compartment.	34" width, 35.75" entry to compartment width	Enlarge shower stall, if feasible, to compliant dimensions for an alternate roll in shower of 36" deep by 60" wide with a 36" opening on the long dimension	2015 ABAAS Section: 608.2.3 2012 TAS Section: 608.2.3 2010 ADAS Section: 608.2.3		

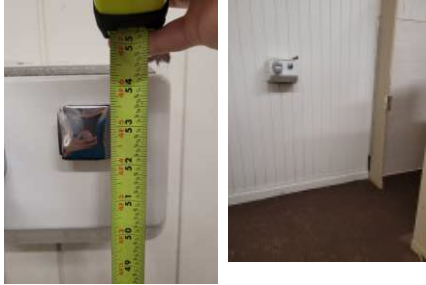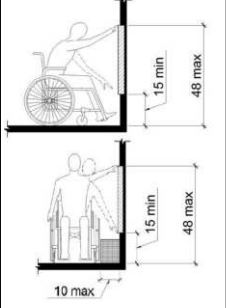
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
71	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351255 , -94.254174 7]	The side grab bar is missing In alternate roll-in type shower compartments, grab bars shall be provided on the back wall and the side wall farthest from the compartment entry. Grab bars shall not be provided above the seat. Grab bars shall be installed 6 inches maximum from adjacent walls.	Grab bar missing from side wall, vertical bar is 16" from side wall	Provide grab bars in the shower mounted in the correct locations for the shower type	2015 ABAAS Section: 608.3.3 2012 TAS Section: 608.3.3 2010 ADAS Section: 608.3.3		
72	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2350986 , -94.254153 2]	The shower seat height is noncompliant. A seat in a standard roll-in shower compartment shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches of the compartment entry. A seat in an alternate roll-in type shower compartment shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches of the compartment entry. The top of the seat shall be 17 inches minimum and 19 inches maximum above the bathroom finish floor.	Seat is broken so edge is 24"	Remount shower seat to the correct location and height in the shower	2015 ABAAS Section: 610.3 2012 TAS Section: 610.3 2010 ADAS Section: 610.3		

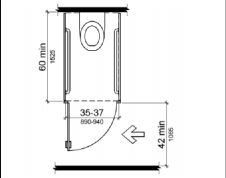
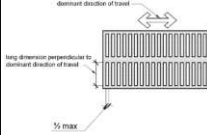
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
73	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2350807 , -94.254196 1]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	20" to side wall, thick part of L is 21", thin part is 13.5"	Remount shower seat to the correct location and height in the shower.	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2		
74	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351704 , -94.254217 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	1 of 2 mirrors complies; higher mirror surface is 55" AFF	Leave as is second mirror, first one complies	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		


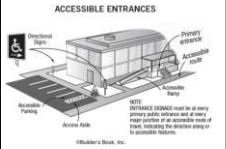

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
75	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351255 , -94.254196 1]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Dryer button 52.25" AFF	Remount operable parts to be in reach range of 15" min to 48" max. In the alternative, leave as is citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
76	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2350986 , -94.254174 7]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	2 standard, 1 ambulatory; lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
77	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351255 , -94.254185 4]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	stall 38" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing stall to create required wheelchair stall.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		

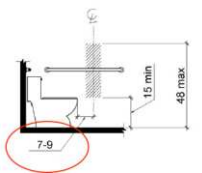



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
78	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351345, -94.2541854]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20.1" from flusher side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls or 16" to 18" in the new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		
79	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351883, -94.2541747]	The stall door fails to comply with some of the door requirements. The stall door have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self closing, small outside hardware	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
80	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351704, -94.2541317]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet paper too close to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		


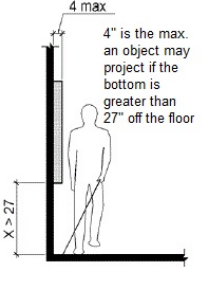

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
81	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.235139, -94.25418]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer projects 9.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
82	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351345, -94.2542176]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.5% cross slope at ambulatory stall, 8.4% running slope at shower	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		


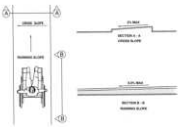
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
83	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351076 , -94.254196 1]	<p>Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. The threshold has a gap greater than 1/2 inch wide. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight</p>	Door - 35" back to wall on pull side, clearance on push 9.5" to wall	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.					
84	Knights Bluff Camping Area: Knights Bluff - Women's Restroom	[33.2351345 , -94.254196 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" gap on way to men's from parking, 3" front of men's	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		

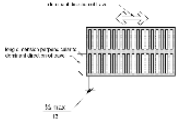

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
85	Day Use Area: Day Use - Volleyball	[33.2371626 , -94.255816 2]	There is no accessible route to the site elements At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No AR to 2 of 2 horseshoes, no AR to volleyball, no AR to 4 of 4 benches	Create an accessible route with crushed stone or other outdoor material from parking or walkway to one of each of the site elements	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
86	Day Use Area: Day Use - Group Picnic Pavilion	[33.2373645 , -94.255329 3]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	0 of 10 accessible	Replace two picnic tables with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		



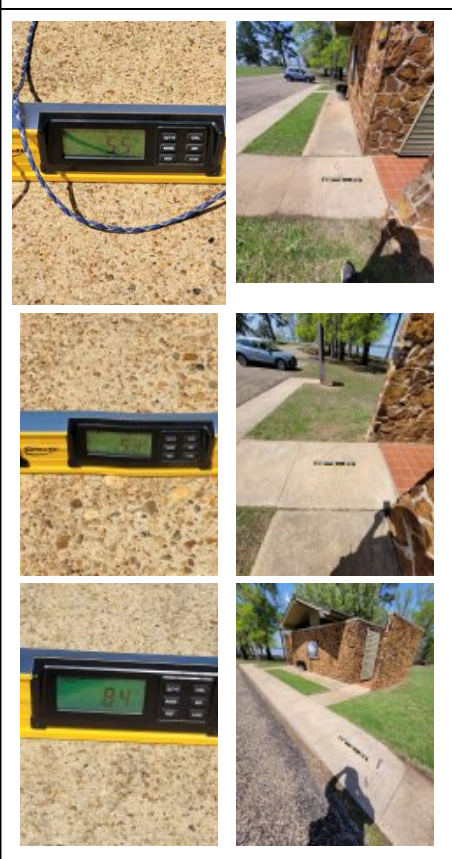

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
87	Day Use Area: Day Use - Group Picnic Pavilion	[33.23045, -94.24969]	Picnic facilities shall provide outdoor recreation access routes complying with 1016 in accordance with F245.4 and 245.4 of IAC	No route to shelter, 33" width at entry due to table placement	Create ORAR with crushed and compacted stone or similar outdoor material from parking or sidewalk to shelter or picnic area Relocate picnic table to provide 36" min clear entry to shelter	2015 ABAAS Section: F245.4		
88	Day Use Area: Day Use - Group Picnic Pavilion	[33.2373712, -94.255324]	Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch (13 mm) diameter except as allowed in 407.4.3, 409.4.3, 410.4, 810.5.3 and 810.10. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel. Floor or ground surface within required maneuvering clearances shall comply with 302. Changes in level are not permitted.	1" gap down middle	Correct or fill gap in doorway to max .5" as a smart practice.	2010 ADAAS Section: 302.3, 404.2.4.4		
89	Day Use Area: Day Use - Group Picnic Pavilion	[33.2373679, -94.2553253]	Where picnic facilities contain two or fewer picnic units, each picnic unit shall provide mobility features complying with F245.2.	34" width to grill due to trash can	Relocate trash can to provide 36" clear wide route.	2015 ABAAS Section: F245.2.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure																																				
90	Day Use Area: Day Use - Group Picnic Pavilion	[33.2373667 , -94.2553065]	Objects project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Fire extinguisher projects 7"	Relocate object to not protrude into the circulation path.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2																																						
91	Day Use Area: Day Use - Parking and Exterior Accessible Route	[33.2373555 , -94.2553334]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (42) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (3) accessible stalls with a minimum of (1) being designed as van accessible.	Day use restroom building - 10 accessible, 0 of 14 at pavilion accessible, parking across restroom - 0 of 18 accessible	Create two 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls. Create one 8' accessible van parking stalls, with one 8' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		<table border="1"> <thead> <tr> <th>Total Number of Parking Spaces Provided in Parking Facility</th> <th>Minimum Number of Required Accessible Parking Spaces</th> </tr> </thead> <tbody> <tr> <td>200 to 249</td> <td>5</td> </tr> <tr> <td>250 to 299</td> <td>6</td> </tr> <tr> <td>300 to 349</td> <td>7</td> </tr> <tr> <td>350 to 399</td> <td>8</td> </tr> <tr> <td>400 to 449</td> <td>9</td> </tr> <tr> <td>450 to 499</td> <td>10</td> </tr> <tr> <td>500 to 549</td> <td>11</td> </tr> <tr> <td>550 to 599</td> <td>12</td> </tr> <tr> <td>600 to 649</td> <td>13</td> </tr> <tr> <td>650 to 699</td> <td>14</td> </tr> <tr> <td>700 to 749</td> <td>15</td> </tr> <tr> <td>750 to 799</td> <td>16</td> </tr> <tr> <td>800 to 849</td> <td>17</td> </tr> <tr> <td>850 to 899</td> <td>18</td> </tr> <tr> <td>900 to 949</td> <td>19</td> </tr> <tr> <td>950 to 999</td> <td>20</td> </tr> <tr> <td>1000 and over</td> <td>20 plus 1 for each 100 in excess thereof, over 1000</td> </tr> </tbody> </table>	Total Number of Parking Spaces Provided in Parking Facility	Minimum Number of Required Accessible Parking Spaces	200 to 249	5	250 to 299	6	300 to 349	7	350 to 399	8	400 to 449	9	450 to 499	10	500 to 549	11	550 to 599	12	600 to 649	13	650 to 699	14	700 to 749	15	750 to 799	16	800 to 849	17	850 to 899	18	900 to 949	19	950 to 999	20	1000 and over	20 plus 1 for each 100 in excess thereof, over 1000
Total Number of Parking Spaces Provided in Parking Facility	Minimum Number of Required Accessible Parking Spaces																																											
200 to 249	5																																											
250 to 299	6																																											
300 to 349	7																																											
350 to 399	8																																											
400 to 449	9																																											
450 to 499	10																																											
500 to 549	11																																											
550 to 599	12																																											
600 to 649	13																																											
650 to 699	14																																											
700 to 749	15																																											
750 to 799	16																																											
800 to 849	17																																											
850 to 899	18																																											
900 to 949	19																																											
950 to 999	20																																											
1000 and over	20 plus 1 for each 100 in excess thereof, over 1000																																											


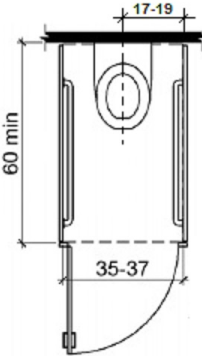

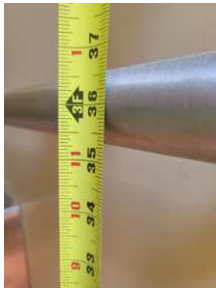
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
92	Day Use Area: Day Use - Parking and Exterior Accessible Route	[33.2378902 , -94.255307 3]	The accessible path of travel has cross slopes greater than 2%. Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as a ramp.	3.2% slope at women's restroom, 4.8% slope at men's restroom route intersection	Correct or repair sidewalk cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		


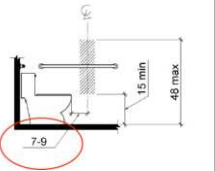

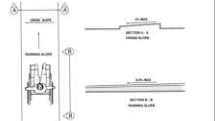
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
93	Day Use Area: Day Use - Parking and Exterior Accessible Route	[33.237888, -94.255296 6]	The running slope of walking surfaces shall not be steeper than 1:20.	8.4% slope from parking to route, 5.5% slope toward men's restroom, 5.9% slope toward women's restroom	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		


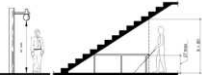

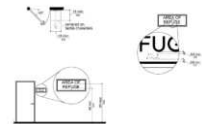
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
94	Day Use Area: Day Use - Picnic Area	[33.2372299 , -94.255499 7]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	No route to 11 of 11 grills, 4 of 4 spouts, 24 of 24 picnic tables at day use; 0 of accessible design	Repair or replace surface or ORAR to be firm and stable as a smart practice. Provide route to 3 grills and tables. Replace 5 tables with ones of an accessible design.	2015 ABAAS Section: 1016. 2		
95	Day Use Area: Day Use - Men's Restroom	[33.2379108 , -94.255250 2]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Restroom lacks accessible signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of gate, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

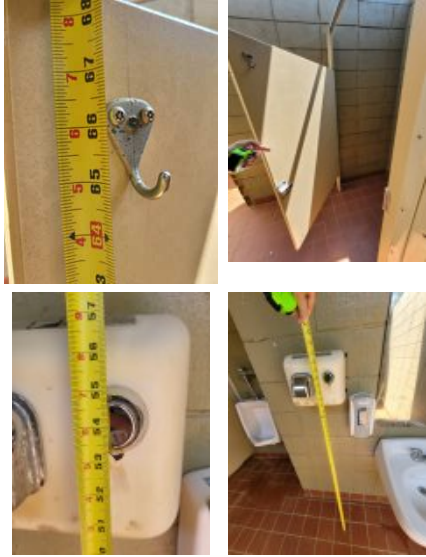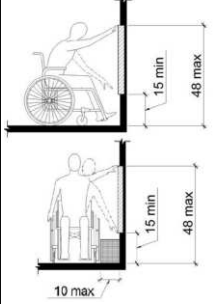




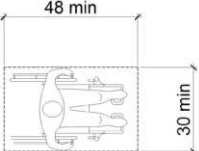
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
96	Day Use Area: Day Use - Men's Restroom	[33.2379074 , -94.255248 9]	The tactile restroom wall sign is missing the International Symbol of Accessibility (ISA). Accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Accessibility (ISA). Wall signs identifying permanent rooms and spaces of a building shall have be horizontal format and the characters raised 1/32 inch minimum and shall be sans serif uppercase characters a minimum of 5/8 inch and a maximum of 2 inches high. Contracted Grade 2 Braille shall be in a horizontal format and shall be placed a minimum of 3/8 inch and a maximum of 1/2 inch directly below the tactile characters; flush left or centered. Signs with raised characters or Braille shall be located 48 inches minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60 inches maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character.	ISA symbol missing	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character. Cost included in previous finding	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		
97	Day Use Area: Day Use - Men's Restroom	[33.2379096 , -94.255242 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes Lacks insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		





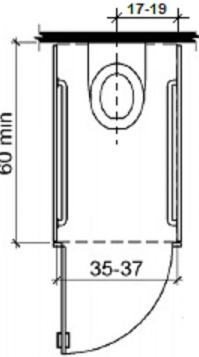
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
98	Day Use Area: Day Use - Men's Restroom	[33.2379085 , -94.255247 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	65" AFF to hook, 54" AFF to dryer button	Lower hook to 48" max. Leave as is dryer citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
99	Day Use Area: Day Use - Men's Restroom	[33.2379052 , -94.255242 2]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		





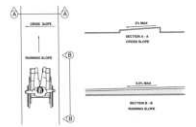
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
100	Day Use Area: Day Use - Men's Restroom	[33.2379388 , -94.2552368]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	toilet center line - 16.5" to left side, 20.5" to right side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		
101	Day Use Area: Day Use - Men's Restroom	[33.2379074 , -94.2552529]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides and be self-closing.	Stall door doesn't close all the way, small hardware on outside	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
102	Day Use Area: Day Use - Men's Restroom	[33.237904, -94.2552422]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Right grab bar, 36.5" AFF to top	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

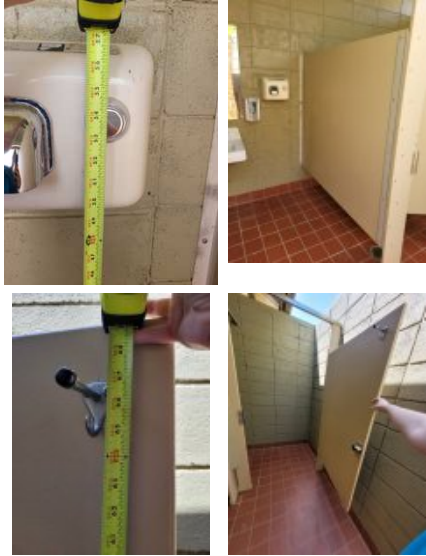
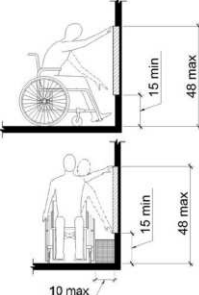

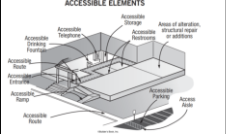
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
103	Day Use Area: Day Use - Men's Restroom	[33.2379388 , -94.2552529]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	3" to toilet paper dispenser	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		
104	Day Use Area: Day Use - Men's Restroom	[33.2379253 , -94.255269]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	3.6% cross slope at hand dryer	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

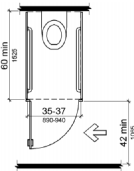

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
105	Day Use Area: Day Use - Men's Restroom	[33.2379052 , -94.255244 9]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sink projects 20" and Dryer projects 9.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of items.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
106	Day Use Area: Day Use - Women's Restroom	[33.2379164 , -94.255263 6]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Non compliant sign, no ISA	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
107	Day Use Area: Day Use - Women's Restroom	[33.2379141 , -94.255250 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Non insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
108	Day Use Area: Day Use - Women's Restroom	[33.2379164 , -94.255263 6]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Dryer button 53" AFF, hook in stall 65" AFF	Lower hook to 48" max. Leave as is dryer citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
109	Day Use Area: Day Use - Women's Restroom	[33.2378962 , -94.255244 9]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	28" width at hand soap and hand dryer	Provide required 30" by 48" CFS at operable parts	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		

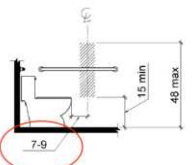
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
110	Day Use Area: Day Use - Women's Restroom	[33.2379074 , -94.255242 2]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	1 standard, 1 ambulatory; lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
111	Day Use Area: Day Use - Women's Restroom	[33.2379152 , -94.255242 2]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	ambulatory stall 37.5" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing stall to create required wheelchair stall.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		
112	Day Use Area: Day Use - Women's Restroom	[33.237913, -94.255239 5]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	toilet center line 20.5" from partition side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls or 16" to 18" in new wheelchair accessible stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		

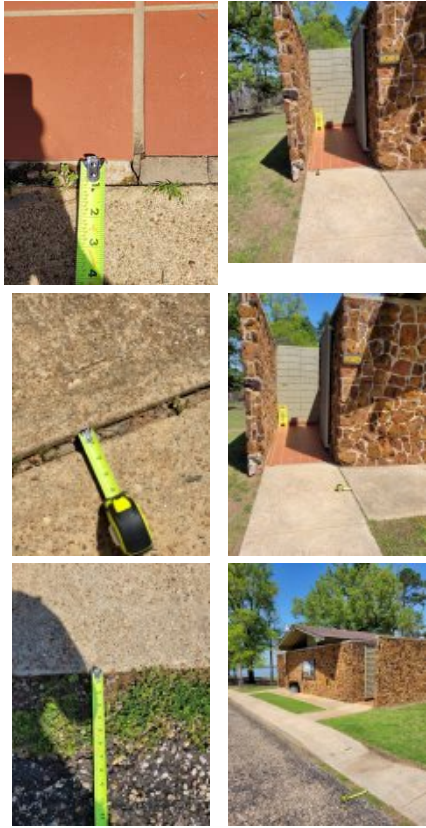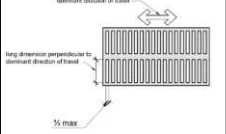
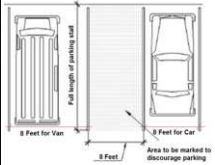


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
113	Day Use Area: Day Use - Women's Restroom	[33.2379074 , -94.255236 8]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides and the stall door must be self-closing.	Stall door not self closing, small hardware on outside of stall	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
114	Day Use Area: Day Use - Women's Restroom	[33.2379096 , -94.255247 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet paper too close to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		
115	Day Use Area: Day Use - Women's Restroom	[33.2379063 , -94.255238 1]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.7% cross slope at hand dryer	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
116	Day Use Area: Day Use - Women's Restroom	[33.2378805 , -94.255231 4]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" gap at entry to women's, 1" at corner of women's, 7.5" gap at entry to restroom from parking lot	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
117	Day Use Area: Day Use - Playground and Beach Access	[33.2378704 , -94.255067 8]	There is no accessible route to the play area. Accessible routes serving play areas shall comply with Chapter 4 and 1008.2 and shall be permitted to use the exceptions in 1008.2.1 through 1008.2.3. Where accessible routes serve ground level play components, the vertical clearance shall be 80 inches high (2030 mm) minimum.	No route to swings	Create an AR to the play area within the site.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 1008.2 2010 ADAS Section: 206.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
118	Day Use Area: Day Use - Playground and Beach Access	[33.2378513 , -94.255092]	There is no accessible route within the play area At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Swing area surface is pea gravel	Replace surface at swings with one that is firm and stable.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
119	Day Use Area: Day Use - Playground and Beach Access	[33.2391278 , -94.255784]	Beach access routes shall connect an entry point to the beach to the: 1. High tide level at tidal beaches; 2. Mean high water level at river beaches; or 3. Normal recreation water level at lake, pond, and reservoir beaches	No AR to beach	Create a beach access route to normal recreational water level of a firm and stable material as a smart practice	2015 ABAAS Section: 1018.2		

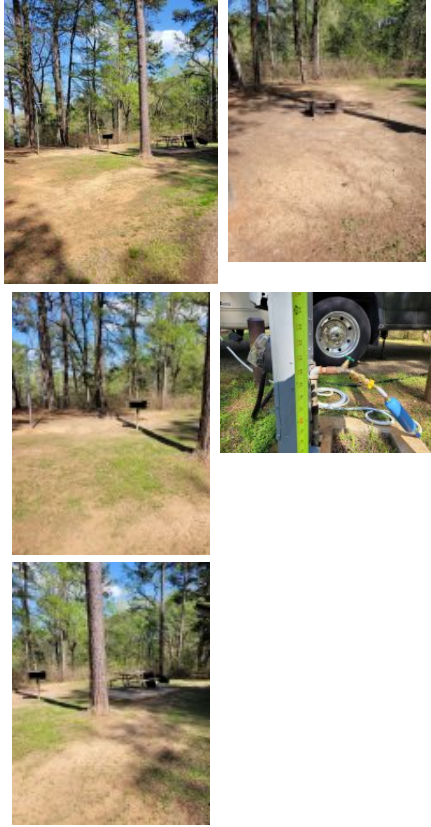
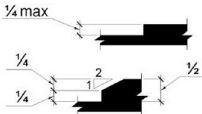
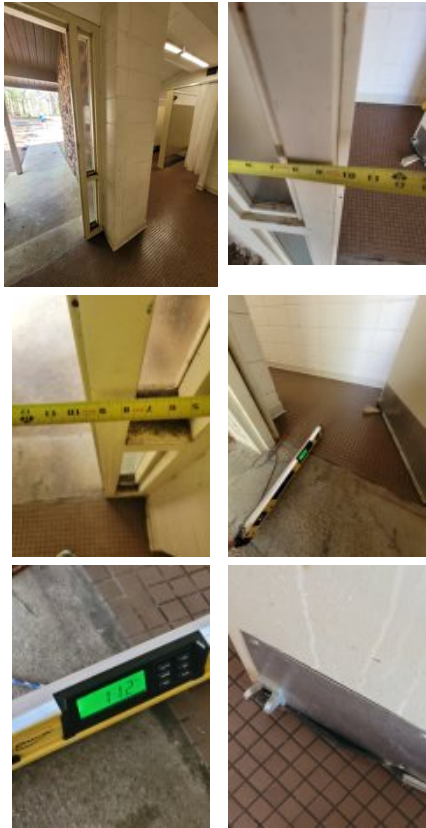
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
122	Trails: Arrowhead Trailhead	[33.23246, -94.24445]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Arrowhead and Hickory Hollow trailheads lacks firm and stable surface	Repair or replace surface of ORAR to be firm and stable as a smart practice.	2015 ABAAS Section: 1016.2		




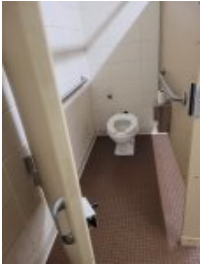
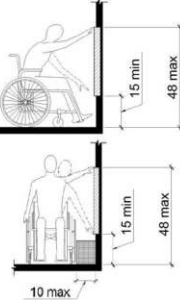
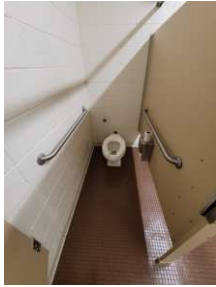
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
123	Wilkins Creek Camping Area: Wilkins Creek - Campsite 41 (Sample)	[33.2300372 , -94.235978 5]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 accessible camp sites, 19 standard camp sites; sample site lack accessible table, grill or fire ring; not route to site or amenities; water spigot low at 21"	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		
124	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2298554 , -94.235915 5]	Element meets all standards and requirements	7 standard 1 accessible	None	2010 ADAS Section: N/A		




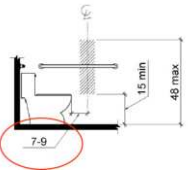
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
125	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2298027 , -94.236057 7]	The accessible parking stall lacks paint. Each parking space must be at least 8' feet wide and shall be marked to define the width. The measurements of parking spaces and access aisles shall be made from the centerline of the markings. Where the parking space is not adjacent to another parking space or access aisle, the measurement shall be permitted to include the full width of the line defining the parking space.	Stall lacks paint	Repaint stalls and access aisle to 11' and 5' or 8' and 8' for an accessible van stall.	2015 ABAAS Section: 502.2 2012 TAS Section: 502.2 2010 ADAS Section: 502.2		
126	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2298173 , -94.236064 4]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of (6) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Stall lacks van signage	Add van parking sign to 1 accessible stall	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		







Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
127	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2297949 , -94.2360671]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Stall - 2.5% slope, probable access aisle - 2.4% and 5.6% slope	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
128	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2297926 , -94.2360697]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Sign at 52.5" AGL	Raise existing accessible parking signs so lowest end of bottom sign is min 60" above ground level (AGL) measured from the surface of the stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
129	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2297971 , -94.2360644]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" gap toward woman's and men's restroom, 1" gap in middle of walk	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
130	Wilkins Creek Camping Area: Wilkins Creek - Parking and Exterior Accessible Route at Restrooms	[33.2297949 , -94.236059]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" at apparent ramp	Repair, bevel or ramp CIL along the route.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		
131	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297635 , -94.2361247]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground.	Door - wall blocks pull side clearance, 11.2% slope in door clearance, 22# push, hold open device on push side, broke sweep	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, provide kick plate on push side of door from floor to 10" AFF.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


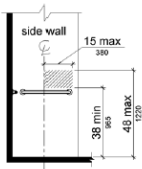


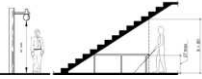



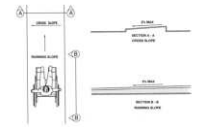
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
132	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297836 , -94.236126 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
133	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297724 , -94.236128 8]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	64.5" AFF to hook	Lower hook to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	 	
134	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297545 , -94.236118]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

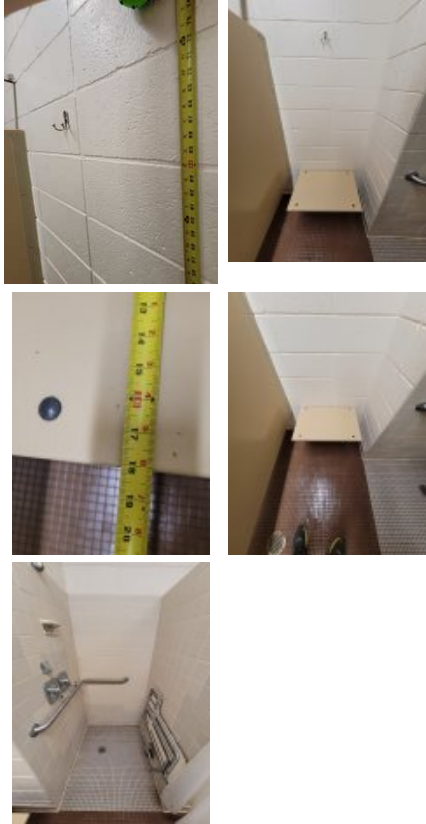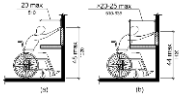


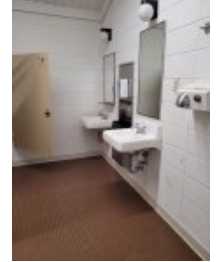
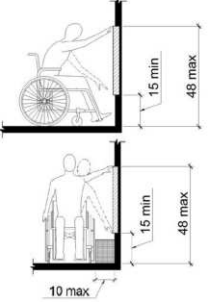

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
135	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297657 , -94.2361207]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides. The stall door must be self-closing.	Stall door lacks auto close, outside hardware too small	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
136	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297455 , -94.2361234]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Right grab bar 36.5" AFF	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
137	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297646 , -94.2361247]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	2" to centerline of toilet paper dispenser	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

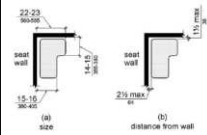


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
138	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297668 , -94.2361234]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer projects 8.5", sink projects 18"	Relocate protruding objects or place cane detectable warning or bollard at foot of items.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	 	
139	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297657 , -94.2361288]	The floor drain is set too low in the floor which causes a steep slope over 2 percent. Changes in level up to 1/4 inch may be vertical and without edge treatment. Changes in level between 1/4 inch and 1/2 inch maximum shall be beveled with a slope no greater than one unit vertical in 2 units horizontal (50-percent slope).	2.9% slope at shower drain	Correct or repair slope at drain to max 2.08%	2015 ABAAS Section: 303.3 2012 TAS Section: 303.3 2010 ADAS Section: 303.3	 	

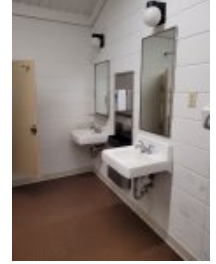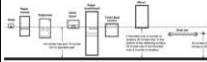Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
140	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297657 , -94.236120 7]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Hook 67" AFF over a bench	Lower hook to max 46" above the finished floor (AFF) for a side reach over a bench	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
141	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297635 , -94.236118]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	bench 26" long, 18" deep	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
142	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297657 , -94.2361207]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	Stall 39" wide, 43.5" deep	Reduce transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		


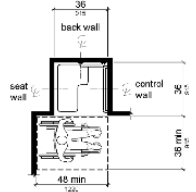
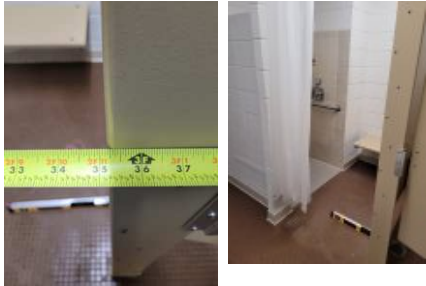
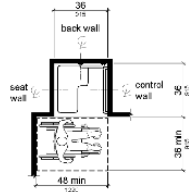
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
143	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297657, -94.2361247]	Shower controls are in the incorrect location. In transfer type shower compartments, the controls, faucets, and shower spray unit shall be installed on the side wall opposite the seat 38 inches (965 mm) minimum and 48 inches (1220 mm) maximum above the shower floor and shall be located on the control wall 15 inches (380 mm) maximum from the centerline of the seat toward the shower opening.	16" to controls from edge	Remount shower controls to the correct location in the transfer shower	2015 ABAAS Section: 608.5.1 2012 TAS Section: 608.5.1 2010 ADAS Section: 608.5.1		
144	Wilkins Creek Camping Area: Wilkins Creek - Men's Restroom	[33.2297859, -94.236118]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Rear edge 8.5" from wall	Remount shower seat to the correct location and height in the shower.	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2	 	
145	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702, -94.2361274]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom of both mirrors too high; mirror reflecting surface 40.5" AFF, shelf mirror 42" AFF	Lower one mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	  	

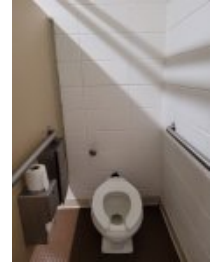Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
146	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236118]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	2 of 2 lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
147	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297635 , -94.2361127]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Hand dryer 50" AFF, hook in stall 65" AFF	Lower hook to 48" max. Leave as is hand dryer citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	 	
148	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.2361261]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	1 standard stall, 1 ambulatory stall, lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		


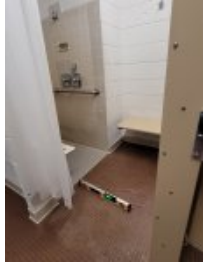
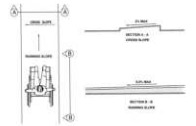


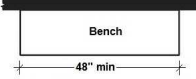


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
149	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297747 , -94.2361234]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self closing	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
150	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297635 , -94.2361247]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Both mounted 12.5" from rear wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1	 	



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
151	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297635 , -94.236128 8]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Partition side 36.75"AFF, concrete masonry wall side 36.25" AFF	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF). Price included in previous finding.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
152	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236124 7]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet paper dispenser too close to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		
153	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297657 , -94.236123 4]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer projects 8"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		


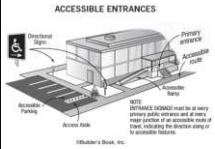
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
154	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297679 , -94.2361274]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hook 70" AFF	Remount at least one hook to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
155	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297691 , -94.2361234]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	bench dimensions fail - 18" x 26"	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		

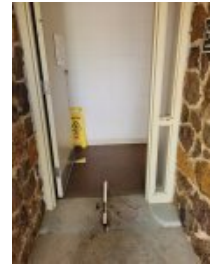
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
156	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297679 , -94.236134 1]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	shower dimension - 43.5" depth by 39" width	Reduce transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		 <p><small>Note: Inside finished dimensions measured at the center points of opposing sides.</small></p>
157	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236126 1]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	35.5" width at entry	Provide appropriate CFS on the exterior of the transfer shower.	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		 <p><small>Note: Inside finished dimensions measured at the center points of opposing sides.</small></p>


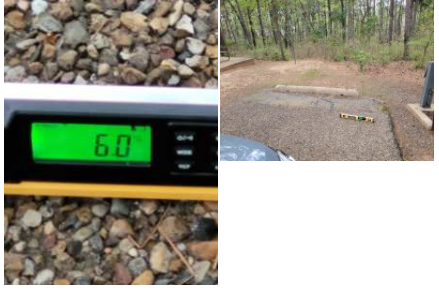


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
158	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236128 8]	Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface	grab bars at 36.5" AFF	Remount shower grab bar to 33" min. and 36" max. AFF.	2015 ABAAS Section: 609.3 Exception, 609.4 2012 TAS Section: 609.4, 609.3 Exception 2010 ADAS Section: 609.4, 609.3 Exception		
159	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297679 , -94.236128 8]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	bench mounted 9" from side wall, 14.75" at narrow part of bench	Remount shower seat to the correct location and height in the shower.	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2		






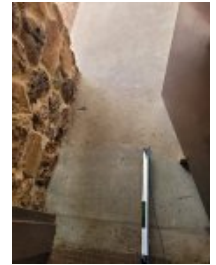

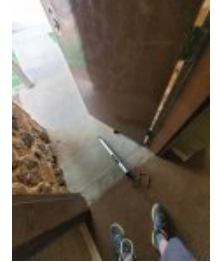

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
160	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236126 1]	The accessible route contains slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	4.2% within shower	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3	 	
161	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236123 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Door - wall obstructs back clearance, 15# push, 7.4% slope in clearance, 9.5" to wall on pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception	    	


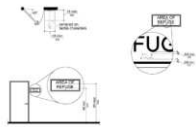
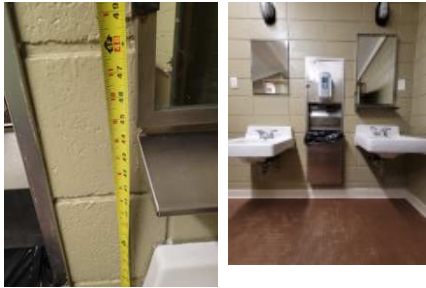
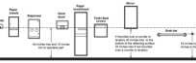

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
162	Wilkins Creek Camping Area: Wilkins Creek - Women's Restroom	[33.2297702 , -94.236126 1]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of turning spaces shall not be steeper than 1:48.	2.8% cross slope at turn to women's restroom 8.4% slope at curb ramp in front of men's restroom	Leave as is curb ramp slope citing construction tolerance. Correct cross slope at turning space along the AR to max. 2.08%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
163	Wilkins Creek Camping Area: WC - Dump Station	[33.2297186 , -94.236175 7]	The element is not accessible because the operable parts are not within the required reach range. Operable parts on accessible elements, accessible routes, and in accessible rooms and spaces shall comply with requirements for operable parts. The requirements include complying with a clear floor space, reach range, and operation.	No CFS or AR to spigot, reach 55" AGL	Provide a firm and stable route to the spigot Create a level CGS at spigot; max 2.08% slope in any direction Lower water spout to 28" to 36" above the ground	2015 ABAAS Section: F205.1 2012 TAS Section: 205.1 2010 ADAS Section: 205.1		





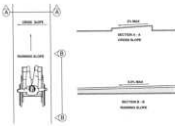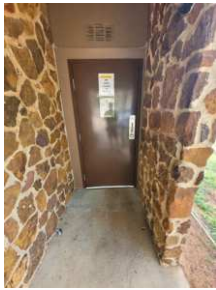



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
164	White Oak Camping Area: White Oak - Campsite #44 - Sample	[33.2355428 , -94.233993 7]	There is no accessible route to the horseshoes At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No route to horseshoe in loop	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the horseshoes	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		



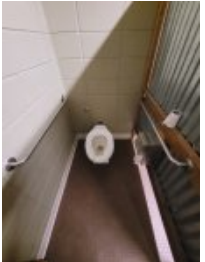
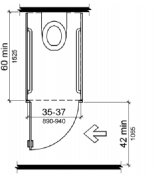

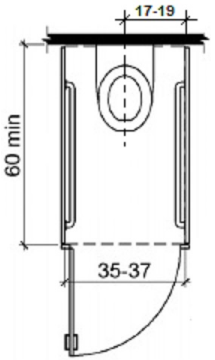
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
165	White Oak Camping Area: White Oak - Campsite #44 - Sample	[33.2350919 , -94.234640 1]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 accessible campsites, 16 standard campsites; sample site 44 - no route to amenities; lacks accessible features - table, fire ring, water spigot	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
166	White Oak Camping Area: White Oak - Campsite #44 - Sample	[33.2343369 , -94.2350116]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum. EXCEPTION: Where two adjacent parking spaces are provided for recreational vehicles, one parking space shall be permitted to be 16 feet (4880 mm) wide minimum.	parking at site - 11' 3" wide stall	Correct RV parking space to be 20' wide minimum; or 16' for two adjacent spaces as a smart practice at new accessible camping sites.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION		
167	White Oak Camping Area: White Oak - Campsite #44 - Sample	[33.2344256 , -94.2349808]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	6% slope in parking stall	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice at 2 new accessible campsites.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION		
168	White Oak Camping Area: White Oak - Parking at Restroom	[33.2340958 , -94.2352168]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (6) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	0 of estimated 6 stalls at restroom building are accessible	Create one 8' accessible parking stalls, with one 8' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2	 	

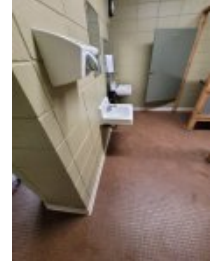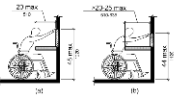


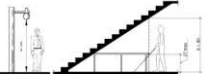
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
169	White Oak Camping Area: White Oak - Men's Restroom	[33.2341148 , -94.235274 5]	The accessible route of travel contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	4.5% cross slope at AR to men's restroom	Correct or repair cross slope along AR to max 2.08%.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3	 	
170	White Oak Camping Area: White Oak - Men's Restroom	[33.234089, -94.235270 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold has a gap greater than 1/2 inch wide. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Door - stone wall in pull side clearance, wall in push side clearance, 7.4% slope pull side, 1" gap pull side, 10# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, fill gaps at door entries to max .5". For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception	     	

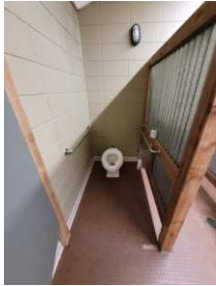

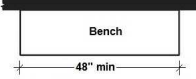
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
171	White Oak Camping Area: White Oak - Men's Restroom	[33.2341272 , -94.235278 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks accessible signage, no ISA	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
172	White Oak Camping Area: White Oak - Men's Restroom	[33.2341047 , -94.235275 8]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	45.4" AFF to mirror bottom	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
173	White Oak Camping Area: White Oak - Men's Restroom	[33.2340913 , -94.235262 4]	The urinal is located in an area that does not provide the required clear floor space for a front approach. The surrounding elements of a recessed urinal must provide a minimum of 36 by 48 inches of clear floor space for a front approach.	30.75" width to urinal (over 24" deep recess), sink ok	Relocate privacy wall at urinal to provide 36" CFS	2015 ABAAS Section: 605.2 2012 TAS Section: 605.2 2010 ADAS Section: 605.2		


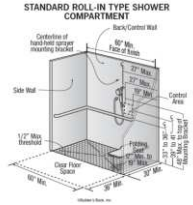


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
174	White Oak Camping Area: White Oak - Men's Restroom	[33.2341047 , -94.2352718]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
175	White Oak Camping Area: White Oak - Men's Restroom	[33.2341025 , -94.2352691]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	66" AFF to hook, 46" AFF to obstructed soap dispenser, 56" AFF to dryer,	Lower hook and hand dryer to max 48" above the finished floor (AFF) to highest operable part. Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2	    	




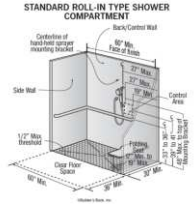
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
176	White Oak Camping Area: White Oak - Men's Restroom	[33.2340935 , -94.235257]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lack wheelchair stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
177	White Oak Camping Area: White Oak - Men's Restroom	[33.2341092 , -94.235277 1]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	ambulatory stall - 39" wide stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing stall to create required wheelchair stall.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1	 	
178	White Oak Camping Area: White Oak - Men's Restroom	[33.2341283 , -94.235282 5]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Right side 21.5" to wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 15" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		


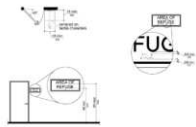


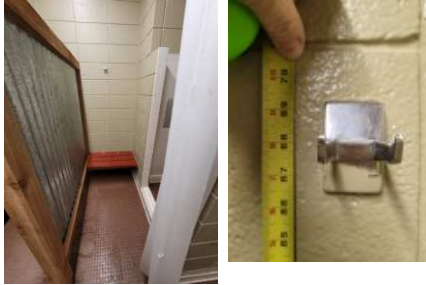
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
179	White Oak Camping Area: White Oak - Men's Restroom	[33.2341092 , -94.235278 5]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides. The stall door must be self-closing.	Stall door lacks self close, tight pinch hardware on inside	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
180	White Oak Camping Area: White Oak - Men's Restroom	[33.2340969 , -94.235277 1]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	36" long grab bar	Replace side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4 2012 TAS Section: 609.4, 609.3, 604.8.2.3 2010 ADAS Section: 609.3, 609.4, 604.8.2.3		



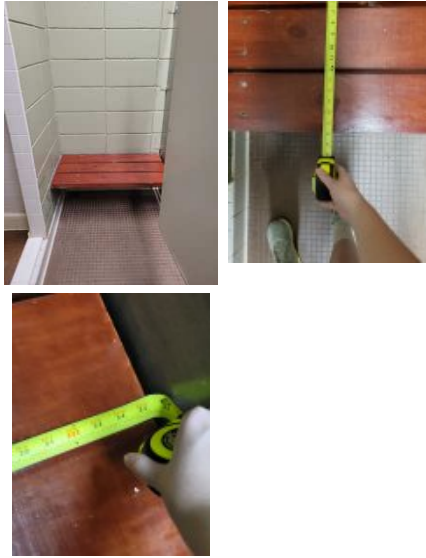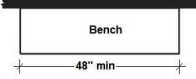


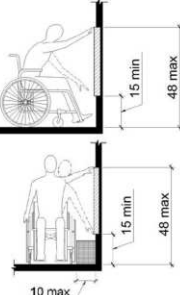

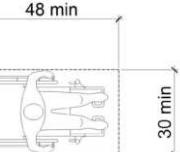
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
181	White Oak Camping Area: White Oak - Men's Restroom	[33.2340756 , -94.235286 5]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Grab bar extends 42"	Replace side grab bar with a 42" long bar mounted to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF. Cost included in previous finding	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
182	White Oak Camping Area: White Oak - Men's Restroom	[33.2340958 , -94.235270 4]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars 2.5" gap, bars only 1" diameter.	Replace grab bars in accessible stall with ones having a max gap of 1.5" and mounted to 33" to 36" above the finished floor (AFF). Cost included in previous finding	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
183	White Oak Camping Area: White Oak - Men's Restroom	[33.234107, -94.235254 4]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer 8" and sink 18" projections	Relocate protruding objects or place cane detectable warning or bollard at foot of items.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		

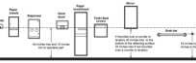

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
184	White Oak Camping Area: White Oak - Men's Restroom	[33.2341025, -94.2352919]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hook obstructed over bench, 68" AFF	Install at least one hook at max 48" AFF	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
185	White Oak Camping Area: White Oak - Men's Restroom	[33.234107, -94.2352919]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	32" wide bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		


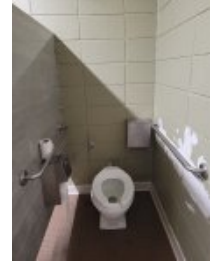
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
186	White Oak Camping Area: White Oak - Men's Restroom	[33.2341261 , -94.2352704]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	shower lacks accessible features	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		
187	White Oak Camping Area: White Oak - Women's Restroom	[33.2340868 , -94.2352865]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	hook 67" AFF	Lower hook to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5	 	


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
188	White Oak Camping Area: White Oak - Women's Restroom	[33.2341003 , -94.235274 5]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	18" x 36" bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
189	White Oak Camping Area: White Oak - Women's Restroom	[33.2341362 , -94.235278 5]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Non accessible shower	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
190	White Oak Camping Area: White Oak - Women's Restroom	[33.2341261 , -94.2352718]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Non compliant sign, non compliant location	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
191	White Oak Camping Area: White Oak - Women's Restroom	[33.2341305 , -94.2352798]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Both mirrors at 42" AFF	Lower at least one mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	 	


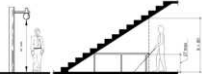
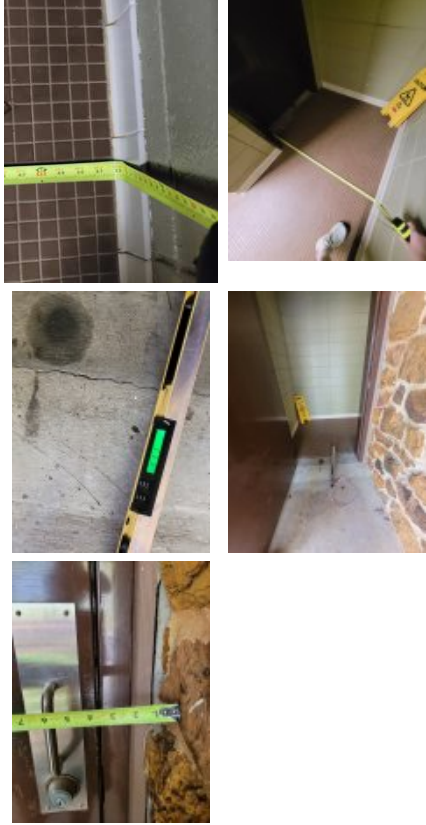
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
192	White Oak Camping Area: White Oak - Women's Restroom	[33.2341204 , -94.235283 9]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	0 of 2 lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
193	White Oak Camping Area: White Oak - Women's Restroom	[33.2341204 , -94.235281 2]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Dryer button 55" AF, outlet at 52.5" AFF	Remount dryer to be in reach range of 15" min to 48" max. Leave as is outlet citing safe harbor.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	  	
194	White Oak Camping Area: White Oak - Women's Restroom	[33.2341238 , -94.235269 1]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	CFS for sink reduced by ambulatory door door	Leave as is sink clearance as only one sink is required to be accessible.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		




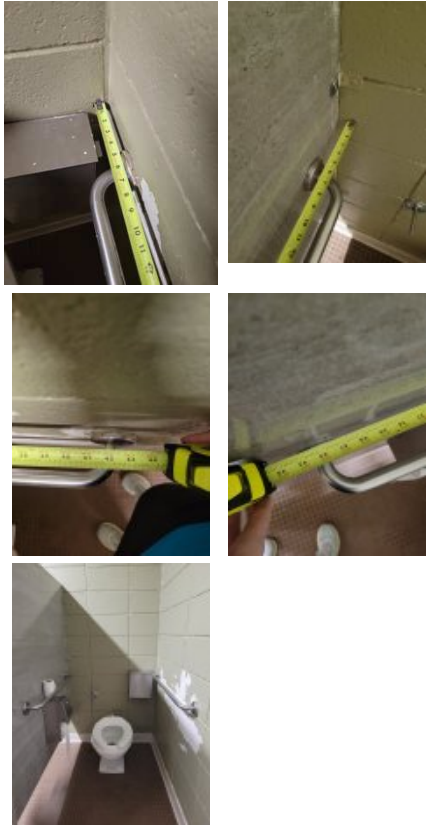


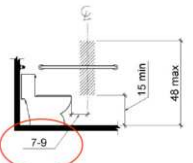


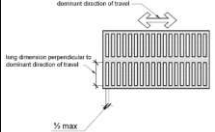
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
195	White Oak Camping Area: White Oak - Women's Restroom	[33.234107, -94.235283 9]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	1 standard stall, 1 ambulatory stall; lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
196	White Oak Camping Area: White Oak - Women's Restroom	[33.2341182, -94.235273 1]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	30.5" width, not self closing	Widen stall doors to 32" when opened to 90 degrees Adjust stall door to be self-closing Ensure stall hardware has hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


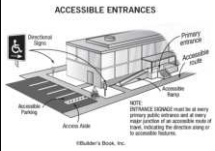



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
197	White Oak Camping Area: White Oak - Women's Restroom	[33.2341137 , -94.235273 1]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	36" long grab bars	Replace side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4 2012 TAS Section: 609.4, 609.3, 604.8.2.3 2010 ADAS Section: 609.3, 609.4, 604.8.2.3	 	

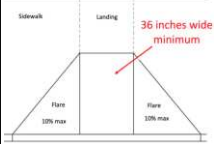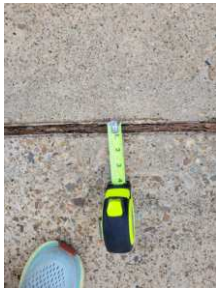
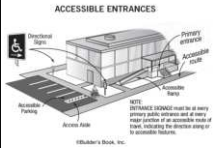
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
198	White Oak Camping Area: White Oak - Women's Restroom	[33.2341238 , -94.2352704]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	36" grab bars mounted 6" from rear wall and extends 42" to end	Cost and recommendation included in previous finding	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
199	White Oak Camping Area: White Oak - Women's Restroom	[33.2341272 , -94.235278 5]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Toilet paper on top, 3" grip clearance	Remove loose toilet paper from grab bar. Assure new grab bars have a max gap of 1.5" between grip surface and wall.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
200	White Oak Camping Area: White Oak - Women's Restroom	[33.2341317 , -94.235277 1]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet paper dispenser too close to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
201	White Oak Camping Area: White Oak - Women's Restroom	[33.2341317 , -94.235286 5]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer projects 8"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
202	White Oak Camping Area: White Oak - Women's Restroom	[33.2340935 , -94.235262 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 LBF as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Door - On push side, latch approach 52" back, 13# push, 11.1% slope, clearance on pull 3.5" due to rock wall	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 LBF to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
203	White Oak Camping Area: White Oak - Women's Restroom	[33.2341204 , -94.235283 9]	The curb ramp does not meet minimum width requirements. Curb ramps must be a minimum 36 inches in width.	Curb ramp at restroom from lot is 35" in width	Re-cut or re-pour curb ramp in the sidewalk to be max running slope 8.33%, max cross slope 2.08%, having a top landing as wide as the ramp and 36" deep and side flares max slope 10%	2015 ABAAS Section: 405.5, 406.1 2010 ADAS Section: 405.5, 406.1	 	
204	White Oak Camping Area: White Oak - Women's Restroom	[33.2341092 , -94.235275 8]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	.75" gap at women's, .75" gap at top of curb ramp, .75" gap at men's entry	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	     	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
205	Wilkins Creek Boat Ramp Area: Boat Ramp	[33.2366013 , -94.2353034]	There is no accessible route to the fishing line recycling At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Fishing line recycling at boat ramp lacks route	Create an accessible route with crushed stone or other outdoor material from parking or walkway to fishing line recycling	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
206	Wilkins Creek Boat Ramp Area: Boat Ramp	[33.2367315 , -94.2353879]	Element meets all standards and requirements	Wilkins Creek boat ramp complies	None	2010 ADAS Section: N/A		
207	Wilkins Creek Boat Ramp Area: Parking	[33.2365097 , -94.2355601]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (25) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	0 of estimated 25 accessible stalls	Create one or more 8' accessible parking stalls, with one 8' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
208	Wilkins Creek Boat Ramp Area: Canoe Access	[33.2365737 , -94.235299 9]	There is no accessible route to the the canoes At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No route to canoes	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the canoes.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		

**TEXAS PARKS AND WILDLIFE DEPARTMENT
ATLANTA STATE PARK**

**AMERICANS WITH DISABILITIES ACT COMPLIANCE INITIATIVE
PROGRAM AND POLICY REPORT
JULY 28, 2023**

INTRODUCTION

The Texas Parks and Wildlife Department (TPWD) is subject to the many requirements of the Americans with Disabilities Act (ADA). To assist it in meeting those requirements, TPWD retained The WT Group, LLC (WTG) Accessibility Practice in 2021.

Title II of the ADA applies to TPWD sites, along with 89,000 other units of state and local government. WTG has a broad scope of work that matches the ADA requirements found in title II. It includes:

- Schedule and conduct project management meetings;
- Conduct access audits of 89 sites, including Atlanta State Park;
- Prepare a site report that describes deficits at Atlanta State Park, and suggests solutions to those deficits;
- Provide guidance regarding the programs or opportunities Texans can enjoy at Atlanta State Park;
- Conduct community engagement events to determine the access preferences and priorities of Texans who visit Atlanta State Park;
- Provide a Atlanta State Park Transition Plan that identifies deficits, notes solutions, identifies the officer responsible for barrier removal, and notes the phase or timing of barrier removal;
- Provide a GIS shapefile regarding the accessibility of Atlanta State Park;
- Provide a method of tracking barrier removal at Atlanta State Park; and
- Report to TPWD leadership and stakeholders.

THIS REPORT

This report addresses program and policy advice, and then the WTG observations of deficits at Atlanta State Park. Other deliverables are provided separately.



What is a Program?

A unit of state or local government is required to make the “programs” it offers accessible to people with and without disabilities. The term “program” is broadly defined as an opportunity made available by the state to the public, and the term public includes both people with and without disabilities. As an example, if a state park offers camping it must make certain that some campsites are of an accessible design.

The number to be made accessible is called scoping and it is usually a percentage or ratio of the similar sites. For example, if a state park has outdoor constructed features such as grills, fire pits, and benches, it must make 20% of an accessible design. Those 20% accessible must be dispersed throughout the park.

In an ADA context, “programs” at a state park include but are not limited to:

Hiking	Fishing
Camping	Bird Watching
Swimming	Playgrounds
Lodging	Beaches
Boating	Interpretive activities
Parking	Visitor Centers
Trams	Picnicking
Sports fields	Viewing areas
Restrooms	Grilling

The Federal and Texas Accessibility Standards

The current Texas Accessibility Standards (TAS 2012) became effective in 2012 after an amendment process. Those Standards are almost identical to the federal 2010 Standards for Accessible Design, and both effectively address parking, entries, restrooms, and other typical building elements. They also address playgrounds, boating and fishing areas, and sports fields and courts. They do not however address some of the assets at Atlanta State Park. Trails, campsites, and picnic areas are not yet a final and enforceable state or federal standard.

That will change at the end of 2023 or early 2024. The Texas Department of Licensing and Regulation (TDLR) has signaled its intent to adopt the pending federal guidance for key outdoor assets integral to TPWD sites like Atlanta State Park. This includes trails, beaches, campsites, picnic areas, viewing areas, and constructed park assets like grills, fire pits, and benches.

In discussing the Standards, it is important to use the correct definition of park assets. Most definitions are found in TAS 2012 at section 106. As noted above, TDLR plans to add the pending federal guidance regarding some outdoor areas to TAS. It is important to remember that the Standards set the floor, not the ceiling. Making a slope more gentle, or a route wider, is always a smart practice with universal design benefits.

Some selected definitions of park assets common to TPWD are noted below.



- **Trail:** A pedestrian route developed primarily for outdoor recreational purposes. A pedestrian route developed primarily to connect elements, spaces, or facilities within a site is not a trail.
- **Trailhead:** An outdoor space that is designed by an entity responsible for administering or maintaining a trail to serve as an access point to the trail. The junction of two or more trails or the undeveloped junction of a trail and a road is not a trailhead.
- **Picnic Facility:** A site or portion of a site developed for outdoor recreational purposes that contains picnic units.
- **Picnic Unit:** An outdoor space in a picnic facility used for picnicking that contains outdoor constructed features.
- **Outdoor Constructed Features:** Picnic tables, fire rings, grills, fireplaces, wood stoves, trash and recycling receptacles, water hydrants, utility and sewage hookups, outdoor rinsing showers, benches, and viewing scopes provided at outdoor recreation facilities.
- **Camp Shelter:** A partially enclosed structure that provides campers and hikers cover from weather and that does not contain plumbing fixtures or kitchen appliances. Camp shelters are not transient lodging facilities or residential dwelling units.
- **Camping Facility:** A site or portion of a site developed for outdoor recreational purposes that contains camping units.
- **Camping Unit:** An outdoor space in a camping facility used for camping that contains outdoor constructed features, parking spaces for recreational vehicles, tent pads or tent platforms, or camp shelters.
- **Viewing Area:** An outdoor space developed for viewing landscapes, wildlife, or other points of interest.
- **Boarding Pier:** A portion of a pier where a boat is temporarily secured for the purpose of embarking or disembarking.
- **Boat Launch Ramp:** A sloped surface designed for launching and retrieving trailered boats and other watercraft to and from a body of water.
- **Gangway:** A variable-sloped pedestrian walkway that links a fixed structure or land with a floating structure. Gangways that connect to vessels are not addressed by these Standards.
- **Transition Plate:** A sloping pedestrian walking surface located at the end(s) of a gangway.
- **Play Area:** A portion of a site containing play components designed and constructed for children.
- **Play Component:** An element intended to generate specific opportunities for play, socialization, or learning. Play components are manufactured or natural; and are stand-alone or part of a composite play structure.



Two other key outdoor assets are not included in the definitions. Both are defined below.

- **Beach access routes:** A beach access route (BAR) connects an entry point to the beach to the water, as defined below:
 - At a tidal beach, to the high tide level
 - At a river beach, to the mean high water level
 - At a lake, pond, or reservoir beach, to the normal recreation water level

A BAR can be temporarily placed at a beach for all hours the beach is open, and need not be a permanent fixture.

- **Outdoor Recreation Access Routes (ORAR):** A route that connects outdoor recreation assets at an outdoor recreation site. An ORAR is not a trail.

Conditions for Exceptions at Certain Outdoor Recreation Assets

In developing the scoping and technical requirements for accessibility at beaches, trails, and other outdoor developed areas, a wide net was cast to assure a variety of perspectives. The process involved:

- Officials from states with beaches and trails
- Officials from local entities with beaches and trails
- People with disabilities
- Landscape architects and civil engineers
- Parks and recreation officials

Throughout the process, all agreed that there are times that an existing beach, a new beach, an existing trail, or a new trail cannot meet the technical requirements for accessibility. The belief of regulatory bodies however is that these conditions should arise infrequently. The four conditions for exception are defined and discussed below.

- Section 1019.1.1: ***Compliance is not practicable due to terrain.***

This is best clarified as naturally occurring terrain. It is applicable to both existing trails, and new trails. When locating and designing new trails, making the trail accessible should be a very high priority. ***This is especially important at Atlanta State Park where none of the six existing trails are accessible.***

- Section 1019.1.2: ***Compliance cannot be accomplished with the prevailing construction practices.***

This is best clarified as a reference to prohibitions on the use of foreign soil or motorized equipment. As an example, if a trail bed is being carved by TPWD staff and volunteers on their hands and knees, with pick axes, shovels, and hoes, all because of a prohibition on motorized equipment in the park, this exception may apply

- Section 1019.1.3: ***Compliance would fundamentally alter the function or purpose of the facility or the setting.***



This is best clarified as having a clear understanding of the purpose of the asset. A sharply ascending trail in a mountainous West Texas state park may have the intended use of endurance training. To “flatten” the trail is possible from a design perspective, but the trail then loses its function or purpose.

- Section 1019.1.4: ***Compliance is limited or precluded by any of the following laws, or by decisions or opinions issued or agreements executed pursuant to any of the following laws:***

Endangered Species Act (16 USC 1531 et seq.);

National Environmental Policy Act (42 USC 4321 et seq.);

National Historic Preservation Act (16 USC 470 et seq.);

Wilderness Act (16 USC 1131 et seq.); or

Other federal, State of Texas, or local laws the purpose of which is to preserve threatened or endangered species; the environment; or archeological, cultural, historical, or other significant natural features.

There are other mitigating factors regarding accessibility. Four are discussed below.

- Construction Tolerance (see 104.1.1 Construction and Manufacturing Tolerances): All dimensions are subject to conventional industry tolerances except where the requirement is stated as a range with specific minimum and maximum end points. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Equivalent Facilitation (see 103 Equivalent Facilitation): Nothing in these requirements prevents the use of designs, products, or technologies as alternatives to those prescribed, provided they result in substantially equivalent or greater accessibility and usability. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Technical Infeasibility (see 106 Definitions): With respect to an alteration of a building or a facility, a condition wherein compliance with a requirement of this Standard has little likelihood of accomplishment because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements. This is likely most applicable to making transition plan retrofits.
- Safe Harbor (see US DOJ title II section 35.151(c)): If a public entity has constructed or altered required elements of a path of travel in accordance with the specifications in either the 1991 Standards or the Uniform Federal Accessibility Standards, or TAS 1994, before March 15, 2012, the public entity is not required to retrofit such elements to reflect incremental changes in the 2010 Standards solely because of an alteration to a primary function area served by that path of travel. ***It is important to note that the 1991 Standards and TAS 1994 did not address technical requirements for recreation assets, such as boating areas, fishing areas, beaches, campsites, trails, picnic***



areas, playgrounds, sports fields, sports courts, and more. The Safe Harbor approach cannot be applied to such assets.

Campsites

We have sorted campsites into several categories. These include tent only campsites, recreational vehicle campsites, shelter sites, and sites that combine features in a hybrid approach, such as an RV site with utilities.

In evaluating Atlanta State Park, WTG used TAS 2012, the pending outdoor developed areas guidance, and smart practices that make public spaces and outdoor recreation assets more accessible to people with disabilities. We also applied the concepts of construction tolerance, technical infeasibility, safe harbor, equivalent facilitation, and other imitations on when a site must be made accessible.

What is Inclusion?

The title II regulation requires Atlanta State Park programs to be available in the most integrated setting. This is defined as the setting in which people with and without disabilities interact together. Using the camping example above, inclusive camping would locate accessible campsites amidst inaccessible campsites to facilitate interaction between campers with and without disabilities.

While all programs must be inclusive, that does not mean that everyone with every type of disability or health condition must be allowed to participate in every program. The concept of essential eligibility allows Atlanta State Park to apply neutral conditions to determine who uses programs. Again, using camping, if there are 20 campsites and a person with a disability is the 21st person to register, the neutral concept of “capacity” applies and that camper has no place to camp. If that camper is the 20th person to seek camping but does not pay the campsite fee, the neutral concept of paying the same fees can apply and that camper will not camp at Atlanta State Park.

How Can Programs in General Be Made Accessible?

The title II regulation at section 35.150(b) lists a number of ways to make Atlanta State Park programs accessible. These include but are not limited to:

- Removing architectural barriers;
- Removing communication barriers;
- Changing rules and policies;
- Providing additional staff training;
- Providing different staff ratios;
- Providing adaptive equipment;
- Providing auxiliary aids and services such as a sign language interpreter;



- Providing accessible transportation when transportation is part of the opportunity;
- Reassignment of services to accessible locations;
- Conducting duplicate opportunities, one in accessible location and the other in an inaccessible location;
- Designing and constructing new facilities that are therefore fully compliant;
- Home visits; and
- Other methods that make programs accessible.

Atlanta State Park staff should be aware of, and ready to, provide such modifications.

Are the Atlanta State Park Programs Accessible and Inclusive?

In our review of the opportunities available at Atlanta State Park, we saw:

- One playground at the Day Use Area;
- Two boat ramps at Wilkins Creek and Day Use Area;
- Two canoe launches at Wilkins Creek and Day Use Area;
- One swimming area at the Day Use Area;
- 59 hybrid campsites at Knight's Bluff, Wilkins Creek, and White Oak Ridge;
- Six trails throughout Atlanta;
- 15 picnic areas at the Day Use Area; and
- One volleyball court at the Day Use Area.

Of these, the accessibility status and our recommendation is:

- Make the one playground at Day Use accessible;
- Maintain the accessible boat ramp at Wilkins Creek accessible and implement recommendations in the site report;
- Leave the boat ramp at Day Use as is and inaccessible until later altered for another purpose;
- Make either one of the two canoe launches at Wilkins Creek or the Day Use Area accessible, leaving the other as is and inaccessible until later altered for another purpose;
- Make the one swimming area at Day Use accessible;



- Make four of the 59 hybrid campsites at Knight's Bluff, Wilkins Creek, and White Oak accessible and disperse the accessible campsites among these areas;
- Make two of the six trails accessible;
- Make three of the 15 picnic areas accessible; and
- Make the volleyball court at Day Use Area accessible.

Camping Clarification

A number of campsites of each type provided within the park (see the Outdoor Developed Area Guidelines at 244.2, which will eventually be a part of the revisions to TAS 2012) must be retrofit to make the program of camping accessible, and to meet the soon-to-be-adopted State of Texas standard.

We have sorted campsites at State Parks into several types: tent only, RV only, hybrid (usable by tent or RV), and shelter. TPWD or Atlanta State Park staff can also distinguish these sites by amenities provided (covered tables, water only, electric, scenic views, etc.).

If concessionaires are to provide camping experiences at the Park, those sites too must include accessible campsites.

Conclusion

The staff at Atlanta State Park offer experiences and assets desired by park visitors. Those same experiences and assets must be accessible to and usable by people with disabilities. See the following site report to identify barriers and recommendations for barrier removal.