
# **Access Audit Site Report**



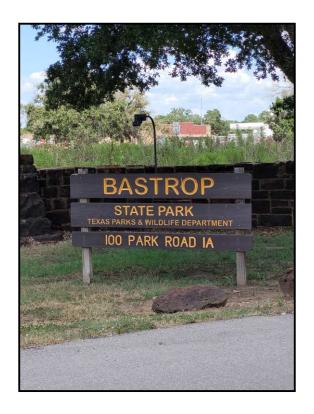

Engineering with Precision, Pace & Passion. (224) 293 - 6451 www.wtengineering.com

Bastrop State Park
Park Rd 1-A
Bastrop, TX 78602
Accessibility Evaluation
Inspection Date: 08/25/2021
Inspectors: Tanya Scheibe

### Table of Contents

over Letter	. :
ASTROP STATE PARK PROGRAM REPORT 202301	. !
indings	1:
Headquarters (HQ)	1:
Swimming Pool	2:
Park Amenities	4:
Copperas Creek Camping Area	6:
Piney Hill Camping Area	7
Dining Hall Refectory	7
Deer Run Camping Area	8
Pioneer Village Camping Area	10:
Trails	12
Group Barracks	12
Administrative Building	16



July 28, 2023

Jessica Burke, ADA Coordinator Support Resources Texas Parks and Wildlife Department 4200 Smith School Road Austin, TX 78744

Dear Jessica,

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the Bastrop State Park located at Park Rd 1-A, Bastrop, TX 78602. The facility was inspected on 08/25/2021.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

- 1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.
- 2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and findings new to the technical standards such as recreation elements
- 3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.
- 4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.
- 5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.

Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.





If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.

#### Legend of Abbreviations:

AFF... Above the finished floor

AGL... Above Ground Level

AR... Accessible Route

CIL... Change in Level

CFS... Clear Floor Space

EPC... Elevated Play Component

GLPC...Ground Level Play Component

Sincerely,

Zanya Schule

Tanya Scheibe, RAS #1369



# TEXAS PARKS AND WILDLIFE DEPARTMENT BASTROP STATE PARK

# AMERICANS WITH DISABILITIES ACT COMPLIANCE INITIATIVE PROGRAM AND POLICY REPORT JULY 28, 2023

#### **INTRODUCTION**

The Texas Parks and Wildlife Department (TPWD) is subject to the many requirements of the Americans with Disabilities Act (ADA). To assist it in meeting those requirements, TPWD retained The WT Group, LLC (WTG) Accessibility Practice in 2021.

Title II of the ADA applies to TPWD sites, along with 89,000 other units of state and local government. WTG has a broad scope of work that matches the ADA requirements found in title II. It includes:

- Schedule and conduct project management meetings;
- Conduct access audits of 89 sites, including Bastrop State Park;
- Prepare a site report that describes deficits at Bastrop State Park, and suggests solutions to those deficits:
- Provide guidance regarding the programs or opportunities Texans can enjoy at Bastrop State Park;
- Conduct community engagement events to determine the access preferences and priorities of Texans who visit Bastrop State Park;
- Provide a Bastrop State Park Transition Plan that identifies deficits, notes solutions, identifies the officer responsible for barrier removal, and notes the phase or timing of barrier removal;
- Provide a GIS shapefile regarding the accessibility of Bastrop State Park;
- Provide a method of tracking barrier removal at Bastrop State Park; and
- Report to TPWD leadership and stakeholders.

#### THIS REPORT

This report addresses program and policy advice, and then the WTG observations of deficits at Bastrop State Park. Other deliverables are provided under separate cover.

#### What is a Program?

A unit of state or local government is required to make the "programs" it offers accessible to people with and without disabilities. The term "program" is broadly defined as an opportunity made available by the state to the public, and the term public includes both people with and without disabilities. As an example, if a state park offers camping it must make certain that some campsites are of an accessible design.

The number to be made accessible is called scoping and it is usually a percentage or ratio of the similar sites. For example, if a state park has outdoor constructed features such as grills, fire pits, and benches, it must make 20% of an accessible design. Those 20% accessible must be dispersed throughout the park.

In an ADA context, "programs" at a state park or state natural area include but are not limited to:

Hiking	Fishing
Camping	Bird Watching
Swimming	Playgrounds
Lodging	Beaches
Boating	Interpretive activities
Parking	Visitor Centers
Trams	Picnicking
Sports fields	Viewing areas
Restrooms	Grilling

#### The Federal and Texas Accessibility Standards

The current Texas Accessibility Standards (TAS 2012) became effective in 2012 after an amendment process. Those Standards are almost identical to the federal 2010 Standards for Accessible Design, and both effectively address parking, entries, restrooms, and other typical building elements. They also address playgrounds, boating and fishing areas, and sports fields and courts.

They do not however address some of the assets at Bastrop State Park. Trails, campsites, and picnic areas are not yet a final and enforceable state or federal standard.

That will change at the end of 2023 or early 2024. The Texas Department of Licensing and Regulation (TDLR) has signaled its intent to adopt the pending federal guidance for key outdoor assets integral to TPWD sites like Bastrop State Park. This includes trails, beaches, campsites, picnic areas, viewing areas, and constructed park assets like grills, fire pits, and benches.

In discussing the Standards, it is important to use the correct definition of park assets. Most definitions are found in TAS 2012 at section 106. As noted above, TDLR plans to add the pending federal guidance regarding some outdoor areas to TAS. It is important to remember that the Standards set the floor, not the ceiling. Making a slope more gentle, or a route wider, is always a smart practice with universal design benefits.

Some selected definitions of park assets common to TPWD are noted below.



- Trail: A pedestrian route developed primarily for outdoor recreational purposes. A
  pedestrian route developed primarily to connect elements, spaces, or facilities within a
  site is not a trail.
- **Trailhead**: An outdoor space that is designed by an entity responsible for administering or maintaining a trail to serve as an access point to the trail. The junction of two or more trails or the undeveloped junction of a trail and a road is not a trailhead.
- **Picnic Facility**: A site or portion of a site developed for outdoor recreational purposes that contains picnic units.
- Picnic Unit: An outdoor space in a picnic facility used for picnicking that contains outdoor constructed features.
- Outdoor Constructed Features: Picnic tables, fire rings, grills, fireplaces, wood stoves, trash and recycling receptacles, water hydrants, utility and sewage hookups, outdoor rinsing showers, benches, and viewing scopes provided at outdoor recreation facilities.
- Camp Shelter: A partially enclosed structure that provides campers and hikers cover from weather and that does not contain plumbing fixtures or kitchen appliances. Camp shelters are not transient lodging facilities or residential dwelling units.
- Camping Facility: A site or portion of a site developed for outdoor recreational purposes that contains camping units.
- Camping Unit: An outdoor space in a camping facility used for camping that contains outdoor constructed features, parking spaces for recreational vehicles, tent pads or tent platforms, or camp shelters.
- Viewing Area: An outdoor space developed for viewing landscapes, wildlife, or other points of interest.
- **Boarding Pier**: A portion of a pier where a boat is temporarily secured for the purpose of embarking or disembarking.
- **Boat Launch Ramp**: A sloped surface designed for launching and retrieving trailered boats and other watercraft to and from a body of water.
- Gangway: A variable-sloped pedestrian walkway that links a fixed structure or land with a floating structure. Gangways that connect to vessels are not addressed by these Standards.
- Transition Plate: A sloping pedestrian walking surface located at the end(s) of a gangway.
- Play Area: A portion of a site containing play components designed and constructed for children.
- Play Component: An element intended to generate specific opportunities for play, socialization, or learning. Play components are manufactured or natural; and are standalone or part of a composite play structure.

Two other key outdoor assets are not included in the definitions. Both are defined below.

- **Beach access routes**: A beach access route (BAR) connects an entry point to the beach to the water, as defined below:
  - At a tidal beach, to the high tide level
  - At a river beach, to the mean high water level
  - At a lake, pond, or reservoir beach, to the normal recreation water level

A BAR can be temporarily placed at a beach for all hours the beach is open, and need not be a permanent fixture.

Outdoor Recreation Access Routes (ORAR): A route that connects outdoor recreation assets at an outdoor recreation site. An ORAR is not a trail.

#### **Conditions for Exceptions at Certain Outdoor Recreation Assets**

In developing the scoping and technical requirements for accessibility at beaches, trails, and other outdoor developed areas, a wide net was cast to assure a variety of perspectives. The process involved:

- Officials from states with beaches and trails
- Officials from local entities with beaches and trails
- People with disabilities
- Landscape architects and civil engineers
- Parks and recreation officials

Throughout the process, all agreed that there are times that an existing beach, a new beach, an existing trail, or a new trail cannot meet the technical requirements for accessibility. The belief of regulatory bodies however is that these conditions should arise infrequently. The four conditions for exception are defined and discussed below.

• Section 1019.1.1: *Compliance is not practicable due to terrain*.

This is best clarified as naturally occurring terrain. It is applicable to both existing trails, and new trails. When locating and designing new trails, making the trail accessible should be a very high priority. This is especially important at Bastrop State Park, as none of the 18 trails or trail segments throughout the Park are accessible.

 Section 1019.1.2: Compliance cannot be accomplished with the prevailing construction practices.

This is best clarified as a reference to prohibitions on the use of foreign soil or motorized equipment. As an example, if a trail bed is being carved by TPWD staff and volunteers on their hands and knees, with pick axes, shovels, and hoes, all because of a prohibition on motorized equipment in the park, this exception may apply

 Section 1019.1.3: Compliance would fundamentally alter the function or purpose of the facility or the setting.

This is best clarified as having a clear understanding of the purpose of the asset. A sharply ascending trail in a mountainous West Texas state park may have the intended use of endurance training. To "flatten" the trail is possible from a design perspective, but the trail then loses its function or purpose.

 Section 1019.1.4: Compliance is limited or precluded by any of the following laws, or by decisions or opinions issued or agreements executed pursuant to any of the following laws:

Endangered Species Act (16 USC 1531 et seq.);

National Environmental Policy Act (42 USC 4321 et seq.);

National Historic Preservation Act (16 USC 470 et seq.);

Wilderness Act (16 USC 1131 et seq.); or

Other federal, State of Texas, or local laws the purpose of which is to preserve threatened or endangered species; the environment; or archeological, cultural, historical, or other significant natural features.

There are other mitigating factors regarding accessibility. Four are discussed below.

- Construction Tolerance (see 104.1.1 Construction and Manufacturing Tolerances): All
  dimensions are subject to conventional industry tolerances except where the requirement
  is stated as a range with specific minimum and maximum end points. This is likely most
  applicable in new construction, but may also apply to making transition plan retrofits.
- Equivalent Facilitation (see 103 Equivalent Facilitation): Nothing in these requirements
  prevents the use of designs, products, or technologies as alternatives to those
  prescribed, if they result in substantially equivalent or greater accessibility and usability.
  This is likely most applicable in new construction, but may also apply to making transition
  plan retrofits.
- Technical Infeasibility (see 106 Definitions): With respect to an alteration of a building or a facility, a condition wherein compliance with a requirement of this Standard has little likelihood of accomplishment because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements. This is likely most applicable to making transition plan retrofits.
- Safe Harbor (see US DOJ title II section 35.151(c)): If a public entity has constructed or altered required elements of a path of travel in accordance with the specifications in either the 1991 Standards or the Uniform Federal Accessibility Standards, or TAS 1994, before March 15, 2012, the public entity is not required to retrofit such elements to reflect incremental changes in the 2010 Standards solely because of an alteration to a primary function area served by that path of travel.

It is important to note that the 1991 Standards and TAS 1994 did not address technical requirements for recreation assets, such as boating areas, fishing areas,

beaches, campsites, trails, picnic areas, playgrounds, sports fields, sports courts, and more. The Safe Harbor approach cannot be applied to such assets.

#### **Campsites**

We have sorted campsites into several categories. These include tent only campsites, recreational vehicle campsites, shelter sites, and sites that combine features in a hybrid approach, such as an RV site with utilities.

In evaluating Bastrop State Park, WTG used TAS 2012, the pending outdoor developed areas guidance, and smart practices that make public spaces and outdoor recreation assets more accessible to people with disabilities. We also applied the concepts of construction tolerance, technical infeasibility, safe harbor, equivalent facilitation, and other imitations on when a site must be made accessible.

#### What is Inclusion?

The title II regulation requires Bastrop State Park programs to be available in the most integrated setting. This is defined as the setting in which people with and without disabilities interact together. Using the camping example above, inclusive camping would locate accessible campsites amidst inaccessible campsites to facilitate interaction between campers with and without disabilities.

While all programs must be inclusive, that does not mean that everyone with every type of disability or health condition must be allowed to participate in every program. The concept of essential eligibility allows Bastrop State Park to apply neutral conditions to determine who uses programs.

Again, using camping, if there are 20 campsites and a person with a disability is the 21<sup>st</sup> person to register, the neutral concept of "capacity" applies and that camper has no place to camp. If that camper is the 20<sup>th</sup> person to seek camping but does not pay the campsite fee, the neutral concept of paying the same fees can apply and that camper will not camp at Bastrop.

#### **How Can Programs in General Be Made Accessible?**

The title II regulation at section 35.150(b) lists a number of ways to make Bastrop State Park programs accessible. These include but are not limited to:

- Removing architectural barriers;
- Removing communication barriers;
- Changing rules and policies;
- Providing additional staff training;
- Providing different staff ratios;
- Providing adaptive equipment;

- Providing auxiliary aids and services such as a sign language interpreter;
- Providing accessible transportation when transportation is part of the opportunity;
- Reassignment of services to accessible locations;
- Conducting duplicate opportunities, one in accessible location and the other in an inaccessible location;
- Designing and constructing new facilities that are therefore fully compliant;
- Home visits; and
- Other methods that make programs accessible.

Bastrop State Park staff should be aware of, and ready to, provide such modifications.

#### Are the Bastrop State Park Programs Accessible and Inclusive?

In our review of the opportunities available at Bastrop, we saw:

- One playground at Deer Run;
- One swimming area at Deer Run;
- 25 RV only campsites at Piney Hill:
- 22 tent only campsites at Deer Run and Creekside;
- 29 hybrid tent/RV campsites at Copperas Creek;
- 13 cabins at Pioneer Village;
- One group barracks site;
- 18 trails throughout the Park; and
- 18 picnic areas throughout the Park.

#### Of these, the accessibility status and our recommendation is:

- Make the playground accessible;
- Maintain the accessible swimming area at Deer Run and implement the site report retrofits;
- Maintain the three accessible RV only campsites at Piney Hill and implement the site report retrofits, leaving the remaining 22 RV only campsites as is and inaccessible until later altered for other purposes;



- Maintain the two accessible tent campsites at Deer Run and implement the site report retrofits, leaving the remaining 20 tent campsites at Deer Run and Creekside as is and inaccessible until later altered for other purposes;
- Maintain the three accessible hybrid tent/RV campsites at Copperas Creek and implement the site report retrofits, leaving the remaining 26 hybrid tent/RV campsites as is and inaccessible until later altered for other purposes;
- Maintain the two accessible cabins at Pioneer Village and implement the site report retrofits, leaving the remaining 9 cabins as is and inaccessible until later altered for other purposes;
- Maintain the accessibility of the group barracks site and implement the site report retrofits:
- Make six of the 18 trails or trail segments accessible, leaving the remaining 12 as is and inaccessible until later altered for another purpose, or in the alternative, develop six new trails that are accessible; and
- Maintain the two accessible picnic areas at Deer Run and implement all site report retrofits, and leave the remaining 16 picnic areas as is and inaccessible until later altered for another purpose.

#### **Camping Clarification**

A number of campsites of each type provided within the park (see the Outdoor Developed Area Guidelines at 244.2, which will eventually be a part of the revisions to TAS 2012) must be retrofit to make the program of camping accessible, and to meet the soon-to-be-adopted State of Texas standard.

We have sorted campsites into three types: tent only, RV only, and hybrid (usable by tent or RV). TPWD or Bastrop staff can also distinguish these sites by amenities provided (covered tables, water only, electric, scenic views, etc.).

TPWD is prohibited from using contractors or concessionaires that discriminate on the basis of disability. If concessionaires are to provide outdoor recreation experiences at the Park, those must be accessible to and inclusive of people with disabilities.

#### Conclusion

The staff at Bastrop State Park offer experiences and assets desired by park visitors. Those same experiences and assets must be accessible to and usable by people with disabilities. See the following site report to identify barriers and recommendations for barrier removal.

JNM/TRS/BASTROP STATE PARK PROGRAM REPORT 202301

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
1	Headquarters (HQ): HQ - Parking	[30.1101419 -97.286985]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.5% slope access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		4-4-
2	Headquarters (HQ): HQ - Parking	[30.1101435 -97.286990 3]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	sign 58" above ground	Raise existing accessible parking signs so lowest end of bottom sign is min 60" aff	2015 ABAAS Section: 502.6  2012 TAS Section: 502.6  2010 ADAS Section: 502.6	O O O O O O O O O O O O O O O O O O O	Van Accesible 60 nches min.
3	Headquarters (HQ): HQ - Parking	[30.1101353 , -97.286985]	Element meets all standards and requirements	parking scoping complies- 15 standard, 1 accessible	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
4	Headquarters (HQ): HQ - Exterior Accessible Route	[30.1102272 -97.286972 9]	The running slope of walking surfaces shall not be steeper than 1:20.	slope excedes 5% for short runs in 4 spots	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
5	Headquarters (HQ): HQ - Exterior Accessible Route	[30.1102518 -97.287254 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	5" CIL to flag pole	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	11.01 6 8 7 9 9 10.11	½ max ½ ½ ½ ½ ½
6	Headquarters (HQ): HQ - Exterior Accessible Route	[30.1102321 -97.286932 7]	Element meets all standards and requirements	ice machine complies	None	2010 ADAS Section: N/A	TE OS OP TO ALLER A CO.	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
7	Headquarters (HQ): HQ - Exterior Accessible Route	[30.11005, -97.28693]	There is no accessible route to the site amenities. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to firewood shed, pay slot, smoke trash (2), 2 picnic tables, bike rack, self pay (25" reach from path), sign with envelopes, pens, and maps, bench, key drop box, small bench	Create an accessible route with crushed stone or other outdoor material from parking or walkway to site amenities.	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Proving Access to the Control of the Control

8 Headquarters (HO): HO - Exterior Accessible Floute  8 Secion: 1011.42  97.286723  5 Secion: 1011.42  98 Caption of such as the positioned for a longest space for such 2 filmes feet consisted design. 2015 ABAAS section: 1011.42  98 Caption of the positioned for a longest space for such 2 filmes feet consisted flow in the suble and provide kines and to such that the positioned for a longest space for the such as the positioned for a longest space to the table of the suble and provide kines and to such as the positioned for a longest space to the table of the suble and provide kines and to such as the positioned for a longest space to the table of the suble and provide kines and to such as the positioned for a longest space to the suble of the suble	Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
(HQ): HQ - Exterior Accessible Route    Part									
(HQ): HQ - Exterior Accessible Route    Part									
(HQ): HQ - Exterior Accessible Route    Part								1	
	8	(HQ): HQ - Exterior	, -97.286723	wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the	0 of 2 picnic tables of accessible design.	Replace picnic table with one of an accessible design as a smart practice.	Section:		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
9	Headquarters (HQ): HQ - Public Spaces	[30.1102338 -97.286924 6]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	lacks hi bowl fountain	Add second high bowl fountain for standing persons	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2		15 min 380 and 15 min
10	Headquarters (HQ): HQ - Public Spaces	[30.110219, -97.286922]	The drinking fountain projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	fountain protrudes 18"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	13 14 15 10 17 10 19 20 21	
11	Headquarters (HQ): HQ - Public Spaces	[30.1102206 , -97.286922]	The transaction counter is too high. A portion of the counter surface that is 36 inches long minimum and 36 inches high maximum above the finish floor shall be provided. Knee and toe space must be provided for a forward approach. A 30 inch by 48 inch clear floor space on an accessible route must be provided for either a forward or parallel approach.	service counter 47"	Lower 36" wide segment of service counter to max 36" aff.	2015 ABAAS Section: 904.4.2, 904.4.1 2012 TAS Section: 904.4.1, 904.4.2 2010 ADAS Section: 904.4.2, 904.4.1	L COME O PINES	36°max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
12	Headquarters (HQ): HQ - Public Spaces	[30.1102141 -97.286931 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	both entrance doors - 15lbf and loose mats, door on left also has 10.5% slope	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. In the alternative, leave as is and mount signage directing patrons to the other more accessible door. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	OFFICE OF	
13	Headquarters (HQ): HQ - Employee Spaces	[30.110242, -97.286928 7]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Office - 30" door opening, crack in floor to office area	Replace doors with doors having 80" overhead clearance and 32" clear width. Fill gaps at door entries to max .5".	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9	28 29 30 31 E	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
14	Headquarters (HQ): HQ - Restrooms	[30.1102305 -97.286927 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Public Restroom - 2" maneuvering clearance push due to sink, 10 lbf; Employee Restroom - 6" clearance on push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11 Exception		
15	Headquarters (HQ): HQ - Restrooms	[30.1102403 -97.286923 3]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Public Restroom - sign printed, no Braille or ISA, 43"	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6	10 41 42 43 44 45 10 41 42 43 44 45	FÜC

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
16	Headquarters (HQ): HQ - Restrooms	[30.1102469 , -97.28693]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Public Restroom - pipes lack insulation	Insulate exposed pipes under sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACESSIBLE LAVATORY
17	Headquarters (HQ): HQ - Restrooms	[30.1102452 -97.286923 3]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Employee Restroom - seat cover at 52", hook at 65"; Public Restroom - 55" to covers, 54" to switch	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	The sould be seen to the seed of the seed	10 max 48 max 48 max

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
18	Headquarters (HQ): HQ - Restrooms	[30.1102452 , -97.286924 6]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Employee Restroom - pipes lack insulation	Insulate exposed pipes under sink.	2015 ABAAS Section: 606.5  2012 TAS Section: 606.5  2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY  For any or equipment
19	Headquarters (HQ): HQ - Restrooms	[30.1102633 -97.286924 6]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Employee Restroom - no signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC.

Finding	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number	7 and Docomption			7.0 July	10001111101100110	- Citation	1 1101.00	i iguio
20	Swimming Pool: Swimming Pool Parking	[30.108895, -97.281540 1]	The accessible parking stall is not wide enough. Each parking space must be at least 8' feet wide and shall be marked to define the width. The measurements of parking spaces and access aisles shall be made from the centerline of the markings. Where the parking space is not adjacent to another parking space or access aisle, the measurement shall be permitted to include the full width of the line defining the parking space.	stall 92" width	Repaint stalls to be 8' wide each	2015 ABAAS Section: 502.2 2012 TAS Section: 502.2 2010 ADAS Section: 502.2	30 90 01 02 CS	Frest to Van  Frest Tour Van  Frest Tour Van  Area to be marked to decreasing pathing
21	Swimming Pool: Swimming Pool Parking	[30.10863, -97.281104 2]	The access aisle is not a minimum 5 feet wide. A car accessible parking stall's access aisle must be a minimum of 5 feet wide measured from centerline to centerline. Where the access aisle is not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the access aisle.	marked as van accessible but sizing for access aisle is 92" and so is stall	Repaint access aisles at van stall to be 8' each	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		access aisle serving car parking spaces
22	Swimming Pool: Swimming Pool Parking	[30.108565, -97.281190 1]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.3% slope in access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		4 4 4
23	Swimming Pool: Swimming Pool Parking	[30.1086114 , -97.281200 8]	Element meets all standards and requirements	parking scoping complies, 5 standard, 1 accessible	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Fig	gure
24	Swimming Pool: Swimming Pool EAR	[30.1083887 -97.281404 6]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" gap, 1" gap on pool deck	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	Account during the second state of the second	
25	Swimming Pool: Swimming Pool EAR	[30.1083701 , -97.281372 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" CIL, 1" CIL on pool deck	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	½ ya li	2

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
26	Swimming Pool: Swimming Pool EAR	[30.1083701 -97.281404 6]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	2.7% , 2.5%, 2.7% slopes on pool deck	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
27	Swimming Pool: Swimming Pool EAR	[30.1085661 , -97.281104 2]	There is no accessible route to the benches and sign. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to benches and sign at front entry	Create an accessible route with crushed stone or other outdoor material from parking or walkway to benches and sign	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  POPULATION OF THE POPULATI

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
28	Swimming Pool: Swimming Pool EAR	[30.1085338 , -97.281041 2]	Element meets all standards and requirements	entry ramp complies, stairs comply	None	2010 ADAS Section: N/A	
29	Swimming Pool: Swimming Pool EAR	[30.1085116 -97.281172 6]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	covered picnic area - 0 of 7 tables accessible	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2	
30	Swimming Pool: Swimming Pool EAR	[30.1084871 ,-97.281218 2]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	stone paver areas have many gaps and CIL	Reset pavers to provide gaps max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	And the state of t

	1		ı		I	_		Т 1
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
31	Swimming Pool: Swimming Pool EAR	[30.1084301 -97.281359 1]	The ramps slope exceeds the maximum running slope (direction of travel) allowable of 8.33%. Ramps should have the least possible slope but in no case more than 8.3% (1:12).	ramp to picnic area within pool - 9.3%	Correct slope of ramp to max 8.33%	2015 ABAAS Section: 405.2 2012 TAS Section: 405.2 2010 ADAS Section: 405.2		AAMS
32	Swimming Pool: Swimming Pool Men's Restroom	[30.1085077 -97.281131 1]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	men's - sign above door	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC.

	1	1	1		T	ı		
Finding	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
33	Swimming Pool: Swimming Pool Men's Restroom	[30.1085249 -97.281136 4]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	men's - baby changing table protrudes 22"	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2	17 19 19 20 21 22 23 YR 2	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
34	Swimming Pool: Swimming Pool Men's Restroom	[30.1085259 -97.281112 3]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	men's - TP 1" below bar and 14" from toilet, too far	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
35	Swimming Pool: Swimming Pool Men's Restroom	[30.1085093 , -97.281136 4]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	men's - 71" hook height	Remount at least one hook to max 48" aff.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
36	Swimming Pool: Swimming Pool Women's Restroom	[30.1085366 -97.281143 1]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	women's - 41" to mirror	Lower mirror so reflective surface is max 40" aff.	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3	The second secon	
37	Swimming Pool: Swimming Pool Women's Restroom	[30.1084946 -97.281168 6]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	changing table projects 22" in open position	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
38	Swimming Pool: Swimming Pool Women's Restroom	[30.1085164 -97.281144 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	women's - hook by sink at 60", baby changer handle at 50"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	15 min 15 min 15 min 15 min 16 min 17 min 18 max
39	Swimming Pool: Swimming Pool Women's Restroom	[30.1084908 -97.281179 3]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	women's - 18.5" centerline	Remount toilets to 16" to 18" from the side wall to centerline.	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2	E H SE SE IS OF OL SI AL EN SI	16"-18"

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
40	Swimming Pool: Swimming Pool Women's Restroom	[30.1085, -97.281115]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	women's - stall door not self closing	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2		
						2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
41	Swimming Pool: Swimming Pool Women's Restroom	[30.1085557 , -97.281136 4]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	women's - 6.5" partition	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet.	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2	13.45.8 × 8 × 9.1011; ;;	Alternate door location location
42	Swimming Pool: Swimming Pool Women's Restroom	[30.1085274 -97.281120 3]	The sharps box projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	women's - sharps box 5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2	23-10-10-10-10-10-10-10-10-10-10-10-10-10-	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
43	Swimming Pool: Swimming Pool Women's Restroom	[30.1085225 , -97.281112 3]	Accessible lockers are not provided. 5% but not less than one of each type of locker must be accessible. Lockers of different size are considered different types. Although not specifically required, it is considered "best practices" that accessible elements be identified to prevent confusion for those needing accessible elements and to indicate to those that do not need accessible elements that they should only be used if others are unavailable.	women's - 0 of 40 lockers accessible	Designate 5% or no less than 1 locker as accessible with accessible hardware. Mount signage with the access symbol as a (smart practice). Mount hooks and operating mechanisms max 48" aff.	2015 ABAAS Section: F225.2.1 2012 TAS Section: 225.2.1 2010 ADAS Section: 225.2.1		Social Montes of Linguistics and Social Montes of Community Machiners Community and Co
44	Swimming Pool: Swimming Pool Women's Restroom	[30.1085389 ,281135 1]	Clear floor space adjacent to the bench has not been provided. Clear floor or ground space shall be provided and be positioned at the end of the bench seat parallel to the short axis of the bench. The space must be 30 inches minimum by 48 inches minimum.	women's - bench lacks adjacent CFS	Provide required CFS of 30" by 48" on the short end of the bench	2015 ABAAS Section: 903.2 2012 TAS Section: 903.2 2010 ADAS Section: 903.2		
45	Swimming Pool: Swimming Pool Women's Restroom	[30.1085127 -97.281085 5]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the	women's - 25" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	THE STATE OF THE S	Bench 48" min

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Swimming Pool: Swimming Pool S	Finding Number	Area Description Lat/Long	tion Lat/Long Finding	As Built	Recommendation	Citation	Photos	Figure
		-97.281152	-97.281152	counter height complies	None	2010 ADAS Section: N/A	15. 15. 15. 15. 15. 15. 15. 15. 15. 15.	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
47	Swimming Pool: Swimming Pool	[30.1081712 -97.281305 4]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	no AR to 7 picnic tables, none of accessible design.	Replace picnic table with one of an accessible design as a smart practice and extend an accessible route to the tables.	2015 ABAAS Section: 1011.4.2		
48	Swimming Pool: Swimming Pool	[30.1084798 , -97.281223 6]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	steps to pool from locker rooms - 3 steps, no visual contrast	SMART PRACTICE Install contrasting strip along front 2" of each tread The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4 2012 TAS Section: 504.4 Advisory 2010 ADAS Section: 504.4		EXTERIOR STARS ALL TREADS ARE TO HAVE WARNING STRIPES PER

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
49	Swimming Pool: Swimming Pool	[30.1085368 -97.281168 6]	The handrails as well as the handrail extensions are not at the correct height. The tops of handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground.	steps to pool from locker rooms - handrails 41" aff	Replace or remount handrails to 34" to 38" aff	2015 ABAAS Section: 505.4  2012 TAS Section: 505.4  2010 ADAS Section: 505.4		(a) stairs

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
50	Swimming Pool: Swimming Pool	[30.1082238 , -97.281397 9]	The clear deck space adjacent to the lift is not flat (2% max. in any direction). On the side of the seat opposite the water, a clear deck space shall be provided parallel with the seat. The space shall be 36 inches wide minimum and shall extend forward 48 inches minimum from a line located 12 inches behind the rear edge of the seat. The clear deck space shall have a slope not steeper than 1:48.	4.5% in front of seat	Correct slope in clear floor space at lift to max 2.08%	2015 ABAAS Section: 1009.2.3 2012 TAS Section: 1009.2.3 2010 ADAS Section: 1009.2.3	water pool deck  2% max 12  48 min
51	Swimming Pool: Swimming Pool	[30.1083423 -97.281372 5]	Element meets all standards and requirements	5 of 5 benches comply	None	2010 ADAS Section: N/A	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
52	Swimming Pool: Swimming Pool	[30.108431, -97.281365 8]	The drinking fountain projects more than 4 inches into the circulation path. Wallmounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	drinking fountain protrudes	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		The state of the s
53	Swimming Pool: Swimming Pool	[30.1085075 -97.281115]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	64" to AED	Remount operable parts to be in reach range of 15" min to 48" max. In the alternative, leave as is, employee only.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	EMERGE 89 Y DEFIBRILL 19 99 59 10 10 10 10 10 10 10 10 10 10 10 10 10	10 max 48 max 46 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
54	Swimming Pool: Swimming Pool	[30.1085263 ,-97.281141 8]	The fire extinguisher projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	fire extinguisher protrudes 7"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	THE STATE OF THE S	
55	Swimming Pool: Swimming Pool	[30.1085549 , -97.281160 6]	Element meets all standards and requirements	entry door complies	None	2010 ADAS Section: N/A		
56	Swimming Pool: Swimming Pool Employee Spaces	[30.1085353 ,-97.281136 4]	Element meets all standards and requirements	break room door complies (note - they don't open the top half ever)	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
57	Swimming Pool: Swimming Pool Employee Spaces	[30.1085345 -97.281137 8]	Multiple items are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	workout items, 65" to	Remount operable parts to be in reach range of 15" min to 48" max For items operated only by employees for work, leave as is, employee work area pursuant to 2010 Standards 106.5 Defined Terms, until an employee with a disability works here	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		10 max 48 max 48 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
58	Swimming Pool: Swimming Pool Employee Spaces	[30.1085575 ,-97.281153 9]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	break room - clear floor space (CFS) for fridge and microwave reduced by trash, first aid shelf & workout equipment reduced by pool noodle bin, file holders on wall reduced by tote	Remove, or relocate storage in CFS at fixtures and operable parts along the AR.	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3	48 min Viau OS

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
59	Swimming Pool: Swimming Pool Employee Spaces	[30.1085406 , -97.281141 8]	The floor mat or carpet pile height is too high. Carpet or carpet tile shall be securely attached and shall have a firm cushion, pad, or backing or no cushion or pad. Carpet or carpet tile shall have a level loop, textured loop, level cut pile, or level cut/uncut pile texture. Pile height shall be 1/2 inch maximum. Exposed edges of carpet shall be fastened to floor surfaces and shall have trim on the entire length of the exposed edge.	break room - loose rug on exterior	Tape or bevel a 36" wide portion of the mats to provide a designated entry to the mat area	2015 ABAAS Section: 302.2 2012 TAS Section: 302.2 2010 ADAS Section: 302.2		½ max
60	Swimming Pool: Swimming Pool Employee Spaces	[30.1085173 -97.281120 3]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	office - fridge and counter in pull side MC	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	10 11 ° 13 14 15 H	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
61	Park Amenities: Historic Golf Shelter	[30.1092315 -97.283913 9]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Left entry door - 7" step up, 28" width Closet door - uneven flooring within, knob hardware, maneuvering clearance on pull reduced by storage, 28" width Right entry - gaps on outside Back door - 27" width	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Replace doors with doors having 80" overhead clearance and 32" clear width. Ramp step at door entries to max .25". Fill gaps at door entries to max .5". Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9	15 05 95 35 35 36 36 36 36 36 36 36 36 36 36 36 36 36	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
62	Park Amenities: Historic Golf Shelter	[30.1092575 , -97.283897 8]	Employee Work Areas. Common use circulation paths within employee work areas shall comply with 402. EXCEPTIONS:  1. Common use circulation paths located within employee work areas that are less	1" gaps throughout, 7" gap by back door	Make corrections for compliant circulation path.	2015 ABAAS Section: F206.2.8, F206.2.8.1, F206.2.8.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			than 1000 square feet (93 m2) and defined by permanently installed partitions, counters, casework, or furnishings shall not be required to comply with 402. 2. Common use circulation paths located within employee work areas that are an integral component of work area equipment shall not be required to comply with 402. 3. Common use circulation paths located within exterior employee work areas that are fully exposed to the weather shall not be required to comply with 402.			2012 TAS Section: 206.2.8 206.2.8 Exception 1, 206.2.8 Exception 2, 206.2.8 Exception 3, 206.2.8 Advisory 1, 206.2.8 Advisory 2 2010 ADAS Section: 206.2.8, 206.2.8 Exception 1, 206.2.8 Exception 3	PEZA A A A A A A A A A A A A A A A A A A	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
63	Park Amenities: Historic Golf Shelter	[30.1092361 , -97.283929 9]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Men's restroom - mirror 41"	Lower mirror so reflective surface is max 40" aff.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	37.38 39 40 41 42
64	Park Amenities: Historic Golf Shelter	[30.1092477 -97.283936 7]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Men's restroom - toilet paper dispenser 3" from toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7	7-9
65	Park Amenities: Historic Golf Shelter	[30.1092406 -97.283909 8]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Men's and Women's Restr0om doors - 10l# push	Inspect, adjust, and maintain 5 lbf to open doors.	2015 ABAAS Section: 404.2.9 2012 TAS Section: 404.2.9 2010 ADAS Section: 404.2.9	Star

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
66	Park Amenities: Historic Golf Shelter	[30.1092149 , -97.283883]	The required 56 inches by 60 inches clear floor space for the water closet has been obstructed. The clear floor space around the water closet shall be 60 inches minimum measured perpendicular from the side wall and 56 inches minimum measured perpendicular from the rear wall.	Women's Restroom - sink at 47" from the side wall, located in side clearance of toilet	Relocate sink to provide required 60" clearance around toilet; if restroom was renovated prior to 2012, leave as is citing Safe Harbor	2015 ABAAS Section: 604.3. 2012 TAS Section: 604.3.1 2010 ADAS Section: 604.3.1	OS 6V D ZV VV SV VV	
67	Park Amenities: Historic Golf Shelter	[30.1092408 -97.283888 4]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Women's Restroom - toilet paper dispenser 4" from toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		de max
68	Park Amenities: Historic Golf Shelter	[30.1092266 -97.283891 1]	There are not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 29 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 2 accessible stalls with a minimum of 1 being designed as van accessible.	lacks enough accessible stalls, 1 of 29	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Moran Andreas Parameter (1998)  Moran Andreas Parameter (1998)  To the Control of

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
69	Park Amenities: Park Residence	[30.1047876 , -97.284568 3]	Residences used by staff with disabilities must be compliant.	near maintenance: step only to house, sidewalk has many cracks	Provide an accessible route to the entry of each residence; in the alternative, leave as is until an employee with a disability lives in a park residence.	Capture Section: 1		
70	Park Amenities: Park Residence	[30.1085931 -97.283196 4]	Accessible route connects from parking area to at least one entry to the residence	near front entrance: no route to front door, carport is attached for access though	Leave as is until an employee with a disability lives in a park residence.	Capture Section: 1		
71	Park Amenities: Maintenance	[30.1044416 ,-97.283624 2]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Woodshop interior doors: boxes stored in pull side maneuvering clearance, knob handle; knob handle; bookshelf in pull side maneuvering clearance, knob hardware; knob handle; desk in pull side maneuvering clearance, 2" change in level	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Repair, bevel, or ramp CILs at door entries to max .25". Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Training of							15 DE 0 3 2 3 5 P	
							87.8 9 10 11 V 15 to (s)	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Fig	ure
72	Park Amenities: Maintenance	[30.1043419 , -97.283561 1]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	restroom lacks accessible features, too small, lacks signage to nearest accessible park restroom (none at maintenance)	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1  2012 TAS Section: 603.1  2010 ADAS Section: 603.1	SO MIN. CLEAR  TOTAL TOTAL TOTAL  TOTAL TOTAL  TOTA	30° MIN.
73	Park Amenities: Maintenance	[30.1044371 -97.283590 6]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Restroom has no sign	Acquire and mount signage, including Braille and raised characters, mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
74	Park Amenities: Maintenance	[30.1043976 -97.283614 8]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	low bowl fountain only	Add second high bowl fountain for standing persons.	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2		When the second
75	Park Amenities: Maintenance	[30.1043976 -97.283614 8]	The spout for the drinking fountain is too high. Spout outlets shall be 36 inches maximum above the finish floor or ground.	low bowl spout 37"	Remount fountain so spout outlet is max 36" aff.	2015 ABAAS Section: 602.4 2012 TAS Section: 602.4 2010 ADAS Section: 602.4	30 31 to 33 34 35 1 37	S6 max 98 49 wheelchair standing accessible persons
76	Park Amenities: Maintenance	[30.104444, -97.283647]	There is not enough toe space clearance under the drinking fountain. Space under an element between the finish floor or ground and 9 inches above the finish floor or ground shall be considered toe clearance Space extending greater than 6 inches beyond the available knee clearance at 9 inches above the finish floor or ground shall not be considered toe clearance. Where toe clearance is required at an element as part of a clear floor space, the toe clearance shall extend 17 inches minimum under the element.	plumbing and electrical in toe clearance	Remount or replace fountain with one provided 17" min and 25" max deep toe clearance.	2015 ABAAS Section: 306.2.3 2012 TAS Section: 306.2.3 2010 ADAS Section: 306.2.3		max 48"

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
77	Park Amenities: Maintenance	[30.1044392 , -97.283618 8]	The clear floor space required at accessible drinking fountains is not centered on the low fountain. At "hi-low" type drinking fountains, the 30 inch by 48 inch clear floor space must be centered on the "low" fountain.	lacks clear floor space centered on fountain due to shelf	Relocate shelf to provide clear floor space centered on fountain.	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2		30"x48"  Clear Floor &
78	Park Amenities: Maintenance	[30.1043884 , -97.283582 6]	The threshold has a vertical change greater than 1/4 inch high. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Doors must be connected to an accessible route and provide egress away from buildings.	wood shop - 8" step up to door, no AR to door, 20 lbf on push barn door	For all doors along the public circulation route, ramp CILs at door entries to max .25" For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, provide an accessible route to and egress from the door	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
79	Park Amenities: Maintenance	[30.1044348 -97.283604 1]	Benches shall have a 36" by 48" clear ground space (CGS) positioned near the bench with one side of the space adjoining an outdoor recreation access route (ORAR) or trail, as applicable The CGS shall not overlap with the ORAR or trail or another CGS	wood shop - no clear floor space for bench	Construct firm, stable, and slip resistant pads at least 36" by 48" adjacent to 20% of benches, and locate along an AR as a smart practice.	2015 ABAAS Section: 1011.2.1	NO SMOKING	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
80	Park Amenities: Maintenance	[30.1043361 -97.283805 2]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 10 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	lot fails, gravel, no accessible stalls or marked stalls	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls on a firm and stable surface.	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		Weather Services  Services
81	Park Amenities: Maintenance	[30.1042412 -97.284031 9]	The threshold has a vertical change greater than 1/4 inch high. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	state police - 6" step up, knob hardware	For all doors along the public circulation route, ramp CILs at door entries to max .25" For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	Year Trained	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
82	Park Amenities: Maintenance	[30.1043512 -97.283604 1]	The threshold has a vertical change greater than 1/4 inch high. The threshold has a gap greater than 1/2 inch wide. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	15923, door - knob hardware, 8" step, 2" gap	For all doors along the public circulation route, ramp CILs at door entries to max .25". For all doors along the public circulation route, fill gaps at door entries to max .5". For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		
83	Park Amenities: Maintenance	[30.1042027 -97.283765]	There is no accessible route to the site elements. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to - wood shop, metal garage, metal shed, water spigot, cone storage, state park boundary building, brown shed, picnic table, white shed/ house, misc equipment, tool covered space, tractor, wood shop loading dock	Create an accessible route with crushed stone or other outdoor material from parking or walkway to site elements	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Person  Proper  Proper

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
84	Park Amenities: Main Overlook Parking		The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	stall 2.7%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
85	Park Amenities: Main Overlook Parking	[30.1112937 , -97.269184 5]	Element meets all standards and requirements	parking scoping complies, 1 of approximately 25 stalls	None	2010 ADAS Section: N/A		
86	Park Amenities: Main Overlook Shelter	[30.1114816 -97.269357 5]	The force required to operate the element exceeds the maximum. The force required to activate operable parts is 5 pounds maximum.	recycling and trash require excessive force	Adjust operating mechanism to be usable with 5 lbf or less if feasible.	2015 ABAAS Section: 309.4 2012 TAS Section: 309.4 2010 ADAS Section: 309.4		

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
87	Park Amenities: Main Overlook Shelter	[30.1114919 -97.269357 5]	Element meets all standards and requirements	2 of 2 picnic tables of accessible design and on route, 2 of 2 grill on route	None	2010 ADAS Section: N/A		
88	Park Amenities: Main Overlook Shelter	[30.111347, -97.269368 2]	Element meets all standards and requirements	bench complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
89	Park Amenities: Main Overlook Shelter	[30.1114728 -97.269360 2]	There is no accessible route to the shelter. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	lacks accessible entry into shelter	Provide a ramp for access to shelter.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Program  A
90	Park Amenities: Main Overlook Shelter	[30.111347, -97.269366 9]	The sign providing directional and information is noncompliant. Signs that identify, direct to or give information about accessible elements and features of a building or site, shall have a non-glare finish, contrast with their background, be selected from fonts where the width of the uppercase letter "O" is 55 percent minimum and 110 percent maximum of the height of the uppercase letter "I". Characters shall be uppercase or lowercase or a combination of both, conventional in form and shall not be italic, oblique, script, highly decorative, or of other unusual forms and be sized according to the viewing distance. Visual characters shall be 40 inches (1015 mm) minimum above the finish floor or ground.	text on informational signs is too small	Consider replacing sign with one having characters min 5/8" high as a smart practice	2015 ABAAS Section: F216.3  2012 TAS Section: 216.3  2010 ADAS Section: 216.3, 703.5.6 Exception	LAYING THE POUNDATION  W. Class of the state	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
91	Park Amenities: Three Picnic Area	[30.1132197 ,-97.276024 1]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.4% cross in lot	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		4-4-60
92	Park Amenities: Three Picnic Area	[30.1131838 , -97.275916 8]	Element meets all standards and requirements	parking scoping complies, 13 standard, 1 accessible	None	2010 ADAS Section: N/A		
93	Park Amenities: Three Picnic Area	[30.1132055 -97.275879 3]	There is no accessible route to the water spigot and trailhead. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accessible route to water or trail head	Create an accessible route with crushed stone or other outdoor material from parking or walkway to water spigot and trailhead	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Printing  Prin
94	Park Amenities: Three Picnic Area	[30.1131836 -97.275863 2]	Element meets all standards and requirements	picnic table, grill and trash can compliant; table is one out of 4	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
95	Copperas Creek Camping Area: Copperas - Parking	[30.1016317 -97.274860 1]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (XX) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (XX) accessible stalls with a minimum of (XX) being designed as van accessible.	campground parking - 0 of 18 stalls accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Verification of Principle Services   Verification of Principle Services   Verification of Principle Services   Verification of
96	Copperas Creek Camping Area: Copperas - Parking	[30.1015667 , -97.274833 2]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Restroom Parking - 2.5% in parking stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		+ + +
97	Copperas Creek Camping Area: Copperas - Parking	[30.1015969 , -97.274833 2]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Restroom Parking - sand in stall, paint faded	Maintain stall and access aisle to be free of debris. Restripe stall and access aisle where paint faded.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		½ max ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
98	Copperas Creek Camping Area: Copperas - Parking	[30.1016038 -97.274827 9]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Restroom Parking - parking sign 59" above ground level	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6	CCES SERVICE STATE OF THE PROPERTY OF THE PROP	Van Accessible 60 inches min.
99	Copperas Creek Camping Area: Copperas - Parking	[30.1016142 , -97.274803 7]	Element meets all standards and requirements	restroom parking scoping complies, 8 standard, 1 accessible	None	2010 ADAS Section: N/A		
100	Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.10157, -97.274794 3]	The stair risers are not uniform in height. Stair riser heights shall be 7 inches maximum and 4 inches minimum. On any given flight of stairs, all steps shall have uniform riser height and uniform tread widths.	Stairs to Restrooms - first step is 6, second two are 7	Correct riser heights on stairs to consistent height between 4" to 7", leave as is if technically infeasible	2015 ABAAS Section: 504.2 2012 TAS Section: 504.2 2010 ADAS Section: 504.2		
101	Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.1014507 , -97.274693 8]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	Stairs to Restrooms - no visual contrast on nosings	SMART PRACTICE Install contrasting strip along front 2" of each tread The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4  2012 TAS Section: 504.4 Advisory  2010 ADAS Section: 504.4		EXTERIOR STANDS EXTERIOR STANDS EXTERIOR STANDS TO HAVE WARRING STRIPES PER  2º MIN TO 4º MAX 1º MAX

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
102	Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.1014414 -97.274715 2]	The handrails as well as the handrail extensions are not at the correct height. The tops of handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground.	Stairs to Restrooms - 39" aff on left side only when facing restroom entry	Replace or remount handrails to 34" to 38" aff.	2015 ABAAS Section: 505.4 2012 TAS Section: 505.4 2010 ADAS Section: 505.4	2 31 52 57 56 57 66 41 42 43 44	(a) stairs
103	Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.1013346 -97.274597 2]	The running slope of walking surfaces shall not be steeper than 1:20.	crusher fine path to restroom within the loop, running slope of 8.2%	Correct running slope along the AR to max 5% Maintain crushed stone surface to be firm, stable, and maneuverable	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Finding Number	Area Description  Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.1013996 , -97.274656 2]		As Built  12.1% at top of slope, 14.5% at middle, 8.2% parallel to site 60	Recommendation  Frequently maintain trail cross slope to assure it does not exceed 5% for surfaces other than concrete, boards or asphalt as a smart practice	Citation  2015 ABAAS Section: 1017.7.2 EXCEPTION:	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
105	Copperas Creek Camping Area: Exterior Accessible Route At Copperas Restrooms	[30.1013811 -97.274645 5]	Not more than 30 percent of the total length of a trail shall have a running slope steeper than 1:12 (8.33%). The running slope of any segment of a trail shall not be steeper than 1:8 (12%). Where the running slope of a segment of a trail is steeper than 1:20 (5%), the maximum length of the segment shall be in accordance with Table 1017.7.1, and a resting interval complying with 1017.8 shall be provided at the top and bottom of each segment.		Frequently maintain trail running slope to assure it does not exceed 8.33% slope for 200' max, 10% for 30' max or 12.5% for 10' with resting spaces on the trail as a smart practice	2015 ABAAS Section: 1017.7.1		
106	Copperas Creek Camping Area: Men's Restroom	[30.1015394 , -97.274780 9]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Men's and Women's restroom door - 15lbf push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
107	Copperas Creek Camping Area: Men's Restroom	[30.101504, -97.274742]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	baby changing table protrudes in open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2	1 \$\frac{1}{2}\$ 13 14 15 \$\frac{1}{17}\$ 7	
108	Copperas Creek Camping Area: Men's Restroom	[30.1014832 -97.274709 9]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	26.25" knee clearance at drinking fountain	Raise drinking fountain to provide required 27" knee clearance.	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2	10 10 10 10 10 10 10 10 10 10 10 10 10 1	FIRST TO GLAMMES  FIRST TO GLAMMES  TYPES TO GLAMMES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
109	Copperas Creek Camping Area: Men's Restroom	[30.1015296 , -97.274731 3]	Element meets all standards and requirements	dish wash station near Men's restroom has a compliant sink and operable parts	None	2010 ADAS Section: N/A	10 10 10 10 10 10 10 10 10 10 10 10 10 1
		,					
110	Copperas Creek Camping Area: Women's Restroom	[30.10153, -97.27484]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench		Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	Bench 48" min

					Recommendation	Citation	Photos Figu	ure
111	Copperas Creek Camping Area: Women's Restroom	[30.1014994 -97.274723 3]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	women's - projects in open position 19"	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
112	Copperas Creek Camping Area: Women's Restroom	[30.1015156 , -97.274731 3]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	women's - stall door mounted 7" to adjacent partition	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2	Alternate door location	60° Min.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
113	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018916 , -97.274806 4]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	4 Tables, none accessible	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2	
114	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018289 -97.274798 4]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Historic stone floor, too many gaps to document all	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3	Internal distance of transit
115	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018253 ,-97.274798 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Historic stone floor, too many CIL to document all	Repair, bevel or ramp CIL along AR; in the alternative, repair or reset pavers to eliminate CIL	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	Wanax

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
116	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018301 -97.274799 7]	Where picnic facilities contain two or fewer picnic units, each picnic unit shall provide mobility features complying with F245.2.	no accessible route to open air room or rear fireplace seating, the rear seating walkway is only 25", fireplace access blocked by stone curb	Recommendation  Create an ORAR to shelter or picnic area and provide accessible features as a smart practice.	Citation  2015 ABAAS Section: F245.2.1	Photos  Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
117	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018405 , -97.274795 7]	Objects project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	2 outlet boxes protrude 5"	Provide cane detectable warning at base of object along the AR or elocate object to not protrude into the circulation path.	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2	72 < X	4 max  4" is the max. an object may project if the bottom is greater than 27" off the floor
118	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018823 -97.274785]	The branches extend down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	branches as low as 34" over AR	Maintain overhead clearance of min. 80"	2015 ABAAS Section: 307.3  2012 TAS Section: 307.3  2010 ADAS Section: 307.3	2 2 2 2 2 2 3 2 3 3 3 3 3 3 3 3 3 3 3 3	Any Projection
119	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018544 -97.274795 7]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	group picnic pavilion parking - slopes - stall 3.2%, aisle 3.3%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		4-4-4-

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
120	Copperas Creek Camping Area: CCC Shade Shelter	[30.1018637 , -97.274806 4]	Element meets all standards and requirements	Group picnic pavilion, parking lot complies with scoping - 4 standard stalls, one accessible	None	2010 ADAS Section: N/A		
121	Copperas Creek Camping Area: Campsite #61	[30.1017442 , -97.274473 8]	Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch (13 mm) in height measured vertically to the highest point. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, obstacles shall be permitted to not exceed 1 inch (25 mm) in height measured vertically to the highest point.	1" CIL from sidewalk to tent pad	Repair, bevel or ramp CIL along the ORAR to max .5" as a smart practice.	2015 ABAAS Section: 1016.5, 1016.5 EXCEPTION		
122	Copperas Creek Camping Area: Campsite #61	[30.1017384 -97.274492 6]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	61 - would be good, but elevation mechanism is broken	Repair broken mechanism or correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
123	Copperas Creek Camping Area: Campsite #61	[30.1017639 ,-97.274488 6]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the accessible stall exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	campsite 61 parking - 3.7% cross in access aisle	Correct or repair slope of stall and access aisle to max 2.08% in any direction as a smart practice	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
124	Copperas Creek Camping Area: Campsite #61	[30.1017372 -97.274481 9]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	61 - lacks accessible route and clear ground space at utilities	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice.	2015 ABAAS Section: 1011.2	
125	Copperas Creek Camping Area: Campsite #69	[30.1015899 , -97.275281 2]	Campsite occupied, unable to audit	park host occupied	Assure compliance to camping standards.	2015 ABAAS Section: Reco mmended  2012 TAS Section: Reco mmended  2010 ADAS Section: Reco mmended	
	Т	I	T	Т	T		
126	Copperas Creek Camping Area: Campsite #71	[30.1010887 , -97.274811 8]	Campsite occupied, unable to audit	park host occupied	Assure compliance to camping standards.	2015 ABAAS Section: Reco mmended  2012 TAS Section: Reco mmended  2010 ADAS Section: Reco mmended	

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
127	Piney Hill Camping Area: Piney Hill Campsites	[30.1062818 -97.278947 7]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	site 19 - grown over crusher fines	Maintain required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice	2015 ABAAS Section: 1011.2	
128	Piney Hill Camping Area: Piney Hill Campsites	[30.1070057 -97.279473 5]	Campsite occupied, unable to audit	25, occupied park host	Assure compliance to camping standards.	2015 ABAAS Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended	
129	Piney Hill Camping Area: Piney Hill Campsites	[30.1061704 -97.278711 7]	The surface of the outdoor recreation access route, passing spaces, and/or resting intervals are not firm and stable. The surface of outdoor recreation access route, passing spaces, and resting intervals shall be firm and stable, having a width of 36", max gaps of .5" and tread obstacles of .5" or less.	site 18 - loose debris in clear floor space for wheelchair	Correct surface of ORAR to be firm and stable, a min 36" wide and having gaps and changes in level of max .5". Train staff to maintain accessible sites to be free of overflow and debris.	2015 ABAAS Section: 1016. 2	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
130	Dining Hall Refectory : Refectory Parking	[30.10904, -97.28185]	There are not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 64 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 3 accessible stalls with a minimum of 1 being designed as van accessible.	64 standard 2 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Manufacture   Army Section   Army
131	Dining Hall Refectory : Refectory Parking	[30.10904, -97.28185]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	left - 2.2% stall, 3% access aisle, right-3.1%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		4 4 4

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
132	Dining Hall Refectory : Refectory Exterior Accessible Route	[30.1088552	Changes in level greater than ½ inch (13 mm) high shall be ramped, and shall comply with 405 or 406.	no AR to front of building entry by loop	Create a curb ramp to be max running slope 8.33%, max cross slope 2.08%, having a top landing as wide as the ramp and 36" deep and side flares with a max slope 10% along the AR where curbs are present.	2015 ABAAS Section: 303.4  2012 TAS Section: 303.4  2010 ADAS Section: 303.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
133	Dining Hall Refectory : Refectory Exterior Accessible Route	[30.108832, -97.282297 8]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high.	Front door - 1" change in level, 28" width for both Right dble door to main meeting room on right and left - 27" for both doubles Back storage with chairs - 28" width, tables in push maneuvering clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25"	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	15 05 05 15 26 05 35 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
134	Dining Hall Refectory : Refectory Exterior Accessible Route	[30.1087981 -97.282283 1]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	65" to window hardware	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	10 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
135	Dining Hall Refectory : Refectory Exterior Accessible Route	[30.1088249 -97.282230 8]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	30" width to restrooms	Widen AR to compliant 36" clear width.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	2345078910	24 max 48 min 48 min 48 min 48 min 48 min 49 min 49 min 49 min 40
136	Dining Hall Refectory : Restrooms In Refectory	[30.1087692 , -97.282230 8]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Women's Restroom - pipes lack insulation	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5  2012 TAS Section: 606.5  2010 ADAS Section: 606.5		ACCESSIBLE LAWATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
137	Dining Hall Refectory: Restrooms In Refectory	[30.1087414 , -97.282187 9]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.		Lower operating mechanisms in restroom to max 48" aff to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		2) Fig. 1. (a) (b) (c) (c) (c) (c) (c) (c) (c) (c) (c) (c

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure	
138	Dining Hall Refectory : Restrooms In Refectory	[30.108862, -97.282209 3]	Toilet compartment doors, including door hardware, shall comply with 404 except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42 inches (1065 mm) minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4 inches (100 mm) maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches (100 mm) maximum from the front partition, the door opening shall be 4 inches (100 mm) maximum from the front partition. The door shall be self-closing. A door pull complying with 404.2.7 shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area.	Women's Restroom - stall door lacks maneuvering clearance due to other stall	Reconfigure restroom to provide compliant wheelchair accessible compartment including stall door that meets requirements for maneuvering clearance	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2		
139	Dining Hall Refectory : Restrooms In Refectory	[30.1088249 -97.282273 7]	There are not enough accessible toilet compartments. The room contains 2 toilet compartments. A minimum of 1 must be wheelchair accessible .	Women's Restroom - ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
140	Dining Hall Refectory : Restrooms In Refectory	[30.108862, -97.282209 3]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Women's Restroom - ambulatory stall door not self closing	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2		
						2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
141	Dining Hall Refectory : Restrooms In Refectory	[30.108862, -97.282230 8]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Women's Restroom - left extends 48"	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff.	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
142	Dining Hall Refectory : Restrooms In Refectory	[30.1087878 , -97.282252 2]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Women's Restroom - toilet paper dispenser too close	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7	Buo 6 3 t o 3 y E to	year 6th

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
143	Dining Hall Refectory : Restrooms In Refectory	[30.1087599 , -97.282263]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	doors - 15# push	Inspect, adjust, and maintain 5 lbf to open doors.	2015 ABAAS Section: 404.2.9 2012 TAS Section: 404.2.9 2010 ADAS Section: 404.2.9		S lbf
144	Dining Hall Refectory : Restrooms In Refectory	[30.1088806 -97.282252 2]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Men's Restroom - soap dispenser 53"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	1 1 2 2 3 3 3 4 1 2 3 3 3 4 1 3 3 3 3 4 1 3 3 3 3 4 1 3 3 3 3	10 max 48 max 48 max
145	Dining Hall Refectory : Restrooms In Refectory	[30.1087228 , -97.28222]	There are not enough accessible toilet compartments. A minimum of 1 must be wheelchair accessible .	Men's - ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
146	Dining Hall Refectory : Restrooms In Refectory	[30.1088359 ,-97.282203 9]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Men's Restroom - right bar extends 48"	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1	5 46 47 1 49 50	
147	Dining Hall Refectory : Kitchen In Refectory	[30.1088249 -97.282230 8]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm).	Kitchen restroom door - 22" width Closet door - 26" width, no maneuvering clearance on push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
148	Dining Hall Refectory : Kitchen In Refectory	[30.1088434 -97.282252 2]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	no signage at kitchen restroom, restroom not accessible	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom. Mount compliant signage with Braille and raised lettering.	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8	_,4	RESTROOM -
149	Dining Hall Refectory : Kitchen In Refectory	[30.1088249 -97.282209 3]	There is no accessible route to the refectory trash cans. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accessible route to exterior trash cans	Relocate at least one garbage can to be in reach range of the route.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Type of the property of

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
150	Dining Hall Refectory : Kitchen In Refectory	[30.1088271 -97.282225 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground. Egress doors shall provide a continuous and unobstructed way of egress travel from any point in a building or facility that provides an accessible route to an area of refuge, a horizontal exit, or a public way.	Exterior door to entry - missing hardware on front, no accessible route or egress, 14.5% slope	For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp. For all doors along the public circulation route, enlarge cement pad at exit to allow 18" clearance on the latch side, and extend a pathway away from the building for emergency egress.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	
151	Dining Hall Refectory : Kitchen In Refectory	[30.1088335 -97.282230 8]	The shelves and fire extinguishers project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	shelves and fire extinguishers protrude more than 4"	Relocate protruding objects or place cane detectable warning or bollard at foot of items.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	3456789

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
152	Dining Hall Refectory : Kitchen In Refectory	[30.1087692 -97.282230 8]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	slope to drain 3.3%	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		**************************************
153	Dining Hall Refectory : Kitchen In Refectory	[30.1088249 , -97.282166 4]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	lowest work surface 35"	Provide tables and work surfaces at 28" to 34" aff with required knee and toe clearances	2015 ABAAS Section: 902.3  2012 TAS Section: 902.3  2010 ADAS Section: 902.3	35 34 35 36 36 36 36 36 36 36 36 36 36 36 36 36	Knee Space Ser Mn. to Ser Mn. to Mn.
154	Dining Hall Refectory : Kitchen In Refectory	[30.1088063 , -97.282166 4]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	sink 36.25"	Lower sinks to max 34" aff to front of rim	2015 ABAAS Section: 606.3  2012 TAS Section: 606.3  2010 ADAS Section: 606.3	15 25 25 25 25 25 25 25 25 25 25 25 25 25	Toe clearance  Toe clearance  6' deep toe space

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
155	Deer Run Camping Area: Deer Run Camping Playground Parking	[30.1078327 -97.280915 1]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	picnic side: stall 2.8%, aisle 3.2%; playground side: stall 2.4%, aisle 3.7%; Restroom Side: Stall 2.3%, Aisle 2.8%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
156	Deer Run Camping Area: Deer Run Camping Playground Parking	[30.107744, -97.280803 8]	Element meets all standards and requirements	parking scoping complies- 3 of 27 accessible	None	2010 ADAS Section: N/A		
157	Deer Run Camping Area: Deer Run Playground Exterior Accessible Route	[30.1077385 , -97.280758 2]	Element meets all standards and requirements	accessible route to playground complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
158	Deer Run Camping Area: Deer Run Playground	[30.1076939 -97.280693 9]	As a smart practice, play area should have a minimum 60" wide entry, free of changes in level, gaps, and slope.	6.9% running slope at entry near restroom, 1" gap at entry, 20.1% slope up on EWF due to low fill	Repair, bevel or ramp CIL at playground entry/border Correct slope at playground entry to max 6.25% Fill and maintain accessible playground surface to be level with adjacent surfaces	2015 ABAAS Section: F206.1  2012 TAS Section: 206.1  2010 ADAS Section: 206.1		
159	Deer Run Camping Area: Deer Run Playground	[30.1076719 , -97.280675 1]	Play area shall have signage listing designated ages of intended users	play area lacks age signage	Acquire and install intended user signage and mount at designated entry as a smart practice	2015 ABAAS Section: F240.1 2012 TAS Section: 240.1 2010 ADAS Section: 240.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
160	Deer Run Camping Area: Deer Run Playground	[30.1077306 -97.280681 8]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	2" & 2.5" changes in level throughout due to low fill	Fill and maintain play area accessible surface to eliminate changes in level	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		½ max ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½
161	Deer Run Camping Area: Deer Run Playground	[30.1076694 , -97.280660 3]	The transfer platform is not within the compliant range above the ground. The height of transfer platforms shall be 11 inches minimum and 18 inches maximum measured to the top of the surface from the ground or floor surface.	transfer platform 19.5" above surface	Lower platform on transfer system to 11" to 18" aff, in the alternative, add and maintain surface fill level to achieve the same.	2012 TAS Section: 1008.3.1.2 2010 ADAS Section: 1008.3.1.2	N. Young Burk and D. V. Tay 19 50 27 22 28	Man.
162	Deer Run Camping Area: Deer Run Playground	[30.1076833 -97.280697 9]		Play area meets 50% on route by transfer: 8 of 12 on route: bird cage, bridge, circle ladder, fire Pole, three racer slide, swirl slide, double split slide, twist ladder; not on route due to large step - rock climber, tube slide, 2 monkey bars and ladder)	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
163	Deer Run Camping Area: Deer Run Playground	[30.1077425 , -97.280715 3]	A minimum of one of each type of ground level play components is not on an accessible route. Where ground level play components are provided, at least one of each type shall be on an accessible route and shall comply.	2 manipulable both under playground (2 steering wheels); compliant - 4 swings (2 belt swings, 1 basket swing, 1 chair swing)	Provide an AR to at least one steering wheel for one of each type accessible	2012 TAS Section: 240.2.1.1 2010 ADAS Section: 240.2.1.1		
164	Deer Run Camping Area: Deer Run Playground	[30.1076554 , -97.280696 5]		play area fails to meet incentive scoping with only 1 type on the route	Add two more types of GLPCs such as climbers, spinners or rockers, to meet incentive scoping	2012 TAS Section: 240.2.1.2 2010 ADAS Section: 240.2.1.2		No. 10 & 1.1   April metal from all from a florated plans
165	Deer Run Camping Area: Deer Run Playground	[30.107674, -97.280707 3]	Element meets all standards and requirements	double benches on play entry near restroom comply with clear floor space, double benches on parking side comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
166	Deer Run Camping Area: Deer Run Campsites	[30.1077987 -97.280437 7]	There is no accessible route to the dump station amenities. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	at dump station - no AR to trash, water spigot	Create an accessible route with crushed stone or other outdoor material from parking or walkway to dump station amenities Provide operable parts that can be operated without tight grasping, pinching, or twisting of the wrist and mount within reach 15" to 48"	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  POPULATION AND ACCESSIBLE AND ACCESSION

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
167	Deer Run Camping Area: Deer Run Campsites	[30.1078345 -97.280471 2]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1.5" gap on left side, 1.5" on right side black top, 1.5" parallel to dump	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3	2 3 4 5 6 7 1 2 3 4 - 5	dominant disastics of hasel  There diseases proprietabilities in the second disastics of treat  When the second disastics of treat  When the second disastics of treat  When the second disastics of treat  Second disastics disas
168	Deer Run Camping Area: Deer Run Campsites	[30.1078646 , -97.280482]		10.5" raised deterioration by dump station	Resurface AR where deterioration occurs.	2015 ABAAS Section: 302.1  2012 TAS Section: 302.1  2010 ADAS Section: 302.1	To Jan 19 19 19 19 19 19 19 19 19 19 19 19 19	Charges is less fatheres.  (If a light of the state of th

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
169	Deer Run Camping Area: Deer Run Campsites	[30.1073492 ,-97.280814 6]	Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch (13 mm) in height measured vertically to the highest point. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, obstacles shall be permitted to not exceed 1 inch (25 mm) in height measured vertically to the highest point.	site 2775" change in level from tent pad to restroom	Repair, bevel or ramp CIL along the ORAR to max .5" as a smart practice.	2015 ABAAS Section: 1016.5, 1016.5 EXCEPTION		
170	Deer Run Camping Area: Deer Run Campsites	[30.107295, -97.280769]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	site 27- 2.2% at intersection to play and restroom	Correct or repair ORAR cross slope to max 2.08% as a smart practice. In the alternative, leave as is citing construction tolerance.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
171	Deer Run Camping Area: Deer Run Campsites	[30.1072965 -97.280766 3]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	site 27- 3.3% slope at table clear space	Correct slope of clear ground space around all usable portions of the table to max 2.08% on surface that is concrete, asphalt, or boards as a smart practice	2015 ABAAS Section: 1011.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure	
172	Deer Run Camping Area: Deer Run Campsites	[30.107377, -97.280750 2]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	site 27- 2.5% slope in access aisle	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION		
173	Deer Run Camping Area: Deer Run Campsites	[30.1073213 -97.280707 3]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground	site 27- 25" to spout	Remount water spouts to 28" min or 36" max above the ground as a smart practice	2015 ABAAS Section: 1011.6		
174	Deer Run Camping Area: Deer Run Campsites	[30.1073584 , -97.280728 7]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	site 27- no clear ground space at water spigot	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice	2015 ABAAS Section: 1011.2		
175	Deer Run	[30.1077967	Element meets all standards and	accesible route to	None	2010 ADAS		
1/5	Deer Hun Camping Area: Deer Run Camping Area Picnic	-97.281682 3]	requirements	picnic area is compliant	None	Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
176	Deer Run Camping Area: Deer Run Camping Area Picnic	[30.1068108 , -97.280685 8]	Where picnic facilities contain two or fewer picnic units, each picnic unit shall provide mobility features complying with 245.2. Where picnic facilities contain more than two picnic units, at least 20 percent, but not less than two, of the picnic units shall provide mobility features complying with 245.2.	2 out of 17 picnic tables compliant and 2 out of 10 Grills compliant	Provide an AR and accessible tables to shelter/picnic area to achieve the required number accessible	2015 ABAAS Section: F245.1		
177	Deer Run Camping Area: Deer Run Women's Restroom	[30.1074365 -97.280412 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. The threshold has a gap greater than 1/2 inch wide. All interior doors must be maintained so that the operating pressure does not exceed 5 lbf to open.	Women's Restroom - Door - 12 lbf, recessed on push 11", 1.5" gap Men's Restroom - Door - 10 lbf, 10" recessed on push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, fill gaps at door entries to max .5". For all doors along the public circulation route, inspect, adjust, and maintain 5 lbf to open interior doors.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
178	Deer Run Camping Area: Deer Run Women's Restroom	[30.1074513 -97.280449 8]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	sink pipes lack insulation	Insulate exposed pipes under sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY  For any or equivalent
179	Deer Run Camping Area: Deer Run Women's Restroom	[30.1074703 -97.280354 6]	Clear floor space adjacent to the bench has not been provided. Clear floor or ground space shall be provided and be positioned at the end of the bench seat parallel to the short axis of the bench. The space must be 30 inches minimum by 48 inches minimum.	women's - bench lacks clear floor space at side	Provide required CFS of 30" by 48" on the short end of the bench	2015 ABAAS Section: 903.2  2012 TAS Section: 903.2  2010 ADAS Section: 903.2	44	
180	Deer Run Camping Area: Deer Run Women's Restroom	[30.1074234 , -97.280406 9]	Element meets all standards and requirements	shower complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
181	Deer Run Camping Area: Deer Run Men's Restroom	[30.1074048 , -97.280439 1]	The rim of the urinal Is too high. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	urinal rim at 18"	Lower urinal so that rim height is max 17" aff	2015 ABAAS Section: 605.2 2012 TAS Section: 605.2 2010 ADAS Section: 605.2	1019 13 14 15 69 17 18 1	13½ min 17 max
182	Deer Run Camping Area: Deer Run Men's Restroom	[30.1074698 -97.280385 4]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	changing table protrudes in open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2	1. 15 P 17 18 19 20 21 22	

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
183	Deer Run Camping Area: Deer Run Men's Restroom	[30.1074513 , -97.280417 6]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	drinking fountain 26.5" knee clearance	Raise drinking fountain to provide required 27" knee clearance	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2	11 22 23 69 25 26 27 28	F MN - NOS CLAMANCE

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
184	Pioneer Village Camping Area: Cabin 12	[30.1147925 -97.278035 8]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	back right double bedroom - shelf lacks clear floor space due to bed obstruction 28"	Relocate bed to provide clear floor space at shelf.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3	The state of the s	48 min
185	Pioneer Village Camping Area: Cabin 12	[30.1148346 -97.278062 6]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Mats or rugs at doors must be secured The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door.	front door - 76" overhead, loose rug on exterior kitchen door to outside - 73" light in overhead double doors to back- left and right- fast close, 76" overhead for both	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	3 60 70 71 12 18 18 18 18 18 18 18 18 18 18 18 18 18	

Finding Area I	Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Cam	neer Village nping Area: Cabin 12	[30.1148106 -97.278030 4]	the face of the door and the stop, with the	back right room with double beds - door can't open 90 due to bed in maneuvering clearance, .75" change in level, 28" wide, gap on interior, 1.5" gap within right side room from entry with single large bed - 28" wide, 1" change in level, 77" height, 7" maneuvering clearance on push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, fill gaps at door entries to max .5".	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
							3 74 75 76 77 18 79 400 80 3 74 75 76 77 18 79 400 80	
187	Pioneer Village Camping Area: Cabin 12	[30.1148697 -97.278057 3]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	back right room double beds - 29" width at entry	Widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 48 min 24 max 48 min 9
188	Pioneer Village Camping Area: Cabin 12	[30.1148389 -97.278046 5]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	right single room - width from bed to exterior window is 15"	Widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	TO BE	24 max 46 min 24 max 46 min 25 max 46 min 26 min 26 min 26 min 27

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
189	Pioneer Village Camping Area: Cabin 12	[30.1148389 , -97.278003 6]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	right single room window hardware at 66"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	\$5 61 62 63 801 65 66 87 8	10 max 48 max
190	Pioneer Village Camping Area: Cabin 12	[30.1148761 , -97.278046 5]	The door is equipped with a door closer and returns to a closed position too quickly. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum.	back dbl doors - fast close	Inspect, adjust, and maintain closing speed on door closers	2015 ABAAS Section: 404.2.8.1 2012 TAS Section: 404.2.8.1 2010 ADAS Section: 404.2.8.1		90° 5 seconds min. 12°
191	Pioneer Village Camping Area: Cabin 12	[30.1148018 -97.278003 6]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	2.25" gap at entry, 1" gap at sidewalk near entry	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3	2 3 4 5 6	destinant distribute of transit  Imp distribute of transit  Strength of transit

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
192	Pioneer Village Camping Area: Cabin 12	[30.1147461 -97.278025 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	deterioration in entryway	Resurface AR where deterioration occurs	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		deminer discident of basel  berg discretion proposition to include the state of the
193	Pioneer Village Camping Area: Cabin 12	[30.1147276 -97.278046 5]	The curb ramp slope exceeds the maximum running slope (direction of travel) allowable of 8.33%. Curb ramps should have the least possible slope but in no case more than 8.3% (1:12).	8.6% running slope	Correct curb ramp slope to max 8.33%	2015 ABAAS Section: 406.1  2012 TAS Section: 406.1  2010 ADAS Section: 406.1		The Transition Limiting Salarah
194	Pioneer Village Camping Area: Cabin 12	[30.1147833 -97.278068]	There is no accessible route to the trash cans. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to trash	Create an accessible route with crushed stone or other outdoor material from parking or walkway to trash cans.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Printy  State of the Control

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
195	Pioneer Village Camping Area: Cabin 12	[30.1148761 -97.277960 7]	The required clear floor space is not deep enough. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	2 of 2 picnic tables lack clear floor space due to table placement, fire pit surface is ground level, hook is 49" AGL	Remove objects or enlarge CFS to min 48" depth at wheelchair space of picnic table as a smart practice. Correct fire building surface to be 9" min above the ground as a smart practice. In the alternative, replace fire ring with a compliant accessible fire ring. Replace operable parts with ones usable without a tight pinch or grasp, mounted within reach range of 15" to 48" above the ground as a smart practice.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		48 min
196	Pioneer Village Camping Area: Cabin 12	[30.1147647 , -97.278046 5]	provide a minimum width of 36 inches. The	far left room, 2 double beds- 31" between beds, 23" from bed to bench	Widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	70 21 22 23 1P 25 26 2:	24 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
197	Pioneer Village Camping Area: Cabin 12	[30.1148204 -97.278025 1]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T-shaped space.	far left room- lacks turning space due to furniture	Relocate obstacles to create turning space in bedroom	2015 ABAAS Section: 304.3.1, 304.3.2 2012 TAS Section: 304.3.1, 304.3.2 2010 ADAS Section: 304.3.1, 304.3.2		60 min  Grade  24 min  12 min  12 min  12 min  12 min
198	Pioneer Village Camping Area: Cabin 12	[30.1148018 -97.277917 8]	Vertical clearance shall be 80 inches (2030 mm) high minimum. Guardrails or other barriers shall be provided where the vertical clearance is less than 80 inches (2030 mm) high. The leading edge of such guardrail or barrier shall be located 27 inches (685 mm) maximum above the finish floor or ground. EXCEPTION: Door closers and door stops shall be permitted to be 78 inches (1980 mm) minimum above the finish floor or ground.	far left room - both bedroom doors and the bathroom door on the left side were 76"	Replace doors with doors having 80" overhead clearance	2015 ABAAS Section: 307.4, 307.4 EXCEPTION  2012 TAS Section: 307.4, 307.4 Exception  2010 ADAS Section: 307.4, 307.4 Exception	73 74 75 76 77 75 76 77 75 76 77 77	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
199	Pioneer Village Camping Area: Cabin 12	[30.1148018 -97.278003 6]	Space unable to be audited due to additional furniture during renovation	furniture moved in these to spaces to replace flooring, unable to measure clear floor space	Ensure that all elements within the room have required clear floor space upon completion of renovation	Capture Section: 1		
200	Pioneer Village Camping Area: Cabin 12	[30.1148389 -97.277917 8]	The storage space is not within reach range. At least 50% of the storage space must be a minimum of 15 inches and a maximum of 48 inches off the floor with an unobstructed approach. For side approach, the maximum reach range is 46 inches high over an obstruction that is a maximum of 34 inches tall and 24 inches deep.	7 cabinets out of reach, 2 cabinets in reach, 6 drawers in reach	Lower 50% of shelving, or relocate supplies to within reach range, max 48" aff	2015 ABAAS Section: 804.5 2012 TAS Section: 804.5 2010 ADAS Section: 804.5		
201	Pioneer Village Camping Area: Cabin 12	[30.1147647 -97.278046 5]	The controls are located such that operation require reaching across burners. Where knee and toe space is provided, the underside of the range or cooktop shall be insulated or otherwise configured to prevent burns, abrasions, or electrical shock. The location of controls shall not require reaching across burners	oven controls on back panel	Replace oven with one having controls on the front panel	2015 ABAAS Section: 804.6.4 2012 TAS Section: 804.6.4 2010 ADAS Section: 804.6.4		30 max 30.35 max 30.35 max 40.35 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
202	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1148018 , -97.278003 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	mirror 42"	Lower mirror so reflective surface is max 40" aff	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	1 4 2 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	
203	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1148761 -97.278003 6]	The required 56 inches by 60 inches clear floor space for the water closet has been obstructed. The clear floor space around the water closet shall be 60 inches minimum measured perpendicular from the side wall and 56 inches minimum measured perpendicular from the rear wall.	sink and trash 36"	Relocate garbage can and sink to provide required 60" clearance around toilet.	2015 ABAAS Section: 604.3.  2012 TAS Section: 604.3.1  2010 ADAS Section: 604.3.1	34 35 55 37 38 39	
204	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1148575 -97.278046 5]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	centerline 18.75"	Remount toilets to 16" to 18" from the side wall to centerline	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2	07 61 81 ZI th C	16"-18"

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
205	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1147833 -97.278025 1]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	24" rear bar	Replace rear grab bar with one 36" long, mounted behind the toilet, 12" to one side of center and 24" to the other and 33" to 36" aff. In the alternative, leave as is, allowable exception if plumbing fixture can't be relocated.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2	1 10 21 22 23 <sup>1</sup> C :	Top of bar
206	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1148389 -97.278003 6]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	toilet paper 4" from toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		48 max
207	Pioneer Village Camping Area: Cabin 12 Restroom	[30.1148018 -97.278025 1]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	Second restroom has no sign	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom.	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		RESTROOM

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
208	Pioneer Village Camping Area: Cabin 14	[30.1164963 ,-97.279272 3]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (XX) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (XX) accessible stalls with a minimum of (XX) being designed as van accessible.	0 of 3 stalls marked accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Various Property   Various Pro
209	Pioneer Village Camping Area: Cabin 14	[30.1164352 , -97.279237 4]	The pass through kitchen is not wide enough. In pass through kitchens where counters, appliances or cabinets are on two opposing sides, or where counters, appliances or cabinets are opposite a parallel wall, clearance between all opposing base cabinets, counter tops, appliances, or walls within kitchen work areas shall be 40 inches minimum. Pass through kitchens shall have two entries.	20" clearance due to door	Renovate kitchen, or remove objects to provide required 40" clearance through kitchen	2015 ABAAS Section: 804.2.1 2012 TAS Section: 804.2.1 2010 ADAS Section: 804.2.1	CONTRACTOR OF THE PARTY OF THE	40 min
210	Pioneer Village Camping Area: Cabin 14	[30.1163795 -97.279205 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	pipes not insulated	Insulate exposed pipes under sink	2015 ABAAS Section: 606.5  2012 TAS Section: 606.5  2010 ADAS Section: 606.5		ACCESSIBLE LANATORY  To saving or regulation

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
211	Pioneer Village Camping Area: Cabin 14	[30.1164352 -97.279162 3]	The ceiling extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	71" at low end, 77 at high end	Raise ceiling to min 80"; leave as is if technically infeasible	2015 ABAAS Section: 307.4 2012 TAS Section: 307.4 2010 ADAS Section: 307.4	OLSE WAR AS SO	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
212	Pioneer Village Camping Area: Cabin 14	[30.1165095 -97.279033 6]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum.		Lower breaker box to max 46" above the finished floor (AFF) for a side reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2	SE AF OC SE DE CE ME VE OF AS	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
213	Pioneer Village Camping Area: Cabin 14	[30.1163981 -97.279162 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a gap greater than 1/2 inch wide. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Doors with spring hinges can close no quicker than 1.5 seconds. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, fill gaps at door entries to max .5". For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
214	Pioneer Village Camping Area: Cabin 14	[30.1164955 -97.279264 2]	The threshold has a vertical change greater than 1/4 inch high. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	back door - knob, 10" step	For all doors along the public circulation route ramp CILs at door entries to max .25" For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		
215	Pioneer Village Camping Area: Cabin 14	[30.1164166 -97.279226 7]	There is no accessible route to the cabin outdoor amenities. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no AR to picnic, fire pit, or chairs	Create an accessible route with crushed stone or other outdoor material from parking or walkway to picnic table, fire pit, and seating.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  PORT OF THE PORT OF

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
216	Pioneer Village Camping Area: Cabin 14	[30.1163981 -97.279205 2]	The fan control is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	front room - 79" to ceiling fan; back room- 80" to ceiling fan	Remount operable parts to be in reach range of 15" min to 48" max or extend a fan pull within reach range.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		10 max 48 max 48 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
217	Pioneer Village Camping Area: Cabin 14	[30.1164352 -97.279162 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Doors with spring hinges must not close faster than 1.5 seconds. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.		For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25" For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
218	Pioneer Village Camping Area: Cabin 14	[30.1164538 -97.279183 8]	The running slope of walking surfaces shall not be steeper than 1:20.	8.2% slope to entry	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
219	Pioneer Village Camping Area: Cabin 14	[30.1163981 -97.279226 7]	The overhang extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	72" height	Raise overhang to min 80", or pad object to prevent hazard in overhead clearance	2015 ABAAS Section: 307.3 2012 TAS Section: 307.3 2010 ADAS Section: 307.3	59 70 71 77 73 14 3 14 1	Any Projection
220	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164352 , -97.279216]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	mirror at 44"	Lower mirror so reflective surface is max 40" aff	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	31 35 40 43 46 45 46 4	20 10 10 10 10 10 10 10 10 10 10 10 10 10

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
221	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164723 , -97.279205 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	pipes lack insulation	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY  The many in equivariant
222	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1163981 -97.279291 1]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	hook is 58"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		xem 8b xem 8b xem 8b xem 8b
223	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164166 -97.279248 2]	The required 56 inches by 60 inches clear floor space for the water closet has been obstructed. The clear floor space around the water closet shall be 60 inches minimum measured perpendicular from the side wall and 56 inches minimum measured perpendicular from the rear wall.	sink at 42" in side clearance	Relocate sink to provide required 60" clearance around toilet. In the alternative, leave as is citing safe harbor.	2015 ABAAS Section: 604.3. 2012 TAS Section: 604.3.1 2010 ADAS Section: 604.3.1	2 39 CP ZP LP 00 6C E	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
224	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1163981 -97.279119 4]	The toilet seat is not located within the range allowed off the floor. The height of accessible water closets shall be a minimum of 17 inches and a maximum of 19 inches measured to the top of a maximum 2-inch high toilet seat.	toilet not installed	Upon reinstallation, ensure toilet seat is 17" to 19" aff	2015 ABAAS Section: 604.4 2012 TAS Section: 604.4 2010 ADAS Section:		17" to 19"
225	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164352 -97.279162 3]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	36" bar extends to 48"	Replace side grab bar with a 42" long bar mounted to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff.	604.4  2015 ABAAS Section: 604.5.1  2012 TAS Section: 604.5.1  2010 ADAS Section: 604.5.1	33 34 35 37 3	
226	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164538 -97.279248 2]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	24" rear bar	Replace rear grab bar with one 36" long, mounted behind the toilet, 12" to one side of center and 24" to the other and 33" to 36" aff.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2	21 22 23 3 25 26	Top of bar 33°-36°

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
227	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164723 -97.279205 2]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	37" AFF, cabinet is built directly on rear bar	Remount grab bars in accessible stall to 33" to 36" aff Remount objects to provide clearance min 12" above or 1.5" below grab bar	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4	34 35 6 37 38 39 40	
228	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164352 -97.279162 3]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	toilet paper can't be checked at this time	Ensure toilet paper dispenser is 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		7-9

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
229	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164352 -97.279119 4]	The controls are not located on the end wall between the the rim and the grab bar on open side of the bathtub and its centerline. Controls, other than drain stoppers, shall be located on an end wall. Controls shall be between the bathtub rim and grab bar, and between the open side of the bathtub and the centerline of the width of the bathtub.	handheld mount is closer to back wall	Remount controls to be between the centerline of the end wall and the rim of the tub	2015 ABAAS Section: 607.5 2012 TAS Section: 607.5 2010 ADAS Section: 607.5		control end wall
230	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1163795 -97.279226 7]	The bottom grab bar is not located correctly. Two grab bars shall be installed on the back wall, one installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the other located 8 inches minimum and 10 inches maximum above the rim of the bathtub. Each grab bar shall be installed 15 inches maximum from the head end wall and 12 inches maximum from the control end wall.	grab bars more than 15" from head wall	Replace grab bars with ones that extend to within 15" of head wall and 12" of control wall	2015 ABAAS Section: 607.4.1, 607.4.2.1 2012 TAS Section: 607.4.1.1, 607.4.2.1 2010 ADAS Section: 607.4.1, 607.4.2.1		8-10

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
231	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164723 , -97.279205 2]	The bath tub does not have an in-tub seat or a permanent seat at the head end of the tub as required. A permanent seat at the head end of the bathtub or a removable intub seat shall be provided. Allowable stresses for seats shall not be exceeded for materials used when a vertical or horizontal force of 250 pounds is applied at any point on the grab bar, fastener, mounting device, or supporting structure.	bath tub doesn't appear to have fixed or removable seat	Install fixed seat or provide removable seat for bathtub	2015 ABAAS Section: 607.3  2012 TAS Section: 607.3  2010 ADAS Section: 607.3		
232	Pioneer Village Camping Area: Cabin 14 Restroom	[30.1164352 -97.279205 2]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise.	both bedrooms - 77" overhead bathroom- 77" overhead, 30" wide front door- 77" tall, threshold cracked and uneven	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, repair, provide beveled threshold	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	22	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
233	Trails: Trailheads	[30.1001233 ,-97.272794 8]	There is no accessible route to the sign and trash can. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Fehr's overlook trail - no access to sign or trash	Create an accessible route with crushed stone or other outdoor material from parking or walkway to sign and trash can.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  POPUTY  Grant Age  And Age  Accessible and A
234	Trails: Trailheads	[30.1075533 -97.279795 3]	Benches shall have a 36" by 48" clear ground space (CGS) positioned near the bench with one side of the space adjoining an outdoor recreation access route (ORAR) or trail, as applicable The CGS shall not overlap with the ORAR or trail or another CGS	gray trail - no access to trailhead bench	Construct firm, stable, and slip resistant pads at least 36" by 48" adjacent to 20% of benches, and locate along an AR as a smart practice.	2015 ABAAS Section: 1011.2.1		
235	Trails: Trailheads	[30.1078434 -97.269876 5]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 8 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	gray trail parking loose gravel - approximately 8 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Machinery Street, March 1997, Street Street, March 1997, Street Street, March 1997, St

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
236	Trails: Trailheads	[30.1086857 , -97.283797 2]	There is no accessible route to the site elements. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Cart Path Trails no access to sign or trash or picnic areas; this area has been improved since the initial audit	Create an accessible route with crushed stone or other outdoor material from parking or walkway to site elements.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  FORM  FO

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
237	Group Barracks : Group Barracks Parking	[30.107597, -97.280170 8]	There are no van accessible parking stalls.  1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 11 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	lacks van stall	Add van parking sign to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' per the table	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2,		Section of Article States (Section States St
238	Group Barracks : Group Barracks Parking	[30.1078759 -97.280079 6]		building 3 - 3.6% stall, 5.4% aisle; building 4 - 2.4% in stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		4-4-68

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
239	Group Barracks : Group Barracks Parking	[30.1078596 -97.279977 7]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	building 2 sign 54"; main barrack building 54"	Raise existing accessible parking signs so lowest end of bottom sign is min 60" aff	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6	CC SSI	Van Accessible 60 nches min.
240	Group Barracks : Group Barracks Parking	[30.1078444 , -97.280009 9]	Element meets all standards and requirements	parking scoping complies, 5 of 11 stalls accessible	None	2010 ADAS Section: N/A		
241	Group Barracks : Group Barracks Main Building	[30.1078225 , -97.279881 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	side door near playground - 6.6% slope on interior side, 10lbf	For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
242	Group Barracks : Group Barracks Main Building	[30.1078396 -97.279972 3]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	Play Area Entry stairs - 6 stairs missing contrast	SMART PRACTICE Install contrasting strip along front 2" of each tread The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4  2012 TAS Section: 504.4 Advisory  2010 ADAS Section: 504.4		EXTEROR STARS ALL TREAGS ARE TO HAVE WARRING STRIPES PER
243	Group Barracks : Group Barracks Main Building	[30.1078234 ,-97.279988 4]	The handrails as well as the handrail extensions are not at the correct height. The tops of handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground.	Play Area Entry stairs - handrails to high - left 40" AFF, right 39" AFF	Replace or remount handrails to 34" to 38" aff.	2015 ABAAS Section: 505.4  2012 TAS Section: 505.4  2010 ADAS Section: 505.4	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	38-388 (a) stairs

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
244	Group Barracks : Group Barracks Main Building	[30.1077947 , -97.279913 3]	Element meets all standards and requirements	ramp complies	None	2010 ADAS Section: N/A	
245	Group Barracks : Group Barracks Main Building	[30.1078634 -97.280004 5]	Element meets all standards and requirements	6 of 6 picnic tables on crusher fines path comply, of accessible design	None	2010 ADAS Section: N/A	
246	Group Barracks : Group Barracks Main Building	[30.1078503 -97.279961 6]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	Front Entry Stairs - no visual contrast	SMART PRACTICE Install contrasting strip along front 2" of each tread The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4 2012 TAS Section: 504.4 Advisory 2010 ADAS Section: 504.4	EXTERIOR STARS ALL TREADS ARE TO HAVE WARNING STRIPES PER

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
247	Group Barracks : Group Barracks Main Building	[30.1078039 -97.279956 3]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	from front entry steps	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		½ max ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½ ½

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
248	Group Barracks : Group Barracks Main Building	[30.1079, -97.27991]	The supports extend down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	room 501 - eight pillar supports hang down to 68"	Raise supports to min 80", or pad object to prevent hazard in overhead clearance along AR	2015 ABAAS Section: 307.4  2012 TAS Section: 307.4  2010 ADAS Section: 307.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
249	Group Barracks : Group Barracks Main Building	[30.1079, -97.27991]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	room 501 - 27" high knee clearance for tables	Provide tables and work surfaces at 28" to 34" aff with required knee and toe clearances.	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		Space
250	Group Barracks : Group Barracks Main Building	[30.1078567 -97.279948 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Front of building entry to 501 - loose rug on inside, trash on push; 501 main dbl doors - 12# on left dbl, fast close	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
251	Group Barracks : Group Barracks Main Building	[30.1078382 , -97.279975]	Element meets all standards and requirements	501 back door to porch - door complies; door to kitchen - door complies	None	2010 ADAS Section: N/A		
252	Group Barracks : Group Barracks Main Building	[30.107906, -97.279977 7]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Front entry door from porch - Right is 19lbf, loose rug on interior side, 6.5% slope on inside	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
253	Group Barracks : Group Barracks Main Building	[30.107863, -97.280015 3]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Women's restroom - bar obstructs knee clearance	Remove bar to provide 8" deep knee clearance.	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.4, 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.4, 306.3.5, 306.3.1	20 21 22 23 24 25 26 27 2	Knee clearance
254	Group Barracks : Group Barracks Main Building	[30.1078555 -97.279972 3]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	Women's restroom - stall door mounted 4.25" from wall	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet.	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2		Alternate door location

Finding	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number	7 ii da 2000 ii piioii	20020119	i intering	/ C Duit	Tiossimion dutien	Ontainon.	1 1101.00	. iguio
255	Group Barracks : Group Barracks Main Building	[30.1078411 -97.279913 3]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Women's restroom - 2.4% slope by hook	Correct or repair slope to max 2.08%.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
256	Group Barracks : Group Barracks Main Building	[30.1078318 -97.279902 6]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	8lbf push	Inspect, adjust, and maintain 5 lbf to open doors.	2015 ABAAS Section: 404.2.9 2012 TAS Section: 404.2.9 2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
257	Group Barracks : Group Barracks Main Building	[30.1078225 -97.279956 3]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	509 - door entry 22" width, storage in circulation path; janitor closet - storage in pass- through	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Replace doors with doors having 80" overhead clearance and 32" clear width.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
258	Group Barracks : Group Barracks Main Building	[30.1078613 -97.280009 9]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	storage 505 - no room to move freely due to chair storage	Widen AR to compliant 36" clear width.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 48 min 24 max 48 min 24 max 24

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
259	Group Barracks : Group Barracks Main Building	[30.1078596 -97.279902 6]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T-shaped space.	storage 505 - no space within, no access to tables in back	Relocate obstacles to create turning space in storage room.	2015 ABAAS Section: 304.3.1, 304.3.2 2012 TAS Section: 304.3.1, 304.3.2 2010 ADAS Section: 304.3.1, 304.3.2		60 min
260	Group Barracks : Group Barracks Main Building	[30.1078762 -97.279967]	Element meets all standards and requirements	505 and 506 doors comply	None	2010 ADAS Section: N/A		
261	Group Barracks : Group Barracks Main Building	[30.1078318 -97.279956 3]	provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24	505 meeting room - room is being temp used as office while they finish floors, there is usually a long table in center with chairs; building use has changed since initial audit	Assure there is a 36" wide route to all aspects of the room upon completion of renovations.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 40 min 44

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
262	Group Barracks : Group Barracks Main Building	[30.1078609 ,-97.279969 7]	The supports projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	505 meeting room - supports at 68"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
263	Group Barracks : Group Barracks Main Building	[30.1078039 -97.280063 5]	The operable parts are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	505 meeting room - 55" to curtain, 72" to screen	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	1 6 5 6 6 6 6 6 6 6 6 6 6 6 6 6 7 7 7 7 7	10 max 48 max 48 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
264	Group Barracks : Group Barracks Main Building	[30.1078596 -97.279913 3]	The operable parts are not accessible because they require tight grasping, pinching or twisting of the wrist.	505 meeting room - projector and curtains require tight pinch	Replace operable parts with ones usable without a tight pinch or grasp.	2015 ABAAS Section: 309.4 2012 TAS Section: 309.4 2010 ADAS Section: 309.4		
265	Group Barracks : Group Barracks Main Building	[30.1078318 , -97.279956 3]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	men's restroom - cfs for hook reduced by trash	Remove, or relocate storage in CFS at fixtures and operable parts along the AR Provide required 30" by 48" CFS at operable parts	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		48 min
266	Group Barracks : Group Barracks Main Building	[30.1078318 , -97.279934 8]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open.	Men's restroom - trash in pull side clearance 9", 10 lbf	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain 5 lbf to open interior doors	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception	THE PROPERTY OF THE PARTY OF TH	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
267	Group Barracks : Group Barracks Main Building	[30.1078411 , -97.279967]	Combination refrigerators and freezers shall have at least 50 percent of the freezer space 54 inches (1370 mm) maximum above the finish floor or ground. The clear floor or ground space shall be positioned for a parallel approach to the space dedicated to a refrigerator/freezer with the centerline of the clear floor or ground space offset 24 inches (610 mm) maximum from the centerline of the dedicated space.	Kitchen - table is 35" back from the center	Relocate items for required CFS at refrigerator.	2015 ABAAS Section: 804.6.6 2012 TAS Section: 804.6.6 2010 ADAS Section: 804.6.6	2 2 2 4 4 5 5 10 10 10 10 10 10 10 10 10 10 10 10 10	
268	Group Barracks : Group Barracks Main Building	[30.1078503 , -97.279924 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Exterior kitchen door: 15lbf, loose mats on both sides of door	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		
	Γ		I	I	I			
269	Group Barracks : GB1	[30.1082236 , -97.279559 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Front and Back door: 10lbf, loose mats	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
270	Group Barracks : GB1	[30.1081566 , -97.27957]	Element meets all standards and requirements	5 interior doors and the screen door are compliant	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
271	Group Barracks : GB1	[30.1081938 -97.279548 6]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	1st bedroom on right from entrance - 29" around bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	CE 18 05 05 85 75 35 65	24 max. 46 min. 24 max.
272	Group Barracks : GB1	[30.1081938 -97.279559 3]	The hooks are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	1st bedroom on right from entrance - coat hooks 66"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	10 max 48 max
273	Group Barracks : GB1	[30.108203, -97.279559 3]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	2nd bedroom on the right 32" around bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	27 28 29 30 31 1 33 34 35 1	24 max 49 min 24 max 49 min 49

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
274	Group Barracks : GB1	[30.1081938 -97.279537 8]	The hooks are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	2nd bedroom on the right coat hooks 66"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	57 58 89 W 61 62 63 th 65 66 67 68	10 max 48 max 48 max
275	Group Barracks : GB1	[30.1081752 -97.279559 3]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	1st bedroom on the left 34" around bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	20, 20, 31 (1) 33 34 35	24 max 48 min 24
276	Group Barracks : GB1	[30.108208, -97.279578 1]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	bunkroom aisle 26"	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	25 26 27 28 29	24 max 48 mm 24 max 98 98 98 98 98 98 98 98 98 98 98 98 98

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
277	Group Barracks : GB1	[30.1081752 -97.279575 4]	There is no accessible route to the picnic tables. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accesible route to tables behind building 1	Create an accessible route with crushed stone or other outdoor material from parking or walkway to picnic tables.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Print's deal of the control o
278	Group Barracks : GB1	[30.1081195 , -97.279634 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	step to back porch of building 1	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	2 2 3 4 2 6 7 4 6 7 6 7	½ max ½ ½ ½ ½

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
279	Group Barracks : GB1 Restroom	[30.1081566 -97.279580 7]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench		Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	2 23 % 25 26 27 28 29 3	Bench 48" min
280	Group Barracks : GB1 Restroom	[30.1081195 -97.279634 4]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	no sign	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
281	Group Barracks : GB1 Restroom	[30.108203, -97.27957]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	sink 34.5"	Lower sinks to max 34" aff to front of rim.	2015 ABAAS Section: 606.3  2012 TAS Section: 606.3  2010 ADAS Section: 606.3	31 EZ 33 34 35	Toe clearance  To degree to space
282	Group Barracks : GB1 Restroom	[30.1081706 -97.279607 6]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	side bar 13" from rear wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff.	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1	SI PL EL LL	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
283	Group Barracks: GB 2	[30.1083689 -97.279466 8]	The operable part is too high and is out of the maximum reach range for a side approach. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches maximum and the depth of the obstruction shall be 24 inches maximum. Where the reach depth exceeds 10 inches, the high side reach shall be 46 inches maximum.	66" to hooks in hallway behind bench, 48" to light behind beds in left from entry room, right from entry room, right 2 from entry, 1 of 3 shelves by sink in reach range	Lower lights to max 46" for a side reach over an obstruction. Relocate bench for access to hooks and lower one to max 48" AFF.	2015 ABAAS Section: 308.3.2 2012 TAS Section: 308.3.2 2010 ADAS Section: 308.3.2		19 mer. Considered Chetrotted

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
284	Group Barracks : GB 2	[30.1084258 -97.279441 3]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	lacks clear floor space at windows	Remove, or relocate storage in CFS at fixtures and operable parts along the AR	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		48 min
285	Group Barracks : GB 2	[30.1084072 , -97.279430 5]	Element meets all standards and requirements	6 interior doors within comply	None	2010 ADAS Section: N/A		
286	Group Barracks : GB 2	[30.108384, -97.279465 4]	Element meets all standards and requirements	10 of 10 doors within comply. (all fire doors)	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
287	Group Barracks : GB 2	[30.1083237 -97.279462 7]	The building entrance is not located on an accessible route. When a building, or portion of a building, is required to be accessible, an accessible route of travel shall be provided to all portions of the building, to accessible building entrances and between the building and the public way. All walks, halls, corridors, aisles, skywalks, tunnels, and other spaces that are part of an accessible route must comply. An accessible route of travel must not pass through kitchens, storage rooms, restrooms, closets or other spaces used for similar purposes. At least one accessible route within the boundary of the site must be provided from public transportation stops, accessible parking and accessible passenger loading zones and public streets or sidewalks to the accessible building entrance they serve. The accessible route shall, to the maximum extent feasible, coincide with the route for the general public. At least one accessible route shall connect accessible buildings, facilities, elements and spaces that are on the same site. At least one accessible route shall connect accessible building or facility entrances with all accessible spaces and elements.	no AR to porch entry	Create AR with crushed and compacted stone or similar outdoor material from parking or sidewalk to building entrance	2015 ABAAS Section: F206.2.1  2012 TAS Section: 206.2.1  2010 ADAS Section: 206.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
288	Group Barracks : GB 2	[30.1083515 -97.279409 1]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	stand; right from entry - 34" between bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 48 min 44 min 44 min 22 8 8

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
							se et le se se es ign it. ce o	
							E PE EE LE DE DE DE DE DE DE DE DE	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
289	Group Barracks : GB 2	[30.1082935 -97.279393]	Element meets all standards and requirements	AR to 2 complies	None	2010 ADAS Section: N/A		
290	Group Barracks : GB 2 Restroom	[30.1083376 , -97.279446 6]	Element meets all standards and requirements	sink area in shower and hallway comply, shelf complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
291	Group Barracks : GB 2 Restroom	[30.1083469 , -97.279446 6]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the	bench 24.5" length, 18" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	17 14 16 20 21 22 20 27 20 20 30 31	Bench  48" min
292	Group Barracks : GB 2 Restroom	[30.1083863 -97.279457 4]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	toilet paper dispenser too close	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		um 99

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
293	Group Barracks : GB 2 Restroom	[30.108442, -97.279449 3]	The required 56 inches by 60 inches clear floor space for the water closet has been obstructed. The clear floor space around the water closet shall be 60 inches minimum measured perpendicular from the side wall and 56 inches minimum measured perpendicular from the rear wall.	clear floor space obstructed by trash	Relocate trash can to provide required 60" clearance around toilet.	2015 ABAAS Section: 604.3. 2012 TAS Section: 604.3.1 2010 ADAS Section: 604.3.1		
294	Group Barracks : GB 2 Restroom	[30.1083852 -97.279461 4]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	no signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC.
295	Group Barracks : GB3	[30.1084536 -97.279967]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Front and Back door: 10lbf, loose mats	For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
296	Group Barracks : GB3	[30.1084536 , -97.279988 4]	Element meets all standards and requirements	5 interior doors and the screen door are compliant	None	2010 ADAS Section: N/A		
297	Group Barracks : GB3	[30.108442, -97.279983 1]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	2nd bedroom on the left 29" in front of window controls	Remove, or relocate storage in CFS at fixtures and operable parts along the AR	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		48 min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
298	Group Barracks : GB3	[30.1084444 -97.279967]	The coat hook is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	first bedroom on the left coat hooks 66"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	10 max 48 max 48 max
299	Group Barracks : GB3	[30.1084548 -97.280013 9]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	2nd bedroom on the left 34.5" around bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	9 30 31 12 33 34 35
300	Group Barracks : GB3	[30.1084606 -97.279999 2]	The coat hook is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	2nd bedroom on the left coat hooks 66"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1	10 max 15 min 15 min 15 min 16 min 16 min 16 min 17 min 18 min 19

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
301	Group Barracks : GB3	[30.108456, -97.279988 4]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	bunkroom aisle ony 22.5"	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	20 21 22 23 23	24 max 48 min 24 max 48 min 24 max 24
302	Group Barracks : GB3	[30.1084258 -97.280031 4]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	1st bedroom on the right 31" around bed	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	EEE DE	24 max 48 min 24 max 48 min 9
303	Group Barracks : GB3	[30.108449, -97.279950 9]	There is no accessible route to the entry. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accesible route to back porch of building 3	Create an accessible route with crushed stone or other outdoor material from parking or walkway to entry.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  PROPERTY AND ACCESSIBLE ENTRANCES  ACCESSIBL

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
304	Group Barracks : GB3 Restroom	[30.1084629 -97.280009 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Restroom lacks signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character Remount signage on wall, latch side of the door, 48" to baseline of lowest character and 60" to baseline of highest character Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character Remount signage to the proper location based on the type of door provided	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		FUC.
305	Group Barracks : GB3 Restroom	[30.1084444 -97.279956 3]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	bench 18" x 26"	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	15 to 17 18 19 20 21 29 26 27 28 29 3	Bench 48" min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
306	Group Barracks : GB 4	[30.1083446 -97.280294 2]	Element meets all standards and requirements	accessible route to 4 complies	None	2010 ADAS Section: N/A		
307	Group Barracks : GB 4	[30.1083608 -97.280256 7]	The operable part is too high and is out of the maximum reach range for a side approach. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches maximum and the depth of the obstruction shall be 24 inches maximum. Where the reach depth exceeds 10 inches, the high side reach shall be 46 inches maximum.	right bedroom from entry- 66" to hooks over bench, light at 48"; right 2 from entry- 65" hook over bench, 48" light over bed; bunk room - hook over bench 65", window control at left end at 76" obstructed by bed; right 3 - 48" light over bed	Lower operable parts to max 46" for a side reach over an obstruction. Relocate benches and lower at least one hook to max 48" AFF.	2015 ABAAS Section: 308.3.2  2012 TAS Section: 308.3.2  2010 ADAS Section: 308.3.2	1 62 63 C 65 66 67 T WHEN WILLIAM STATES OF 15 15 25 3 T 15 15 15 15 15 15 15 15 15 15 15 15 15	10 ms. Characterid University of the

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number								
1								

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
308	Group Barracks : GB 4	[30.1083423 -97.280321]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	hooks in entry at 65", hooks in open pantry at 65.5"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1	30 63 63 63 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 66 65 65	10 max 48 max
309	Group Barracks : GB 4	[30.1083794 , -97.280286 2]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	right 1 bedroom - 36" from bed to bench, 29" from bed to wall, 26" from bed to night stand, obstructs window controls CFS; right 2 - bench to bed 33.5", bed to wall 31", wall to night stand 27" and obstructs window controls; bunk room - 32" between beds on left side; right 3 - 28" from bed to wall, 27" to night stand and no CFS for window controls	Relocate furniture to provide 36" route around all sides of the bed and to all room amenities.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1	30 31 ct 33 34 35 30	24 max 48 min 24 max 48 min 24 max 90 min 24

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number	Area Description	LavLong		AS BUILT	Recommendation	Citation		rigure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos  The state of SE 11 CE 22  The state of SE 21 CE 22  The state	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
310	Group Barracks : GB 4	[30.1083376 -97.280286 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	bunk room lacks maneuvering clearance on pull	Relocate storage, furniture and other obstacles to create 60" maneuvering clearance around door	2015 ABAAS Section: 404.2.4.1, 404.2.4.4 2012 TAS Section: 404.2.4.4, 404.2.4.1 2010 ADAS Section: 404.2.4.4, 404.2.4.1	The state of the s
311	Group Barracks : GB 4	[30.1083608 -97.280278 1]	Element meets all standards and requirements	front door complies, right 1 door complies	None	2010 ADAS Section: N/A	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
312	Group Barracks : GB 4	[30.1083446 -97.280296 9]	The building entrance is not located on an accessible route. When a building, or portion of a building, is required to be accessible, an accessible route of travel shall be provided to all portions of the building, to accessible building entrances and between the building and the public way. All walks, halls, corridors, aisles, skywalks, tunnels, and other spaces that are part of an accessible route must comply. An accessible route of travel must not pass through kitchens, storage rooms, restrooms, closets or other spaces used for similar purposes. At least one accessible route within the boundary of the site must be provided from public transportation stops, accessible parking and accessible passenger loading zones and public streets or sidewalks to the accessible building entrance they serve. The accessible route shall, to the maximum extent feasible, coincide with the route for the general public. At least one accessible route shall connect accessible buildings, facilities, elements and spaces that are on the same site. At least one accessible spaces and elements.	no AR to back porch	Create AR with crushed and compacted stone or similar outdoor material from parking or sidewalk to building entrance	2015 ABAAS Section: F206.2.1 2012 TAS Section: 206.2.1 2010 ADAS Section: 206.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
313	Group Barracks : GB4 Restroom	[30.1083423 -97.280310 3]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	lacks sign	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		The state of the s
314	Group Barracks : GB4 Restroom	[30.1083701 -97.280321]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	bench 18" by 26"	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5	13 14 15 (p) 17 to 19 20 21 22 2	Bench 48" min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
315	Administrative Building: Administrative Building	[30.1093723 , -97.285378 3]	New construction and alterations must be accessible.	administrative building being renovated at time of audit	Ensure renovations are compliant with all accessibility requirements.	Capture Section: 1		
316	Administrative Building: Administrative Building	[30.109374, -97.285379 7]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4.  Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.  Maneuvering clearances shall have a max slope of 2.08%. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	3 interior doors with no pull maneuvering clearance door knobs	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, Exception		
317	Administrative Building: Administrative Building	[30.1093281 -97.285358 2]	50% of the single accommodation restrooms provided in this grouping are not nearly compliant. The restrooms do not have the required minimum clear floor space or maneuvering clearances for the toilet, The restrooms do not have the required minimum clear floor space or maneuvering clearances for the lavatory, The entry doors do not contain the required minimum maneuvering spaces on the pull/push sides, The entry doors encroach into the required clear floor space for fixtures, Grab bars are missing and/or incorrectly installed, Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both, The restrooms contain floor level changes greater than a 1/2 inch, the showers are too small and missing numerous accessible elements.	bathroom is not accessible	Create compliant wheelchair accessible restrooms and correct all features to be accessible if feasible to meet 50% compliant restrooms in this location.	2015 ABAAS Section: 603.1 2012 TAS Section: 603.1 2010 ADAS Section: 603.1		50° MIN CLEAR 30° MIN.

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
318	Administrative Building: Administrative Building	[30.1093806 -97.285293 9]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	than 4"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		

Finding	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number								
319	Administrative Building: Administrative Building	[30.1093511	Stairways must have handrails on both sides. Handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground. The top handrails shall extend a minimum of 12 inches beyond the top nosing and shall be parallel with the floor or ground surface. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The orientation of at least one handrail, including the extension, shall be in the direction of the run of the stair and perpendicular to the direction of the stair nosing. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4 inches minimum and 6 1/4 inches maximum, and a cross-section dimension of 2-1/4 inches maximum. The hand grip portion of handrails shall have a smooth surface with no sharp corners. Gripping surfaces (top or sides) shall be uninterrupted by newel posts, other construction elements or obstructions. Any wall or other surface adjacent to the handrail shall be free of sharp or abrasive elements. Handrails projecting from a wall shall have a space of 1-1/2 inches minimum between the wall and the handrail.		Install handrails on both sides of stairway, mounted 34" to 38" aff with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall. Tape or secure rug at top of staircase.	2015 ABAAS Section: 505.2  2012 TAS Section: 505.2  2010 ADAS Section: 505.2		Stairs Italia X - total Aspn

## Bastrop State Park - Park Rd 1-A Bastrop, TX 78602

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
320	Administrative Building: Administrative Building	[30.1092493 , -97.283947 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 1 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	0 of 6 parking spaces accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		We have a change have been a change of the c
321	Administrative Building: Administrative Building	[30.1093347 -97.285272 4]	There is no accessible route to the administrative building. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accessible route	Create an accessible route with crushed stone or other outdoor material from parking or walkway to administration building.	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		ACCESSIBLE ENTRANCES  Profits  Accessible Entrances  Accessible En