
Access Audit Site Report





Engineering with Precision, Pace & Passion. (224) 293 - 6451 www.wtengineering.com Cedar Hill State Park 1570 FM1382 Cedar Hill, TX 75104 Accessibility Evaluation Inspection Date: 09/12/2022 Inspectors: Tanya Scheibe

-	over Letter		
С	EDAR HILL STATE PARK PROGRAM REPORT 202301		
F	indings		
	Headquarters Area		
	Employee Areas		
	South Day Use Area		
	Coyote Crossing Camping Area		
	Hog Wallow Camping Area	137	
	Penn Farm Agricultural History Center	152	
	Central Day Use Area	186	
	North Day Use Area		
	Lakeview Camping Area	260	
	Eagle Ford Camping Area		
	Shady Ridge Camping Area	289	
	Trails	294	

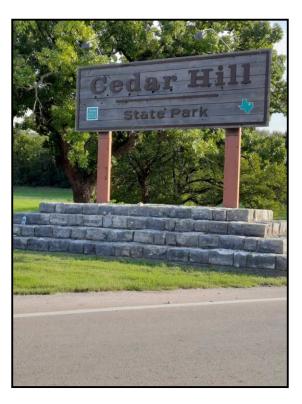



July 28, 2023

Jessica Burke, ADA Coordinator Support Resources Texas Parks and Wildlife Department 4200 Smith School Road Austin, TX 78744

Dear Jessica,

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the Cedar Hill State Park located at 1570 FM1382, Cedar Hill, TX 75104. The facility was inspected on 09/12/2022.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.

2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and findings new to the technical standards such as recreation elements

3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.

4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.

5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.

Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.

224.293.6333 wtengineering.com





If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.

Legend of Abbreviations:

AFF... Above the finished floor AGL... Above Ground Level AR... Accessible Route CIL... Change in Level CFS... Clear Floor Space EPC... Elevated Play Component GLPC...Ground Level Play Component

Sincerely,

Tanya Schule

Tanya Scheibe, RAS #1369





TEXAS PARKS AND WILDLIFE DEPARTMENT CEDAR HILL STATE PARK

AMERICANS WITH DISABILITIES ACT COMPLIANCE INITIATIVE PROGRAM AND POLICY REPORT JULY 28, 2023

INTRODUCTION

The Texas Parks and Wildlife Department (TPWD) is subject to the many requirements of the Americans with Disabilities Act (ADA). To assist it in meeting those requirements, TPWD retained The WT Group, LLC (WTG) Accessibility Practice in 2021.

Title II of the ADA applies to TPWD sites, along with 89,000 other units of state and local government. WTG has a broad scope of work that matches the ADA requirements found in title II. It includes:

- Schedule and conduct project management meetings;
- Conduct access audits of 89 sites, including Cedar Hill State Park;
- Prepare a site report that describes deficits at Cedar Hill State Park, and suggests solutions to those deficits;
- Provide guidance regarding the programs or opportunities Texans can enjoy at Cedar Hill State Park;
- Conduct community engagement events to determine the access preferences and priorities of Texans who visit Cedar Hill State Park;
- Provide a Cedar Hill State Park Transition Plan that identifies deficits, notes solutions, identifies the officer responsible for barrier removal, and notes the phase or timing of barrier removal;
- Provide a GIS shapefile regarding the accessibility of Cedar Hill State Park;
- Provide a method of tracking barrier removal at Cedar Hill State Park; and
- Report to TPWD leadership and stakeholders.

THIS REPORT

This report addresses program and policy advice, and then the WTG observations of deficits at Cedar Hill State Park. Other deliverables are provided under separate cover.

What is a Program?



A unit of state or local government is required to make the "programs" it offers accessible to people with and without disabilities. The term "program" is broadly defined as an opportunity made available by the state to the public, and the term public includes both people with and without disabilities. As an example, if a state park offers camping it must make certain that some campsites are of an accessible design.

The number to be made accessible is called scoping and it is usually a percentage or ratio of the similar sites. For example, if a state park has outdoor constructed features such as grills, fire pits, and benches, it must make 20% of an accessible design. Those 20% accessible must be dispersed throughout the park.

Hiking	Fishing
Camping	Bird Watching
Swimming	Playgrounds
Lodging	Beaches
Boating	Interpretive activities
Parking	Visitor Centers
Trams	Picnicking
Sports fields	Viewing areas
Restrooms	Grilling

In an ADA context, "programs" at a state park include but are not limited to:

The Federal and Texas Accessibility Standards

The current Texas Accessibility Standards (TAS 2012) became effective in 2012 after an amendment process. Those Standards are almost identical to the federal 2010 Standards for Accessible Design, and both effectively address parking, entries, restrooms, and other typical building elements. They also address playgrounds, boating and fishing areas, and sports fields and courts. They do not however address some of the assets at Cedar Hill State Park. Trails, campsites, and picnic areas are not yet a final and enforceable state or federal standard.

That will change at the end of 2023 or early 2024. The Texas Department of Licensing and Regulation (TDLR) has signaled its intent to adopt the pending federal guidance for key outdoor assets integral to TPWD sites like Cedar Hill State Park. This includes trails, beaches, campsites, picnic areas, viewing areas, and constructed park assets like grills, fire pits, and benches.

In discussing the Standards, it is important to use the correct definition of park assets. Most definitions are found in TAS 2012 at section 106. As noted above, TDLR plans to add the pending federal guidance regarding some outdoor areas to TAS. It is important to remember that the Standards set the floor, not the ceiling. Making a slope more gentle, or a route wider, is always a smart practice with universal design benefits.

Some selected definitions of park assets common to TPWD are noted below.

- **Trail**: A pedestrian route developed primarily for outdoor recreational purposes. A pedestrian route developed primarily to connect elements, spaces, or facilities within a site is not a trail.
- **Trailhead**: An outdoor space that is designed by an entity responsible for administering or maintaining a trail to serve as an access point to the trail. The junction of two or more trails or the undeveloped junction of a trail and a road is not a trailhead.
- **Picnic Facility**: A site or portion of a site developed for outdoor recreational purposes that contains picnic units.
- **Picnic Unit**: An outdoor space in a picnic facility used for picnicking that contains outdoor constructed features.
- **Outdoor Constructed Features**: Picnic tables, fire rings, grills, fireplaces, wood stoves, trash and recycling receptacles, water hydrants, utility and sewage hookups, outdoor rinsing showers, benches, and viewing scopes provided at outdoor recreation facilities.
- **Camp Shelter**: A partially enclosed structure that provides campers and hikers cover from weather and that does not contain plumbing fixtures or kitchen appliances. Camp shelters are not transient lodging facilities or residential dwelling units.
- **Camping Facility**: A site or portion of a site developed for outdoor recreational purposes that contains camping units.
- **Camping Unit**: An outdoor space in a camping facility used for camping that contains outdoor constructed features, parking spaces for recreational vehicles, tent pads or tent platforms, or camp shelters.
- Viewing Area: An outdoor space developed for viewing landscapes, wildlife, or other points of interest.
- **Boarding Pier**: A portion of a pier where a boat is temporarily secured for the purpose of embarking or disembarking.
- **Boat Launch Ramp**: A sloped surface designed for launching and retrieving trailered boats and other watercraft to and from a body of water.
- **Gangway**: A variable-sloped pedestrian walkway that links a fixed structure or land with a floating structure. Gangways that connect to vessels are not addressed by these Standards.
- **Transition Plate**: A sloping pedestrian walking surface located at the end(s) of a gangway.
- **Play Area**: A portion of a site containing play components designed and constructed for children.
- **Play Component**: An element intended to generate specific opportunities for play, socialization, or learning. Play components are manufactured or natural; and are standalone or part of a composite play structure.



Two other key outdoor assets are not included in the definitions. Both are defined below.

- **Beach access routes**: A beach access route (BAR) connects an entry point to the beach to the water, as defined below:
 - At a tidal beach, to the high tide level
 - At a river beach, to the mean high water level
 - At a lake, pond, or reservoir beach, to the normal recreation water level

A BAR can be temporarily placed at a beach for all hours the beach is open, and need not be a permanent fixture.

• Outdoor Recreation Access Routes (ORAR): A route that connects outdoor recreation assets at an outdoor recreation site. An ORAR is not a trail.

Conditions for Exceptions at Certain Outdoor Recreation Assets

In developing the scoping and technical requirements for accessibility at beaches, trails, and other outdoor developed areas, a wide net was cast to assure a variety of perspectives. The process involved:

- Officials from states with beaches and trails
- Officials from local entities with beaches and trails
- People with disabilities
- Landscape architects and civil engineers
- Parks and recreation officials

Throughout the process, all agreed that there are times that an existing beach, a new beach, an existing trail, or a new trail cannot meet the technical requirements for accessibility. The belief of regulatory bodies however is that these conditions should arise infrequently. The four conditions for exception are defined and discussed below.

• Section 1019.1.1: Compliance is not practicable due to terrain.

This is best clarified as naturally occurring terrain. It is applicable to both existing trails, and new trails. When locating and designing new trails, making the trail accessible should be a very high priority. *This is especially important at Cedar Hill State Park where none of the five existing trails are accessible.*

• Section 1019.1.2: Compliance cannot be accomplished with the prevailing construction practices.

This is best clarified as a reference to prohibitions on the use of foreign soil or motorized equipment. As an example, if a trail bed is being carved by TPWD staff and volunteers on their hands and knees, with pick axes, shovels, and hoes, all because of a prohibition on motorized equipment in the park, this exception may apply

• Section 1019.1.3: Compliance would fundamentally alter the function or purpose of the facility or the setting.



This is best clarified as having a clear understanding of the purpose of the asset. A sharply ascending trail in a mountainous West Texas state park may have the intended use of endurance training. To "flatten" the trail is possible from a design perspective, but the trail then loses its function or purpose.

• Section 1019.1.4: Compliance is limited or precluded by any of the following laws, or by decisions or opinions issued or agreements executed pursuant to any of the following laws:

Endangered Species Act (16 USC 1531 et seq.);

National Environmental Policy Act (42 USC 4321 et seq.);

National Historic Preservation Act (16 USC 470 et seq.);

Wilderness Act (16 USC 1131 et seq.); or

Other federal, State of Texas, or local laws the purpose of which is to preserve threatened or endangered species; the environment; or archeological, cultural, historical, or other significant natural features.

There are other mitigating factors regarding accessibility. Four are discussed below.

- Construction Tolerance (see 104.1.1 Construction and Manufacturing Tolerances): All dimensions are subject to conventional industry tolerances except where the requirement is stated as a range with specific minimum and maximum end points. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Equivalent Facilitation (see 103 Equivalent Facilitation): Nothing in these requirements prevents the use of designs, products, or technologies as alternatives to those prescribed, provided they result in substantially equivalent or greater accessibility and usability. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Technical Infeasibility (see 106 Definitions): With respect to an alteration of a building or a facility, a condition wherein compliance with a requirement of this Standard has little likelihood of accomplishment because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements. This is likely most applicable to making transition plan retrofits.
- Safe Harbor (see US DOJ title II section 35.151(c)): If a public entity has constructed or altered required elements of a path of travel in accordance with the specifications in either the 1991 Standards or the Uniform Federal Accessibility Standards, or TAS 1994, before March 15, 2012, the public entity is not required to retrofit such elements to reflect incremental changes in the 2010 Standards solely because of an alteration to a primary function area served by that path of travel. *It is important to note that the 1991 Standards and TAS 1994 did not address technical requirements for recreation assets, such as boating areas, fishing areas, beaches, campsites, trails, picnic*



areas, playgrounds, sports fields, sports courts, and more. The Safe Harbor approach cannot be applied to such assets.

Campsites

We have sorted campsites into several categories. These include tent only campsites, recreational vehicle campsites, shelter sites, and sites that combine features in a hybrid approach, such as an RV site with utilities.

In evaluating Cedar Hill State Park, WTG used TAS 2012, the pending outdoor developed areas guidance, and smart practices that make public spaces and outdoor recreation assets more accessible to people with disabilities. We also applied the concepts of construction tolerance, technical infeasibility, safe harbor, equivalent facilitation, and other imitations on when a site must be made accessible.

What is Inclusion?

The title II regulation requires Cedar Hill State Park programs to be available in the most integrated setting. This is defined as the setting in which people with and without disabilities interact together. Using the camping example above, inclusive camping would locate accessible campsites amidst inaccessible campsites to facilitate interaction between campers with and without disabilities.

While all programs must be inclusive, that does not mean that everyone with every type of disability or health condition must be allowed to participate in every program. The concept of essential eligibility allows Cedar Hill State Park to apply neutral conditions to determine who uses programs. Again, using camping, if there are 20 campsites and a person with a disability is the 21st person to register, the neutral concept of "capacity" applies and that camper has no place to camp. If that camper is the 20th person to seek camping but does not pay the campsite fee, the neutral concept of paying the same fees can apply and that camper will not camp at Cedar Hill State Park.

How Can Programs in General Be Made Accessible?

The title II regulation at section 35.150(b) lists a number of ways to make Cedar Hill State Park programs accessible. These include but are not limited to:

- Removing architectural barriers;
- Removing communication barriers;
- Changing rules and policies;
- Providing additional staff training;
- Providing different staff ratios;
- Providing adaptive equipment;
- Providing auxiliary aids and services such as a sign language interpreter;

- Providing accessible transportation when transportation is part of the opportunity;
- Reassignment of services to accessible locations;
- Conducting duplicate opportunities, one in accessible location and the other in an inaccessible location;
- Designing and constructing new facilities that are therefore fully compliant;
- Home visits; and
- Other methods that make programs accessible.

Cedar Hill State Park staff should be aware of, and ready to, provide such modifications.

Are the Cedar Hill State Park Programs Accessible and Inclusive?

In our review of the opportunities available at Cedar Hill State Park, we saw:

- Two playgrounds at North Day Use area and Lakeview;
- Five fishing areas at South Day Use area, Central Day Use area, and North Day Use area;
- Two boat ramps at South Day Use area and North Day Use area;
- One kayak rental at South Day Use area;
- Two swimming areas at South Day Use area and North Day Use area;
- 331 hybrid RV/tent campsites at Hog Wallow, Coyote Crossing, Lakeview, Eagle Ford, and Shady Ridge;
- 30 tent only sites at the Primitive Camping area;
- Five trails throughout the Park;
- 17 picnic areas at South Day Use area, Central Day Use area, and North Day Use area;
- Seven shelters at Central Day Use area, and North Day Use area; and
- Two group picnic areas at Central Day Use area, and North Day Use area.

Of these, the accessibility status and our recommendation is:

- Make one of the playgrounds at North Day Use area or Lakeview accessible and leave the other as is and inaccessible until it is later altered for other purposes;
- Of the five fishing areas, maintain the accessible fishing area at Central Day Use area and make corrections in the site report and make one more fishing area at South Day Use area or North Day Use area accessible;
- Make either one of the two boat ramps accessible at South Day Use area or North Day Use area and leave the other as is and inaccessible until later altered for other purposes;
- Make the kayak rental at South Day Use area accessible;

- Make either one of the two swimming areas at South Day Use area or North Day Use area accessible and leave the other as is and inaccessible until it is later altered for other purposes;
- Maintain the four accessible hybrid RV/tent campsites at Eagle Ford and implement the site report retrofits;
- Make seven more of the 331 hybrid RV/tent campsites at Hog Wallow, Coyote Crossing, Lakeview, Eagle Ford, and Shady Ridge accessible and disperse the accessible campsites among these areas;
- Leave as is the remaining 320 campsites at Hog Wallow, Coyote Crossing, Lakeview, Eagle Ford, and Shady Ridge as is and inaccessible until later altered for other purposes;
- Make three of the 30 tent campsites at the Primitive Camping area accessible;
- Leave the remaining 27 campsites at the Primitive Camping area as is and inaccessible until later altered for other purposes;
- Maintain the accessible Shoreline Trail at North Day Use area and implement the site report retrofits;
- Leave the four other trails as is and inaccessible until later altered for other purposes;
- Maintain the 11 accessible picnic areas at North Day Use area and implement the site report retrofits;
- Leave the six picnic areas at South Day Use area and Central Day Use area as is until later altered for other purposes;
- Maintain the two accessible shelter picnic areas at North Day Use area and implement the site report retrofits;
- Leave the remaining five shelter picnic areas at Central Day Use area and North Day Use area as is and inaccessible until it is later altered for other purposes;
- Maintain the accessible group picnic area at North Day Use area and implement the site report retrofits; and
- Leave the group picnic area at Central Day Use area as is and inaccessible until later altered for other purposes.

Camping Clarification

A number of campsites of each type provided within the park (see the Outdoor Developed Area Guidelines at 244.2, which will eventually be a part of the revisions to TAS 2012) must be retrofit to make the program of camping accessible, and to meet the soon-to-be-adopted State of Texas standard.

We have sorted campsites into two types: tent only and hybrid (usable by tent or RV), and group. TPWD or Cedar Hill State Park staff can also distinguish these sites by amenities provided (covered tables, water only, electric, scenic views, etc.).

If concessionaires are to provide camping experiences at the Park, those sites too must include accessible campsites.

Conclusion

The staff at Cedar Hill State Park offer experiences and assets desired by park visitors. Those same experiences and assets must be accessible to and usable by people with disabilities. See the following site report to identify barriers and recommendations for barrier removal.

JNM/TRS/CEDAR HILL STATE PARK PROGRAM REPORT 202301

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
1	Headquarters Area: HQ - Parking	[32.6221216 -96.979560 5]	Element meets all standards and requirements	60 standard, 4 accessible (plus 16 standard oversized, 1 ADA oversized)	None	2010 ADAS Section: N/A		
2	Headquarters Area: HQ - Parking	[32.6219586 -96.979431 7]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	East side spaces: shared access aisle (AA) - 3%; West side spaces: left stall - 3.5%, shared AA - 2.7%, right stall - 2.8%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4	<image/>	+-+-

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
3	Headquarters Area: HQ - Parking	[32.621997, -96.979409 6]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	2 east side spaces meet van accessible requirements but lack van accessible sign	Add van parking signs to one van accessible stalls.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		CCCSSIBLE 60 nches min.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
4	Headquarters Area: HQ - Parking	[32.622064, -96.979221]	The parking sign/s are missing. Parking space identification signs shall include the International Symbol of Accessibility (ISA). Signs identifying van parking spaces shall contain the designation "van accessible." All signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Oversized accessible parking space at HQ - lacks signage in access aisle identifying it as accessible	Acquire and mount at appropriate heights and locations accessible parking signs for all the stalls. Install sign in access aisle since oversized accessible stall is a pull- through space.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 60 inches min.
		-	-					
5	Headquarters Area: HQ - Exterior Accessible Route	[32.6219851 -96.979447]	The curb ramp on the accessible route contains cross slopes greater than 2%. Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	3% cross slope at ramp from stalls on exit side	Correct curb ramp cross slope to max 2.08%.	2015 ABAAS Section: 405.3 2012 TAS Section: 405.3 2010 ADAS Section: 405.3		
6	Headquarters Area: HQ - Exterior Accessible Route	[32.62202, -96.97953]	Element meets all standards and requirements	Ramp from access aisle on entry side, and ramp from exit lot comply	None	2010 ADAS Section: N/A		
7	Headquarters Area: HQ - Exterior Accessible Route	[32.6218288 -96.979317 7]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	2.7% on route to restrooms	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
8	Headquarters Area: HQ - Exterior Accessible Route	[32.62181, -96.9792]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Three gaps on route to building	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	Image: state of the state
9	Headquarters Area: HQ - Exterior Accessible Route	[32.6219143 -96.979248 3]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1.5" change in elevation (CIL) at ramp from inbound parking	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	Image: Second
10	Headquarters Area: HQ - Exterior Accessible Route	[32.621836, -96.979281 5]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	2.9% on route to building	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	
11	Headquarters Area: HQ - Exterior Accessible Route	[32.6218649 -96.979205 1]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	5.2% cross on route to building from inbound parking, exceeds 2.08% for 30'	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
12	Headquarters Area: HQ - Exterior Accessible Route	[32.6218744 -96.979180 9]	There is no accessible route to the info sign. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route (AR) to info sign at HQ	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the info sign.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIGLE ENTRANCES
13	Headquarters Area: HQ - Exterior Accessible Route	(32.6218178 -96.979130 2)	The 30 inches minimum by 48 inches minimum clear floor space required at the operable part is not flat (2% or 1:48 maximum slope) in all directions. Changes in level are not permitted at required clear floor or ground space except that slopes not steeper than 1:48 shall be permitted.	Slope of 3.3% in clear floor space (CFS) of map at HQ	Correct or repair slope in CFS to max 2.08%.	2015 ABAAS Section: 305.2 2012 TAS Section: 305.2 2010 ADAS Section: 305.2		48 min iu iu oc
14	Headquarters Area: HQ - Exterior Accessible Route	[32.6217571 -96.979153 6]	The 30 inches minimum by 48 inches minimum clear floor space required at the operable part is not flat (2% or 1:48 maximum slope) in all directions. Changes in level are not permitted at required clear floor or ground space except that slopes not steeper than 1:48 shall be permitted.	Slope of 4% in clear floor space (CFS) of after hours check-in station at HQ	Correct or repair slope in CFS to max 2.08%.	2015 ABAAS Section: 305.2 2012 TAS Section: 305.2 2010 ADAS Section: 305.2		48 min uiu OE
15	Headquarters Area: HQ - Exterior Accessible Route	[32.6217922 -96.979170 4]	The 30 inches minimum by 48 inches minimum clear floor space required at the operable part is not flat (2% or 1:48 maximum slope) in all directions. Changes in level are not permitted at required clear floor or ground space except that slopes not steeper than 1:48 shall be permitted.	Slope of 4.5% in CFS of garbage can at HQ entry	Relocate garbage can to be on a level surface.	2015 ABAAS Section: 305.2 2012 TAS Section: 305.2 2010 ADAS Section: 305.2		48 min u u u u u u u u u u u u

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
16	Headquarters Area: HQ - Exterior Accessible Route	[32.62197, -96.97919]	Element meets all standards and requirements	Bench at HQ entry complies	None	2010 ADAS Section: N/A		
17	Headquarters Area: HQ - Exterior Accessible Route	[32.6214875 -96.979565 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Firewood self-pay station operable parts at 62" above ground level (AGL)	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		10 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
18	Headquarters Area: HQ - Exterior Accessible Route	[32.62174, -96.97925]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking fountain at HQ restroom building - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		
19	Headquarters Area: HQ - Public Spaces	[32.6217843 -96.979109 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	HQ main entry double doors - loose floor mat on exterior, slope of 3.2% in pull side clearance, 17# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.11, 404.2.11 Exception	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
20	Headquarters Area: HQ - Public Spaces	[32.6217663 -96.979100 1]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Alarm control panel and locked box lack clear floor space (CFS)	Remove, or relocate storage in CFS at fixtures and operable parts along the AR.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3	<image/>	48 min
21	Headquarters Area: HQ - Public Spaces	[32.6217823 -96.979118 9]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Light switches at 55" AFF, alarm control buttons at 56" AFF or higher	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		To max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
22	Headquarters Area: HQ - Public Spaces	[32.6217773 -96.979084]	Element meets all standards and requirements	HQ - service counters comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
23	Headquarters Area: HQ - Public Spaces	[32.621782, -96.979104 2]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Brochure rack and various merchandise items exceed reach range	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		Ju max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
24	Headquarters Area: HQ - Public Spaces	[32.621802, -96.979111 5]	The threshold has a vertical change greater than 1/4 inch high. All interior doors must be maintained so that the operating pressure does not exceed 5 lbf to open.	HQ employee restroom door - 22# push, 1.5" change in elevation (CIL)	For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, inspect, adjust, and maintain 5 lbf to open interior doors.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
25	Headquarters Area: HQ - Public Spaces	(32.6217795 -96.979100 5)	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	Employee restroom - Lacks directional signage to a compliant restroom	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom.	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		
26	Headquarters Area: HQ - Public Spaces	[32.6217874 -96.979100 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks any signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
27	Headquarters Area: HQ - Public Spaces	[32.62167, -96.97903]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.	Small external door to park entry gates and booths - 21.5" wide, 1.5" change in elevation (CIL), vision window at 52.25"	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
	1		1	1	1	T		
28	Headquarters Area: HQ - Employee Spaces	[32.6217875 -96.979087 9]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	Lacks 36" clear width in corridor from lobby to employee spaces/offices due to storage shelves	Remove shelves to widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 440 min gi gi k k k k k k k k k k k k k k k k k k k

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
29	Headquarters Area: HQ - Employee Spaces	[32.6217872 -96.979116 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Door from lobby into employee area - knobs, lock requires tight pinch, lacks push side clearance due to storage shelves, change in elevation (CIL) of .75" due to high threshold	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, provide beveled threshold. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
30	Headquarters Area: HQ - Employee Spaces	[32.6217921 -96.979116 9]	The door opening does not provide at least 32 inches between the face of the door and the opposite stop. Door openings shall provide a clear width of 32 inches minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees.	Sliding door from lobby corridor to employee area behind registers/service counter lacks 32" clear width - 28.5" wide	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width.	2015 ABAAS Section: 404.2.3 2012 TAS Section: 404.2.3 2010 ADAS Section: 404.2.3		32 min. 997 Hinged Door

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
31	Headquarters Area: HQ - Employee Spaces	(32.6217526 -96.979117 4)	Element meets all standards and requirements	Employee area behind public service counters and corridor to other office spaces comply	None	2010 ADAS Section: N/A		
32	Headquarters Area: HQ - Employee Spaces	[32.6217599 -96.979104 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Supervisor's office - door locked, unable to access to test - knob hardware	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
33	Headquarters Area: HQ - Employee Spaces	[32.6217447 -96.979083 4]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Admin Office - 30" wide door, lacks pull side clearance due to storage	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. Replace doors with doors having 80" overhead clearance and 32" clear width.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
34	Headquarters Area: HQ - Employee Spaces	[32.6217566 -96.979134 6]	There is a change in level greater than 1/4 inch. I/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" change in elevation (CIL) to enter sink area of break room	Repair, bevel or ramp CIL along accessible route (AR) to max .25".	2015 ABAAS Section: 303.3 2012 TAS Section: 303.3 2010 ADAS Section: 303.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
35	Headquarters Area: HQ - Employee Spaces	[32.6217933 -96.979107 8]	The operable part is not accessible because it requires tight grasping, pinching or twisting of the wrist.	Window blind pulls (2) in HQ break room require tight pinch	Replace operable part with one usable without a tight pinch or grasp.	2015 ABAAS Section: 309.4 2012 TAS Section: 309.4 2010 ADAS Section: 309.4		
36	Headquarters Area: HQ - Employee Spaces	[32.6217805 -96.979129 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim in HQ break room at 36.5" AFF	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Fore clearance rec clearance de deer toor sace

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
37	Headquarters Area: HQ - Employee Spaces	[32.6217633 -96.979078 5]	Accessible lockers are not provided. 5% but not less than one of each type of locker must be accessible. Lockers of different size are considered different types. Although not specifically required, it is considered "best practices" that accessible elements be identified to prevent confusion for those needing accessible elements and to indicate to those that do not need accessible elements that they should only be used if others are unavailable.	HQ employee break room lockers - 16 lockers, 0 accessible	Designate 5% or no less than 1 locker as accessible with accessible hardware. Mount signage with the access symbol as a (smart practice). Mount hooks and operating mechanisms max 48" aff.	2015 ABAAS Section: F225.2.1 2012 TAS Section: 225.2.1 2010 ADAS Section: 225.2.1		Control of the second s
38	Headquarters Area: HQ - Employee Spaces	[32.6217556 -96.979090 7]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold has a gap greater than 1/2 inch wide. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	HQ exterior door from employee space to west side of building - gap of 1.5", loose floor mat on external side, fast close, 27# push, slope of 3% on pull side, lacks pull side clearance, lacks push side clearance - sliding doors 46.5" back	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, fill gaps at door entries to max .5". For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Number								

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
39	Headquarters Area: HQ - Employee Spaces	[32.6217931 -96.978987 4]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Ticket entry booth closest to HQ building - CIL/curb and slope of 13% at entry, sliding door has small hardware for opening door	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. Correct slope in door clearance to max 2.08%. Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
40	Headquarters Area: HQ - Employee Spaces	[32.6218312 -96.978925 2]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Ticket entry booth farthest from HQ building - CIL/step to enter	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide a ramp for access to the booth.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
41	Headquarters Area: HQ Public Women's Restroom	[32.6217867 -96.979297 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 35"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		ter desates
42	Headquarters Area: HQ Public Women's Restroom	[32.6217899 -96.979311 9]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 53.5" over sink	Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
43	Headquarters Area: HQ Public Women's Restroom	[32.6218027 -96.979314 6]	The baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changer protrudes when in the open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
44	Headquarters Area: HQ Public Women's Restroom	(32.6217995 -96.979325 3)	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too close to toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		6 15 min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
45	Headquarters Area: HQ Public Women's Restroom	[32.6218014 , -96.979301 2]	The sloped portion of the threshold is too steep. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise.	HQ women's restroom door - threshold broken	Replace thresholds at doors with beveled ADA thresholds.	2015 ABAAS Section: 404.2.5 2012 TAS Section: 404.2.5 2010 ADAS Section: 404.2.5		Max N N N N N N N N N N N N N N N N N N N
46	Headquarters Area: HQ - Public Men's Restroom	[32.621803, -96.979325 9]	The threshold is greater than 1/2 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be	HQ men's restroom door - threshold .5" not beveled	For all doors along the public circulation route, replace thresholds at exterior doors with ADA thresholds.	2015 ABAAS Section: 404.2.5		1/2 1/2 1/2 1/2
			beveled at 1:2 or less. I/4 inch is the maximum vertical rise.			2012 TAS Section: 404.2.5		
						2010 ADAS Section: 404.2.5		
47	Headquarters Area: HQ - Public Men's Restroom	[32.6217872 , -96.979311]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches	Sink rim at 35"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS	34	The clearance
			above the finished floor.			Section: 606.3	97 10 10 10 10 10 10 10 10 10 10 10 10 10	6" deep too space
						2010 ADAS Section: 606.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
48	Headquarters Area: HQ - Public Men's Restroom	[32.6217983 -96.979323 1]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 53.5" over sink	Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
49	Headquarters Area: HQ - Public Men's Restroom	[32.6217951 -96.979309 7]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changer protrudes when in the open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
50	Headquarters Area: HQ - Public Men's Restroom	[32.6218079 -96.979328 5]	The accessible toilet compartment does not provide proper toe clearance on the front and/or side partition. The front partition and at least one side partition shall provide a toe clearance of 9 inches minimum above the finish floor and 6 inches deep minimum beyond the compartment-side face of the partition, exclusive of partition support members. Toe clearance at the side partition is not required in a compartment greater than 66 inches wide. Toe clearance at the front partition is not required where the depth is minimum 62 inches for a wall hung toilet and minimum 65 inches for a floor mounted toilet.	Accessible stall lacks toe clearance at front partition	Provide toe clearance at the front and side partitions, or enlarge stall to provide the same.	2015 ABAAS Section: 604.8.1.4 2012 TAS Section: 604.8.1.4 2010 ADAS Section: 604.8.1.4		im im im

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
51	Headquarters Area: HQ - Public Men's Restroom	[32.6217935 -96.979319 1]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
52	Headquarters Area: HQ - Public Men's Restroom	[32.6217983 , -96.979323 1]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too close to toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		y min sh

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
53	Employee Areas: Maintenance	[32.62128, -96.98498]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold has a vertical change greater than 1/4 inch high. Hand- activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Maintenance building door - slope of 3.2% in pull side clearance, knobs, storage in push side clearance, CIL of 1.5"	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
54	Employee Areas: Maintenance	[32.62128, -96.98498]	The tactile EXIT sign is missing at the door. Wall signs identifying exits shall have characters raised 1/32 inch minimum and shall be uppercase characters a minimum of 5/8 inch and a maximum of 2 inches high. Braille shall be placed directly below the tactile characters; flush left or centered. Signs shall be located a minimum of 48 inches above the floor, measured from the baseline of the lowest tactile characters and 60 inches maximum above the finish floor or ground surface, measured from the baseline of the highest tactile characters. Where a tactile sign is provided at a door, the sign shall be located on the latch side. Where a tactile sign is provided at double doors the sign shall be located to the right of the right- hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall.		Mount compliant signage at all doors along the egress route.	2015 ABAAS Section: F216.4.1 2012 TAS Section: 216.4.1 2010 ADAS Section: 216.4.1		EXIT
55	Employee Areas: Maintenance	[32.62141, -96.98513]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Maintenance building office room - Storage in pull and push side clearance	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
56	Employee Areas: Maintenance	[32.6213, -96.98499]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Vehicle bays with large garage doors - 1.75" change in elevation (CIL) at both garage door entrances	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Repair, bevel, or ramp CILs at door entries to max .25".	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
57	Employee Areas: Maintenance	[32.62113, -96.98518]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%.	Maintenance Building - interior door from break room to large work room with ice machines - refrigerator in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
58	Employee Areas: Maintenance	(32.6214086 -96.985245 6]	Element meets all standards and requirements	Tool shed in maintenance yard complies	None	2010 ADAS Section: N/A		

Finding Area Descrip	tion Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
59 Employee Ar Maintenan	eas: [32.6214239 -96.985249 6]	areas shall only be required to comply with	Two plywood chemical and tire storage rooms in tool shed - Changes in elevation (CILs) to enter both spaces	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Repair, bevel, or ramp CILs at door entries to max .25".	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
60	Employee Areas: Maintenance	[32.6223307 -96.986744 9]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Lacks route to trailer, steps at entrance, knobs, assumed non- accessible restroom within	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Create an accessible route with crushed stone or other outdoor material from parking or walkway to office trailer near farm. Provide a ramp for access to the trailer. Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
61	Employee Areas: Maintenance	[32.62133, -96.98501]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	Employee restroom in maintenance building is not accessible - 32" wide by 63.5" deep	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1 2012 TAS Section: 603.1 2010 ADAS Section: 603.1		BY DIN CLEAR BY DIN HIL BY DIN HI

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
62	Employee Areas: Maintenance	[32.62139, -96.98505]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Break area - first aid and MSDS binder lack clear floor space	Remove, or relocate storage in CFS at fixtures and operable parts along the AR.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		48 min
63	Employee Areas: Maintenance	[32.62139, -96.98505]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Break area - MSDS sheets at 68.5"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		10 max
64	Employee Areas: Maintenance	[32.62139, -96.98505]	Knee and toe clearance has not been provided at the sink. The knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. The toe clearance is the space under the sink between the finish floor or ground and 9 inches above the finish floor 30 inches wide minimum.	Break area - sink has 18" knee clearance	Raise sink bowl to provide 27" knee clearance, in the alternative, acquire a shallower mode. In the alternative, leave as is as a side approach is allowed.	2012 TAS Section: 606.2 2010 ADAS Section: 606.2		Kree Clearance year Toe Clearance year Toe Clearance year to max 17.25

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
65	Employee Areas: Maintenance	[32.62139, -96.98505]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	3 picnic tables in break room in maintenance building lack knee and toe clearance	Provide tables and work surfaces at 28" to 34" AFF with required knee and toe clearances.	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		Knee Space Strang Strang Min Strang Min Strang Min Strang Min Strang Min Strang Min Strang Min Strang Stran
66	Employee Areas: Maintenance	[32.6211343 , -96.985030 9]	Element meets all standards and requirements	Open storage bays comply	None	2010 ADAS Section: N/A		
67	Employee Areas: Maintenance	[32.6211338 -96.985337 9]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Flammable storage - knob hardware at door Green shed - knob, 5.5" change in elevation (CIL)	Replace hardware with lever hardware or hardware operable without a tight pinch or grasp. Repair, bevel or ramp CIL at door.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
68	Employee Areas: Maintenance	[32.6211222 -96.985011 5]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 10 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Maintenance parking within maintenance yard lacks accessible stalls - approximately 10 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		United Formulation Reservation of partial 1 1
69	Employee Areas: Maintenance	[32.6217269 -96.985590 9]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 17 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Park police parking lacks accessible stalls, approximately 17 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		State State <th< td=""></th<>
70	Employee Areas: Residences	[32.6216426 -96.984968 8]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	North Residence - 4 step entry, parking pad ok	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Repair, bevel, or ramp CILs at door entries to max .25".	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
71	Employee Areas: Residences	[32.6095305 ,-96.993482 6]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	South Residence - 4 step entry, parking pad ok	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Repair, bevel, or ramp CILs at door entries to max .25".	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
72	Employee Areas: Urban Fish and Wildlife Office	[32.6137756 -96.996770 8]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Route to entry blocked by parking bumpers, route deterioration creates changes in elevation (CILs), 12% running slope, door lacks maneuvering clearance - 3% slope, narrow pad	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Resurface AR where deterioration occurs. Provide required maneuvering clearance on push and pull side of doors. Correct slope in door clearance to max 2.08%. Repair, bevel, or ramp CILs at door entries to max .25". Relocate or remove parking bumpers to provide access to walkway to building.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
73	South Day Use Area: South Day Use - Parking	[32.6112049 ,-96.997626 5]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 37 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 2 accessible stalls with a minimum of 1 being designed as van accessible.	Parking at restroom building 18 - 37 standard stalls, 1 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Non-Strate Stars, Name Name And Stars, Name 101 1
74	South Day Use Area: South Day Use - Parking	[32.6110603 -96.997648]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking at restroom building 18 - 2.6% aisle, 2.9% stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
75	South Day Use Area: South Day Use - Parking	[32.6111162 -96.997669 4]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Parking at RR 18 - stall degraded	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in previous finding.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		¹ / ₂ ² / ₂ ¹ / ₂

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
76	South Day Use Area: South Day Use - Parking	[32.6110942 -96.997669 4]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Parking at restroom building 18 - lacks van sign	Add one van parking sign to van sized accessible stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 00 nches min.
77	South Day Use Area: South Day Use - Parking	[32.6111459 -96.997707]	The access aisle is not located on an accessible route of travel to the accessible building entrance. Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.	Parking at restroom building 18 - aisle fails to connect to route	Extend accessible surfacing to connect to the sidewalk.	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		
78	South Day Use Area: South Day Use - Parking	[32.62176, -96.97913]	Element meets all standards and requirements	Parking at restroom building 19 - 28 standard stalls, 2 accessible	None	2010 ADAS Section: N/A		
79	South Day Use Area: South Day Use - Parking	(32.6126509 -96.997347 6]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall.	Parking at restroom building 19 - lacks van stall	Add van parking sign to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2, 208.2,		Bits Bits <th< td=""></th<>

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
80	South Day Use Area: South Day Use - Parking	[32.6125244 -96.997422 7]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Parking at restroom building 19 - surface cracks and dips in left stall	Resurface stalls and access aisles to eliminate gaps and cracks.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		¹ / ₂ ¹ / ₂ ¹ / ₂ ¹ / ₂ ¹ / ₂
81	South Day Use Area: South Day Use - Parking	[32.6142053 -96.996660 9]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 20 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Far north lot - 20 standard stalls, none accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Material Same State 13.0 1 14.0 1 15.0 1 16.0 1 17.0 1 18.0 1 19.0 1 10.0 1

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
82	South Day Use Area: South Day Use - Parking	[32.6137481 -96.996741 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 11 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Urban Wildlife office building parking - 11 standard stalls, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Main Main Main Main Main 1 1 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 0 1 1 1 1 1 0 1 1 1 1 1 0 1 1 1 1 1 0 1 1 1 1 1 0 1 1 1 1 1 0 1 1 1 1
83	South Day Use Area: South Day Use - Picnic Area	[32.61079, -96.99803]	There is no accessible route to the picnic areas. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to 24 picnic areas near restroom buildings 18 and 19 - each has a table and a grill	Create an accessible route with crushed stone or other outdoor material from parking or walkway to at least 5 picnic areas as a smart practice.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACESSULE ENTRACES
84	South Day Use Area: South Day Use - Picnic Area	[32.6109575 -96.997787 1]	There is no accessible route to the water station. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to water spigot at restroom building 18	Create an accessible route with crushed stone or other outdoor material from parking or walkway to water station.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESUL DITACHES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
85	South Day Use Area: South Day Use - Picnic Area	[32.6143342 -96.996617 6]	There is no accessible route to the picnic areas. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route picnic areas at far north lot	Create an accessible route with crushed stone or other outdoor material from parking or walkway to picnic areas.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE DATRANCES
					1			
86	South Day Use Area: South Day Use - Boat Ramp	[32.6144162 , -96.995655 1]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (XX) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (XX) accessible stalls with a minimum of (XX) being designed as van accessible.	Day use boat ramp parking - 106 standard stalls, 2 accessible, lacks accessible boat parking , 38 stalls, none accessible	Create three or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls. Create at least 2 accessible boat stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Description Team Repair Property 1 1
87	South Day Use Area: South Day Use - Boat Ramp	[32.6142324 -96.995588]	The accessible parking is not located on the shortest accessible route to the building. Accessible parking spaces serving a particular building or facility entrance shall be located on the shortest accessible route of travel from the parking to an accessible entrance.	Day use boat ramp parking - Accessible space not close to any features	Relocate stalls to be on the shortest AR to the building entry or park features.	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
88	South Day Use Area: South Day Use - Boat Ramp	[32.6144601 -96.995653 7]	The access aisle is not a minimum 5 feet wide. A car accessible parking stall's access aisle must be a minimum of 5 feet wide measured from centerline to centerline. Where the access aisle is not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the access aisle.	Day use boat ramp parking - left stall lacks compliant aisle, narrows at the top	Repaint access aisles to be 5' each.	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		access alse serving area to be be be be be be be be be be be be be

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
89	South Day Use Area: South Day Use - Boat Ramp	[32.6144583 -96.995695 3]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Day use boat ramp parking - right stall 2.8%, aisle 3%, left stall 2.8%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		4-4-
90	South Day Use Area: South Day Use - Boat Ramp	[32.6144154 -96.995660 5]	The accessible parking stall signage is incorrect and/or missing from each accessible parking space. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Stalls lack signage	Acquire and mount at appropriate heights and locations accessible parking signs where missing.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6		RESERVED PARKING

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
91	South Day Use Area: South Day Use - Boat Ramp	[32.6144322 -96.995651 1]	The access aisle is not located on an accessible route of travel to the accessible building entrance. Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.	Must travel through lot to site elements	Reconfigure accessible stalls to avoid requiring pedestrians to cross vehicular way, in the alternative, leave as is with striped crosswalk. In the alternative, relocate per previous finding.	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		
				-				
92	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110893 , -96.997740 7]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	Drinking Fountain at restroom building 18 - lacks high bowl	Add second high bowl fountain for standing persons.	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2		5 max 200
93	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110509 -96.997759 5]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking Fountain at restroom building 18 - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
94	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110747 -96.997752 7]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Men's restroom door at building 18 - 35# push (sticks), fast close (3 secs), 4.5% slope in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
95	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110745 -96.997752 6]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks Braille, too high, lacks raised characters and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1,		
	Courthe Doug Line	100 0110500	The minute is meaning to a birth Minute	Detterre educe of reimon		703.2, 703.5, 703.6		
96	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110598 , -96.997752 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
97	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110617 -96.997736 5]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Rim of sink at 36.25" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Fore clearance
98	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110681 -96.997747 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
99	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110553 -96.997758]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth is 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 52" above the finished floor (AFF), coat hook at 63.25" AFF	Lower operating mechanisms to max 48" above the finished floor (AFF) to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
100	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110598 ,-96.997752 6]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
101	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110521 -96.997752 6]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Ambulatory stall - toilet centerline 19.75" from wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uiu 09 35-37
102	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110489 -96.997755 3]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Ambulatory stall lacks self-closing door and exterior hardware	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
103	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110681 -96.997747 2]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars high at 36.75" above the finished floor (AFF) and 37.5" AFF	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
104	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110617 -96.997741 9]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser behind fromt edge of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		y y y y y y y y y y y y y y y y y y y

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
105	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110393 ,-96.997749 9]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.5% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
106	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6111193 -96.997712 8]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	2" change in elevation (CIL) on route from parking to restrooms at building 18	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3	Image: Second	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
107	South Day Use Area: South Day Use - Men's Restroom Building 18	[32.6110983 -96.997725]	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	Deterioration causing gaps and CILs near garbage can on route from parking to restrooms at building 18	Resurface AR where deterioration occurs.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Provide a list interest the set of a set of the set of
108	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110814 -96.997726 8]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Cross slope of 3% on route to Women's restroom at building 18	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
109	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110761 -96.997747 2]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Signage fails to have raised lettering and Braille, lacks ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
110	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110677 , -96.997747 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.25"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	8 39 40 41 42 43 44 8 39 40 41 42 43 44 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9 9	
111	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110802 , -96.997755 3]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.25"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3	34 35 36 37 38	Fore clearance
112	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110569 -96.997757 9]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
113	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110645 -96.997766]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 51" over sink, hook in stall at 63"	Lower operating mechanisms to max 48" above the finished floor (AFF) to highest operable part. Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
114	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110907 -96.997760 6]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lacks wheelchair stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
115	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110666 -96.997782 1]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20" to wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uite 09 35-37
116	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110647 -96.997760 6]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
117	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.611085, -96.997760 6]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars at 37.25"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
118	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110709 , -96.997744 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		1 1 1 1 1 1 1 1 1 1 1 1 1 1
119	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.6110786 , 96.997760 6]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	3.1% at floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
120	South Day Use Area: South Day Use - Women's Restroom Building 18	[32.611058, -96.997749 9]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Door - 11# push, fast close	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
121	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126179 -96.997418]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Men's restroom door at building 19 - slope of 4.9% in pull side clearance, fast close, 16# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
122	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126322 -96.997424 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 34.5" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Ter clearance ter clearance de dees too toosce
123	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126746 -96.997359 8]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
124	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126067 -96.997424 2]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 51" AFF	Lower operating mechanisms to max 48" above the finished floor (AFF) to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
125	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126131 -96.997408 1]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	18.75" from side partition	Remount toilets to 16" to 18" from the side wall to centerline.	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
126	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6125842 -96.997402 7]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	11.5" to closed side	Remount rear grab bar to behind the toilet, 12" to the wall side of center and 24" to the open side and 33" to 36" AFF.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2	2 10 11 19 10 10	op of bar 33"-36"
127	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126003 -96.997434 9]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum 0f 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Rear bar - 36.5" AFF, side bar - 37" AFF; TP stored on side grab bar	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF). Relocate loose rolls of toilet paper to min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
128	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126067 -96.997424 2]	Toilet compartment doors, including door hardware, shall comply with 404 except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42 inches (1065 mm) minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4 inches (100 mm) maximum from the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4 inches (100 mm) maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition. The door opening shall be 4 inches (100 mm) maximum from the front partition. The door shall be self-closing. A door pull complying with 404.2.7 shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area.	Lacks maneuvering clearance on approach to stall door - 41"	Widen AR to stall to min 42" clear width. In the alternative leave as is as correction may be technically infeasible.	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2	
129	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126067 -96.997418 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
130	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126131 , -96.997424 2]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	4.5" from wall	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet.	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2		Alternate door location
131	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126259 , -96.997424 2]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.3% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
132	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126229 -96.997410 6]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking fountain at restroom building 19 - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
133	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.6126484 -96.997416]	The required clear floor space is not deep enough. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Drinking fountain at restroom building 19 -Lacks 30" wide CFS at low bowl	Remove objects or enlarge CFS to min 30" width.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		48 min
134	South Day Use Area: South Day Use - Men's Restroom Building 19	[32.612629, -96.997432 1]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	Drinking fountain at restroom building 19 -Lacks knee clearance - 25.75"	Raise drinking fountain to provide required 27" knee clearance.	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2		PINI-INE CLAMACE
135	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126011 -96.997430 7]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 34.5"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		ter clasare ter c

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
136	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126375 -96.997428]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 49" over sink	Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
137	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126328 ,96.997390 5]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	Toilet centerline 20" from partition	Remount toilets to 16" to 18" from the side wall to centerline.	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2		¢ 16"-18"

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
138	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126005 -96.997417 3]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Side bar at 36.75", rear bar at 36.5"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
139	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126419 -96.997444 1]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
140	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126338 , -96.997409 3]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too far from front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		xeuu Sb 1 2.9
141	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.6126369 , 96.997425 3]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	4.9% slope at floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
142	South Day Use Area: South Day Use - Women's Restroom Building 19	[32.612612, -96.997401 2]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Women's restroom at building 19 door - 11# push, fast close	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
143	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131635 -96.994591 3]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Men's restroom at building 17 door - slope of 3.7% in pull side clearance, fast close, 16# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
144	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131854 -96.994585 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks Braille, lacks ISA, too high, lacks raised characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
145	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131982 , -96.994575 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.5"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
146	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.613211, -96.994575 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Rim of sink at 36.25" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Fore clearance
147	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131632 -96.994564 5]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
148	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131854 -96.994596 7]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth is 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 50.75" AFF, coat hook at 63 5" AFF	Lower hook to max 44" for a forward reach over the sink. Lower at least one hook to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
149	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131662 -96.994575 2]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
150	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131854 , -96.994575 2]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Ambulatory stall is 37.5" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing ambulatory stall to create required wheelchair stall per the previous finding.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		
151	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131541 -96.994564 5]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	19.75" to partition	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uiu 90 35-37
152	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131722 -96.994585 9]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
153	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131451 -96.994575 2]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Grab bars are 37" and 37.5" AFF; TP dispenser is 1.25" below grab bar	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF). Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" above the finished floor (AFF) and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
154	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131451 -96.9994585 9]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser is behind the front edge of the toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
155	South Day Use Area: South Day Use - Men's Restroom Building 17	[32.6131982 -96.994559 1]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.7% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
156	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.613176, -96.994563 4]	The door is equipped with a door closer and returns to a closed position too quickly. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum.	Women's restroom at building 17 door - fast close	Inspect, adjust, and maintain closing speed on door closers.	2015 ABAAS Section: 404.2.8.1 2012 TAS Section: 404.2.8.1 2010 ADAS		5 seconds min. 12"
						Section: 404.2.8.1		
157	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131678 -96.994582 2]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Signage lacks raised lettering, Braille and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 702.1		
						216.2, 703.1, 703.2, 703.5, 703.6		
158	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131641 -96.994558 1]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
159	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131841 -96.994590 3]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.5"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3	1 33 34 35 36 37 38 39	Tore clearance
160	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131778 -96.994579 5]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
161	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131738 -96.994574 2]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 53" over the sink	Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
162	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.613148, -96.994558 1]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
163	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.613157, -96.994579 5]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
164	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.6131389 -96.994568 8]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars at 37"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
165	South Day Use Area: South Day Use - Women's Restroom Building 17	[32.613166, -96.994536 6]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		e e e e e e e e e e e e e e e e e e e
	1							
166	South Day Use Area: South Day Use - Fishing Pier	[32.6142575 -96.995144 2]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	South Day Use Boat Launch - running slopes of 12.4% to 13.7% for 45' on route to left boarding pier - similar slopes to right boarding pier	Correct running slopes to max 5% to at least one boarding pier.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
167	South Day Use Area: South Day Use - Fishing Pier	[32.6142621 , -96.995123 4]	The route of travel at this location does not provide the required minimum width. The minimum clear width for sidewalks and walks is 36 inches.	Lacks route to boarding piers due to clear width of raised walkway at 35.5" wide	Widen route to min 36" clear width.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		
168	South Day Use Area: South Day Use - Fishing Pier	[32.6142983 -96.995052 9]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Lacks route to boarding piers due to 13.75" CIL	For changes in level 6" or greater, provide a ramp for access.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/2 1/2 1/2 1/2 1/2
169	South Day Use Area: South Day Use - Fishing Pier	[32.6140915 , -96.995128 7]	There is no accessible route to the life saving ring. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to life saving ring	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the life saving ring.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSILE DITENDES
170	South Day Use Area: South Day Use - Fishing Pier	[32.6140155 -96.995092 6]	There is no accessible route to the monofilament recycling bin. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to monofilament recycling bin	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the monofilament recycling bin.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		CACESULE DATADACAS

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
171	South Day Use Area: South Day Use - Fishing Pier	[32.6140579 ,-96.994940 4]	There is no accessible route to the kayak rental stations. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to kayak rental stations	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the kayak rental stations.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSILE DATABACES
172	South Day Use Area: South Day Use - Fishing Pier	[32.61411, -96.99493]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks ORAR to 1 of 1 accessible picnic tables near kayak rental station	Relocate accessible picnic table along an AR, and provide 36" min clear space around entire usable portion of table.	2015 ABAAS Section: F244.5.1		
173	South Day Use Area: South Day Use - Fishing Pier	[32.61306, -96.99409]	Element meets all standards and requirements	Parking lot at fishing pier - 25 standard, 1 accessible	None	2010 ADAS Section: N/A		
174	South Day Use Area: South Day Use - Fishing Pier	[32.6131654 .96.994053 8]	The access aisle is not a minimum 5 feet wide. A car accessible parking stall's access aisle must be a minimum of 5 feet wide measured from centerline to centerline. Where the access aisle is not adjacent to another parking space or access aisle, measurements shall be permitted to include the full width of the line defining the access aisle.	Access aisle is 57.75" wide	Repaint access aisles to be 5' each.	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		access alse serving car parking spaces

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
175	South Day Use Area: South Day Use - Fishing Pier	[32.613159, -96.994064 5]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 25 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Lacks van accessible space	Add van parking sign to 1 accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		Total of the second s
176	South Day Use Area: South Day Use - Fishing Pier	[32.613159, -96.994063 2]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Slopes of 7.1% in stall, 10.1% in access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
177	South Day Use Area: South Day Use - Fishing Pier	[32.613159, -96.994061 8]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Deterioration at head of stall and access aisle (AA), and along right edge of AA causing gaps and CILs, some shallow cracks and depressions in both	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in slope correction in previous finding.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		¹ / ₂ ¹ / ₂ ¹ / ₂
178	South Day Use Area: South Day Use - Fishing Pier	[32.6132343 ,-96.993917 3]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Shelter near fishing pier - Gaps (4) over .5" at 3 of 4 footings of corner posts	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Annuer di conduce ut l'annue Mandene di andere a strategia Mandene

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
179	South Day Use Area: South Day Use - Fishing Pier	[32.6132375 , 96.993917 3]	The angled support beams extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	Angled support beams at corner support posts lack 80" overhead clearance	Raise the angled support beams to min 80", or pad object to prevent hazard in overhead clearance.	2015 ABAAS Section: 307.3 2012 TAS Section: 307.3 2010 ADAS Section: 307.3		Any Projection
180	South Day Use Area: South Day Use - Fishing Pier	[32.6132359 -96.993917 3]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T- shaped space.	Lacks turning space- space too small with picnic table within	Enlarge shelter pad, or provide smaller table to allow for turning space.	2015 ABAAS Section: 304.3.1, 304.3.2 2012 TAS Section: 304.3.1, 304.3.2 2010 ADAS Section: 304.3.1, 304.3.2		24 min 12 min 12 min 12 min
181	South Day Use Area: South Day Use - Fishing Pier	(32.6132367 -96.993915 3]	Picnic tables are required to have clear ground space 36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches.	Lacks 36" around all usable sides of 1 of 1 accessible picnic tables	Relocate picnic table to provide required 36" clear ground space around all usable portions of the table as a smart practice. See previous finding for recommended table replacement.	2015 ABAAS Section: 1011.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
182	South Day Use Area: South Day Use - Fishing Pier	[32.6132359 -96.993917 3]	Where provided, at least one of each type of outdoor constructed feature shall comply with 1011. Where more than one of the same type of outdoor constructed feature is provided, at least two of the same type of outdoor constructed feature shall comply with 1011.	Route to outlet obstructed by picnic table and outlets exceed reach range	Relocate picnic table to provide route to and clear floor space at outlets. Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: F245.2.5.1		
183	South Day Use Area: South Day Use - Fishing Pier	[32.6132359 -96.993917 9]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Cross slope of 2.6% on route to shelter near fishing pier	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
184	South Day Use Area: South Day Use - Fishing Pier	[32.6132387 -96.993912 8]	Openings in the surface of outdoor recreation access routes shall not allow the passage of a sphere more than 1/2 inch (13 mm) in diameter. Advisory: Spaces between the boards in a boardwalk and drainage grates are examples of openings. Where possible, drainage grates should be located outside the minimum clear width of the outdoor recreation access route. Elongated openings should be placed so that the long dimension is perpendicular, or as close to perpendicular as possible, to the dominant direction of travel	Gaps of 1" and 2.5" on route to shelter near fishing pier	Correct or fill gaps along the ORAR to max .5" as a smart practice.	2015 ABAAS Section: 1016.6, Advisory 1016.6		
185	South Day Use Area: South Day Use - Fishing Pier	[32.6131548 -96.993971 1]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Deterioration and plant overgrowth creating CILs and gaps and slopes on route to Shelter near fishing pier	Repair surface or replace ORAR to be firm and stable as a smart practice.	2015 ABAAS Section: 1016. 2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
186	South Day Use Area: South Day Use - Fishing Pier	[32.6131984 -96.994559 4]	The wheelchair accessible drinking fountain is noncompliant. Spout outlets shall be 36 inches maximum above the finish floor or ground and be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers. The spout shall provide a flow of water at least 4 inches high minimum and shall be located 5 inches maximum from the front of the unit. The angle of the water stream shall be measured horizontally relative to the front face of the unit. Where spouts are located less than 3 inches of the front of the unit, the angle of the water stream shall be 30 degrees maximum. Where spouts are located between 3 inches and 5 inches maximum from the front of the unit, the angle of the water stream shall be 15 degrees maximum. On an accessible drinking fountain with a round or oval bowl, the spout must be positioned so the flow of water is within 3 inches of the front edge of the fountain.	Single low fountain fails, 25" knee clearance, knob hardware	Replace drinking fountain with a hi-lo bowl fountain.	2015 ABAAS Section: 602.1 2012 TAS Section: 602.1 2010 ADAS Section: 602.1		High Low Drawing Fourier Region Anterior Boox, Inc.
187	South Day Use Area: South Day Use - Fishing Pier	[32.62176, -96.97913]	Element meets all standards and requirements	Fishing pier complies if route corrected	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
188	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.612936, -96.997105 9]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Boardwalk at Perch Pond - cross slope of 4% near entrance to ramp to restrooms at building 19	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
189	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6135452 , -96.997083 4]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Boardwalk at Perch Pond - cross slope of 4.7% near tree protruding from boardwalk at turn to bird blind	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
190	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.61348, -96.99687]	Element meets all standards and requirements	Bird Blind at Perch Pond complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
191	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.61295, -96.99708]	Element meets all standards and requirements	3 of 4 garbage cans at Perch Pond boardwalk comply	None	2010 ADAS Section: N/A		
192	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6136633 , -96.996823]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks route (ORAR) to boardwalk entry from Urban Fish and Wildlife office side	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
193	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6136644 -96.996821 9]	The ramp is missing the required top landing. Ramps shall have landings at the top and the bottom of each ramp run.	Lacks top landing - lacks firm and stable surface	Create a level landing at the top of the ramp.	2015 ABAAS Section: 405.7 2012 TAS Section: 405.7 2010 ADAS Section: 405.7		do non 100 min 100

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
194	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.613658, -96.996823 3]	Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch (13 mm) in height measured vertically to the highest point. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, obstacles shall be permitted to not exceed 1 inch (25 mm) in height measured vertically to the highest point.	1.5" change in elevation (CIL) at top entry of ramp, multiple CILs (7) due to upheaval of boards	Repair, bevel or ramp CIL along the ORAR to max .5" or 1" for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1016.5, 1016.5 EXCEPTION		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
195	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6136029 -96.996828 6]	The ramp does not have compliant handrails. Handrails are required on both sides of all surfaces that are sloped greater than 5 percent (1:20). Handrails must be between 34 inches and 38 inches above the ramp surface, must extend beyond the top and bottom of the ramp 12 inches and be parallel to the floor or ground surface. The diameter of the handrails must be between 1 inches and 2 inches in cross-sectional nominal dimension for circular handrails and handrail gripping surfaces with a non- circular cross section shall have a perimeter dimension of 4 inches minimum and 6 inches maximum, and a cross-section dimension of 2 inches maximum. The clear space between handrails and walls must 1-1/2 inches minimum.	Ramp to boardwalk lacks compliant handrails	Install handrails that are rounded and/or extend to the ground, with handrail extensions and mounted 34" to 38" AFF.	2015 ABAAS Section: 505.1 2012 TAS Section: 505.1 2010 ADAS Section: 505.1		
196	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6132823 -96.997158 9]	Openings in the surface of outdoor recreation access routes shall not allow the passage of a sphere more than 1/2 inch (13 mm) in diameter. Advisory: Spaces between the boards in a boardwalk and drainage grates are examples of openings. Where possible, drainage grates should be located outside the minimum clear width of the outdoor recreation access route. Elongated openings should be placed so that the long dimension is perpendicular, or as close to perpendicular as possible, to the dominant direction of travel	Boardwalk at Perch Pond - multiple gaps (approximately 20) over .5"	Correct or fill gaps along the ORAR to max .5" as a smart practice.	2015 ABAAS Section: 1016.6, Advisory 1016.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
197	South Day Use Area: South Day Use - Boardwalk Near Perch Pond	[32.6136688 -96.996841 1]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks route (ORAR) to Birding info sign at boardwalk entry from Urban Fish and Wildlife office side	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
198	South Day Use Area: South Day Use - Exterior Accessible Route	[32.612578, -96.997377 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Restroom building 19 - 6" gap near sign	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		demonst disclore of transfer the demonstration of the demonstration of t
199	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6126369 -96.997336 8]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Restroom building 19 75" change in level (CIL) from right aisle	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		Max N N N N N N N N N N N N N N N N N N N

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
200	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6128311 -96.997252 3]	The ramp slope exceeds the maximum running slope (direction of travel) allowable of 8.33%. Ramps should have the least possible slope but in no case more than 8.3% (1:12).	Ramp to boardwalk - 8.8% bottom of first run, 8.7% top of 2nd run, 18.6% bottom of 2nd run	Correct slope of ramp to max 8.33%.	2015 ABAAS Section: 405.2 2012 TAS Section: 405.2 2010 ADAS Section: 405.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
201	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6128139 -96.997267 1]	The ramp on the accessible route contains cross slopes greater than 2%. Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	Ramp to boardwalk - 3% halfway down 3rd run, 3.9% on new boards on 2nd run	Correct ramp cross slope to max 2.08%. Cost included in running slope correction.	2015 ABAAS Section: 405.3 2012 TAS Section: 405.3 2010 ADAS Section: 405.3		
202	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6126965 , -96.997425 3]	Openings in floor or ground surfaces shall not allow passage of a sphere more than ½ inch (13 mm) diameter except as allowed in 407.4.3, 409.4.3, 410.4, 810.5.3 and 810.10. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Ramp to boardwalk - 2" gap at entry	Fill and maintain gaps to max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
203	South Day Use Area: South Day Use - Exterior Accessible Route	[32.612703, -96.997421 3]	There is a change in level greater than 1/4 inch. I/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	5" change in elevation (CIL) at entry	Repair, bevel or ramp CIL along accessible route (AR) to max .25".	2015 ABAAS Section: 303.3 2012 TAS Section: 303.3 2010 ADAS Section: 303.3		¹ / ₄ ² / ₄ ³ / ₄

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
204	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6127134 -96.997406 6]	The handrail is not continuous the entire length of the ramp. The handrail must be continuous. Handrails shall be placed on each side of each ramp, shall be continuous the full length of the ramp. The inside handrail on switch back or dogleg ramps shall always be continuous. Handrail shall have top and bottom extensions.	Ramp to boardwalk - handrails lacks top extensions	Replace handrail with one that is continuous along the full length of the ramp and having required top and bottom extensions.	2015 ABAAS Section: 505.3, 505.10.1 2012 TAS Section: 505.3, 505.10.1 2010 ADAS Section: 505.3, 505.10.1		12 mm 12 mm 100 100 100 100 100 100 100 1
205	South Day Use Area: South Day Use - Exterior Accessible Route	(32.6127112 -96.997417 3)	The handrail extension does not terminate properly. Extensions shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent ramp run.	End of handrails fails	Replace handrails with ones that are rounded and/or extend to the ground. Pricing in previous finding.	2015 ABAAS Section: 505.10.1 2012 TAS Section: 505.10.1 2010 ADAS Section: 505.10.1		
206	South Day Use Area: South Day Use - Exterior Accessible Route	(32.6125054 -96.997389 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Restroom building 19 - 5" gap from left stall	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Annual databa of trans-

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
207	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6131866 -96.994558 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Restroom building 17 - 1.5" gap and crack to fountain	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Annual databa of land
208	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6134283 -96.994732 4]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Restroom building 17 - 3.3% cross from parking to restroom - 1st 7 panels (40')	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
209	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132142 -96.994574 2]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Restroom building 17 - 3.7% cross in front of restrooms	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
210	South Day Use Area: South Day Use - Exterior Accessible Route	(32.6134785 -96.9994761 9)	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	Restroom building 17 - deteriorated at path entry	Resurface AR where deterioration occurs.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Purper is not informed in the second
211	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132052 -96.994481]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Restroom building 17 - 1.5" gap on route to fishing pier	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Annual distiller of hand
212	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132062 -96.994470 9]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Restroom building 17 - 3.1% cross slope from restrooms to fishing pier	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
213	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132229 -96.994174 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Restroom building 17 - 1.25" change in elevation (CIL) to fishing pier	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		¹ / ₄ max ¹ / ₄ ² ¹ / ₂ ¹ / ₄
214	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132098 ,-96.994384 4]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Restroom building 17 - 8.6% cross 5th panel to 25th panel from restrooms to fishing pier	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
215	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6132455 -96.994069 9]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	10.5% running to fishing pier	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
216	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6133102 -96.994021 6]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	12% running to fishing pier	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
217	South Day Use Area: South Day Use - Exterior Accessible Route	[32.6133795 , -96.993974 7]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	4.9% cross to fishing pier	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
218	South Day Use Area: South Day Use - Exterior Accessible Route	[32.613421, -96.993941 2]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	13.8% to fishing pier, entire stretch exceeds 8.33%	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
219	South Day Use Area: South Day Use - Exterior Accessible Route	[32.613339, -96.994002 8]	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	12 panel from top to pier - cracked	Resurface AR where deterioration occurs.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Provide the second seco

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
220	South Day Use Area: South Day Use - Park Site		There is no accessible route to the waters edge. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to swimming area	Create an beach access route from walkway to waters edge as a smart practice.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACESSIBLE DYTRACES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
221	Coyote Crossing Camping Area: CC - Parking	[32.62176, -96.97913]	Element meets all standards and requirements	Restroom building 16 parking - 5 stalls, one accessible	None	2010 ADAS Section: N/A		
222	Coyote Crossing Camping Area: CC - Parking	[32.616101, -96.991486 9]	The access aisle is missing at the accessible parking stall. Access aisles serving parking spaces shall adjoin an accessible route. Two parking spaces shall be permitted to share a common access aisle.	Restroom building 16 parking - lacks marked access aisle	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping.	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		
223	Coyote Crossing Camping Area: CC - Parking	[32.6161024 -96.991478 9]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 5 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Restroom building 16 parking - lacks van stall	Add van parking sign to 1 accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'. Cost included in previous finding.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2, 208.2.4		Name Patch Aller of Patch 1 1 1
224	Coyote Crossing Camping Area: CC - Parking	[32.6161171 -96.991495]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Restroom building 16 parking - 2.6% slope	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
225	Coyote Crossing Camping Area: CC - Parking	[32.6161035 -96.991476 2]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Restroom building 16 parking - surface degraded	Resurface stalls and access aisles to eliminate gaps and cracks.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2
226	Coyote Crossing Camping Area: CC - Parking	[32.61582, -96.98826]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 26 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 2 accessible stalls with a minimum of 1 being designed as van accessible.	3 small lots lack accessible stalls, largest lot has 10 stalls	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Bits Bits <th< td=""></th<>
227	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152547 -96.986749 2]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks Braille, ISA, raised characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
228	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152571 ,-96.986747 8]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.75"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
229	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152523 ,-96.986754 5]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.25"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Fore clearance
230	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152507 -96.986754 5]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
231	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152507 -96.986747 8]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth is 20 inches (510 mm), the high forward reach shall be 43 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 51" above the finished floor (AFF), hook at 62.75" AFF	Remount soap to max 44" AFF for a reach over the sink. Lower one hook to max 48".	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
232	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152731 ,-96.986761 3]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
233	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152731 -96.986750 5]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door and exterior hardware hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
234	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152475 -96.986755 9]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars at 37" AFF	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
235	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152539 -96.986739 8]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser behind the front edge of the toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		P-9
236	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152539 -96.986755 9]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 4.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		1
237	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152283 -96.986750 5]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.4% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
238	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152561 -96.986749 1]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench - 15.75" deep, lacks clear floor space at short end of bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
239	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.615237, -96.986749 1]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible showers	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		
240	Coyote Crossing Camping Area: CC - Trailhead Men's Restroom	[32.6152592 , -96.986745 6]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Men's restroom at building 15/Trailhead door - 20# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
241	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152616 -96.986752 8]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille, raised lettering, and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6	WOMEN	
						2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
242	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152452 , -96.986763 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.5"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	37 38 39 40 41 42 43 44 45 FIERCE	
243	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152664 -96.986758 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Ter clearance a' drep tor sace

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
244	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.615249, -96.986736 7]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY
245	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152536 -96.986736 7]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser 53" over sink, hook in stall at 53"	Lower coat hook to max 48" above the finished floor (AFF) to highest operable part. Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
246	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.615247, -96.986742 1]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1	0	
247	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152642 -96.986747 5]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
248	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152536 -96.986726]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars at 36.75"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
249	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.61526, -96.986747 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		y y y y y y y y y y y y y y y y y y y

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
250	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152175 -96.986726]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench 15.5" deep, lacks clear floor space on short axis	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
251	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152355 -96.986747 5]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible showers	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		SINCESSION OF THE SAME SAME SAME SAME SAME SAME SAME SAM
252	Coyote Crossing Camping Area: CC - Trailhead Women's Restroom	[32.6152459 ,-96.986764 2]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Women's restroom at building 15/trailhead door - 13# push, fast close	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
253	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160954 -96.991285 6]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Coyote Crossing West Men's Restroom door at building 16 - fast close, 21# push	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		
254	Coyote Crossing Camping Area: CC - West Men's Restroom	(32.6160888 -96.991314 4]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks Braille, ISA, raised characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
255	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160537 -96.991303 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.75"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
256	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160989 -96.991292 9]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.75" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Ter clauser
257	Coyote Crossing Camping Area: CC - West Men's Restroom	(32.6160888 -96.991317 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY
258	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160952 -96.991303 6]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Coat hook at 63" above the finished floor (AFF)	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		uiu 9 10 max

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
259	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160718 ,-96.991292 9]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
260	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.616108, -96.991319 7]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door and exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
261	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160718 -96.991292 9]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars at 37" above the finished floor (AFF), TP stored on grab bar	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF). Relocate loose toilet paper rolls a min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
262	Coyote Crossing Camping Area: CC - West Men's Restroom	(32.6160718 -96.991303 6)	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser is behind the front edge of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
263	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160984 -96.991306 3]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 4.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		and a second sec
264	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160952 -96.991330 5]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.3% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
265	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6160678 -96.991298]		Changing bench - 16" deep, lacks clear floor space (CFS) at short end of bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
266	Coyote Crossing Camping Area: CC - West Men's Restroom	[32.6161092 ,-96.991308 7]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible showers	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
267	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6160947 -96.991283 2]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench - 16" deep, lacks clear floor space (CFS) at short end of bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench 48" min —
268	Coyote Crossing Camping Area: CC - West Women's Restroom	(32.6160819 -96.991326 1)	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible showers	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		
269	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.61613, -96.9913]	The door is equipped with a door closer and returns to a closed position too quickly. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum.	Coyote Crossing West Women's restroom at building 16 door - fast close	Inspect, adjust, and maintain closing speed on door closers.	2015 ABAAS Section: 404.2.8.1 2012 TAS Section: 404.2.8.1 2010 ADAS Section: 404.2.8.1		907 5 seconds min. 127

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
270	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6161084 -96.991318]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Signage lacks Braille, raised lettering, and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6	WOMEN I I I I I I I I I I I I I I I I I I I	FUC ***
						2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
271	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6160996 -96.991312 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.75"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
272	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6161064 -96.991323 3]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.25"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Ter classace

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
273	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.616085, -96.991296 5]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY
274	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6161031 -96.991296 5]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 48" over sink, hook in stall at 63"	Lower coat hook to max 48" above the finished floor (AFF) to highest operable part. Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
275	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.616094, -96.991307 2]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1	8
276	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6160946 -96.991331 4]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Toilet centerline 15" to one side, 22.25" to the other	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
277	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6160828 -96.991312 6]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3,		
278	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6161104 -96.991312 6]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars at 36.75"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	404.2.7, 604.8.2.2 2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
279	Coyote Crossing Camping Area: CC - West Women's Restroom	[32.6160912 -96.991328 7]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		e c c c c c c c c c c c c c c c c c c c
280	Coyote Crossing Camping Area: CC - Sample Campsite	[32.6155881 -96.988214 6]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	Coyote Crossing Camping - 84 standard Campsites, 0 accessible - Site 297 as sample - lacks accessible features and route to utilities, fire ring, camp hook, picnic table, etc	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
281	Coyote Crossing Camping Area: CC - Exterior Accessible Route	(32.6161072 -96.991317 3)	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Change in elevation (CIL) of 1.5" to restroom building 16 from parking due to asphalt build up	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/4 1/4 1/4 1/4 1/4 1/4 1/4
282	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.6161, -96.99139]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Cross slope to restroom building 16 - 3.4%	Correct cross slope to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
283	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.6160886 -96.991373]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Cross slope to restroom building 16 - 2.3%	Correct cross slope to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
284	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.61615, -96.99136]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	8" gap to restroom building 16	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		demant decide of trans-

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
285	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.6153056 -96.986839 5]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Cross slope to trailhead restroom building 15 - 4.5%	Correct cross slope to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
286	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.61528, -96.9869]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Cross slope to trailhead restroom building 15 - 7.3%	Correct cross slope to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
287	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.61523, -96.98682]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1.5" gap to restroom building 15	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	2 3-4-5	demand decide of trade
288	Coyote Crossing Camping Area: CC - Exterior Accessible Route	[32.6152376 , -96.986834 6]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1.25" change in elevation (CIL) to restroom building 15	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		¹ / ₄ max ¹ / ₄ ¹ / ₄ ² / ₄ ¹ / ₄

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
289	Hog Wallow Camping Area: HW - Parking	[32.6224648 , -96.989279 5]	Element meets all standards and requirements	5 standard stalls, 1 accessible	None	2010 ADAS Section: N/A		
290	Hog Wallow Camping Area: HW - Parking	[32.622471, -96.989325 1]	The access aisle is missing at the accessible parking stall. Access aisles serving parking spaces shall adjoin an accessible route. Two parking spaces shall be permitted to share a common access aisle.	Lacks marked access aisle	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping.	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		
291	Hog Wallow Camping Area: HW - Parking	[32.6224807 , 96.989325 1]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	4.7% slope in accessible space	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
292	Hog Wallow Camping Area: HW - Parking	[32.6224716 -96.989339 8]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Surface cracked and deteriorated	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in previous finding.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		<u><u><u>y</u></u> <u><u>y</u> <u>y</u> <u>y</u> <u>y</u> <u>y</u> <u>y</u> <u>y</u> <u>y</u> </u></u>

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
293	Hog Wallow Camping Area: HW - Parking	[32.6224777 -96.989330 4]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Lacks van accessible sign	Add van parking sign to accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 60 nches min.
294	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224442 -96.989437 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Hog Wallow men's restroom door at building 14 - slope of 2.9% in pull side clearance, 17# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
295	Hog Wallow Camping Area: HW - Men's Restroom	(32.6224711 -96.989456 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks lacks Braille, ISA , and raised characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
296	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224519 , 96.989478 3]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror - 41.5" above the finished floor (AFF)	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
297	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224455 , -96.989462 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		the demand of the transformed of
298	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224647 -96.989489 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LANATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
299	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224583 -96.989456 9]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth is 20 inches (510 mm), maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Lowest soap dispenser at 53" AFF, hook at 62.5" AFF	Lower soap to max 44" AFF for a reach over the sink. Lower hook in stall to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
300	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224519 .96.989477]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
301	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224583 -96.989483 7]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	19.75" to partition	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uiu 09 35-37
302	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224359 -96.989473]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door and exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
303	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224455 -96.989467 6]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars at 37" above the finished floor (AFF)	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
304	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224583 -96.989483 7]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser is behind the front edge of the toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
305	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224551 -96.989491 7]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 4.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		t t t t t t t t t t t t t t t t t t t
306	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224264 -96.989462 2]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.8% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
307	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224472 -96.989467 1]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench - 15.75" deep, lacks clear floor space (CFS) at short end of bench	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
308	Hog Wallow Camping Area: HW - Men's Restroom	[32.6224408 , -96.989467 1]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible showers	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
309	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224332 -96.989435 4]	The door is equipped with a door closer and returns to a closed position too quickly. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum.	Hog Wallow women's restroom at building 14 door - closes fast	Inspect, adjust, and maintain closing speed on door closers.	2015 ABAAS Section: 404.2.8.1 2012 TAS Section: 404.2.8.1 2010 ADAS Section: 404.2.8.1		5 seconds mir. 12*
310	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224445 -96.989478]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Signage lacks Braille, raised lettering, and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
311	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224336 , 96.989456 5]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 40.75"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	7 38 39 40 41 42 43	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
312	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224564 -96.989480 6]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.5"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3	33 34 35 36 37 38 3 33 34 35 36 37 38 3 36 37 38 3 37 38 3 38	Fore clearance
313	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224446 -96.989451 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
314	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224595 -96.989467 2]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 56" over sink, hook in stall at 63.5"	Lower coat hook to max 48" above the finished floor (AFF) to highest operable part. Lower hand soap to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
315	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224635 , -96.989461 9]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
316	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224458 , -96.989440 4]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Ambulatory stall is 38" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep. In the alternative, use existing stall to create required wheelchair stall.	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		
317	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224562 -96.989475 3]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20.5" from partition	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uiu 09
318	Hog Wallow Camping Area: HW - Women's Restroom	[32.622451, -96.989472 6]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
319	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224383 -96.989443 1]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars at 36.75"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
320	Hog Wallow Camping Area: HW - Women's Restroom	[32.622455, -96.989461 9]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP mounted behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		Year of the second seco

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
321	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224351 , -96.989451 1]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.4% slope at floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
322	Hog Wallow Camping Area: HW - Women's Restroom	[32.6224637 -96.989483 3]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench - 16" deep, lacks clear floor space on short axis	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
323	Hog Wallow Camping Area: HW - Women's Restroom	[32.622451, -96.989467 2]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Shower lacks compliant configuration, single grab bar	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		STANDARD ROLLIN TYPE SHOWED

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
324	Hog Wallow Camping Area: HW - Sample Campsite	[32.6226139 , -96.989292 9]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	49 campsites, none accessible - parking surface degraded, no route to site elements, site elements not of accessible design	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		
	1	r	F			T		1
325	Hog Wallow Camping Area: HW - Exterior Accessible Route	[32.62243, -96.98943]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1.75" from walkway to restroom	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		У max У У У У 12 У У

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
326	Penn Farm Agricultural History Center: Penn Farm - Parking	[32.621906, -96.986367 3]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 28 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 2 accessible stalls with a minimum of 1 being designed as van accessible.	Approximately 28 standard stalls, one accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Test of the left Test of the left Part of the left 1 Part of the left 1
327	Penn Farm Agricultural History Center: Penn Farm - Parking	[32.6219407 -96.986329]	The access aisle is on the driver's side of the stall. Access aisles must be located on the passenger side of the stall for angled van accessible stalls.	Van stall access aisle on driver's side	Relocate access aisle to the passenger side of the stall.	2015 ABAAS Section: 502.3.4 2012 TAS Section: 502.3.4 2010 ADAS Section: 502.3.4		
328	Penn Farm Agricultural History Center: Penn Farm - Parking	[32.6219136 -96.986307 6]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	6 large cracks in stall and access aisle	Resurface stalls and access aisles to eliminate gaps and cracks.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		Vi max Vi Vi Vi Vi Vi Vi Vi Vi Vi

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
329	Penn Farm Agricultural History Center: Penn Farm - Parking	[32.62176, -96.97913]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Lacks van accessible sign	Add van parking sign to accessible stall and assure stall and access aisle are 11' and 5' or 8' and 8'.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Von Accessible 60 nches min.
	1		1	1				
330	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.621896, -96.986452 7]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1.75" change in elevation (CIL) at top of curb ramp	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/4 1/2 1/2 1/2
331	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6219051 -96.986529]	The accessible route contains loose gravel and/or surface materials that do not provide for a stable, firm slip resistant surface. Floor and ground surfaces shall be stable, firm, and slip resistant.	Route from parking to restroom lacks connection - crosses gravel trail	Create AR with crushed and compacted stone or similar outdoor material from parking or sidewalk to the building.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Provide a long transformed and the second se

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
332	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6218972 , -96.986494 4]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	8.2% slope to trail	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	
333	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6219435 ,-96.986546 6]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	3.8% cross to restrooms	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	
334	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6220312 -96.986610 2]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Three 1" gaps to restroom	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3	Image: Section of the section of th

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
335	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6218931 -96.986416 8]	The accessible route contains loose gravel and/or surface materials that do not provide for a stable, firm slip resistant surface. Floor and ground surfaces shall be stable, firm, and slip resistant. Detectable warning surfaces complying with R305 shall be provided at the following locations on pedestrian access routes and at transit stops: Curb ramps and blended transitions at pedestrian street crossings; Pedestrian refuge islands; Pedestrian at-grade rail crossings not located within a street or highway; Boarding platforms at transit stops for buses and rail vehicles where the edges of the boarding platform are not protected by screens or guards; and Boarding and alighting areas at sidewalk or street level transit stops for rail vehicles where the side of the boarding and alighting areas facing the rail vehicles is not protected by screens or guards. Detectable warning surfaces are not required at pedestrian refuge islands that are cut-through at street level and are less than 1.8 meters (6.0 ft) in length in the direction of pedestrian travel.	Ramp from parking has loose gravel, lacks detectable warning	Install compliant detectable warning at curb ramps and transitions from walkways to vehicular ways as a smart practice. Establish protocols for regular and frequent inspection and maintenance of walkway surface.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Particular in the interview of the inter
336	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6220295 -96.986606]	The accessible route contains loose gravel and/or surface materials that do not provide for a stable, firm slip resistant surface. Floor and ground surfaces shall be stable, firm, and slip resistant.	Sand on route to restrooms	Establish protocols for regular and frequent inspection and maintenance of walkway surface.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		Part of the second seco

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
337	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6219005 , -96.986509 9]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	3" change in elevation (CIL) at trail	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/4 1/4 1/4 1/4
338	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6221124 -96.986647 3]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	.5" and 2.25" changes in elevation (CIL) to restrooms	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/4 1/4 1/4
339	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.62228, -96.9865]	Benches shall have a 36" by 48" clear ground space (CGS) positioned near the bench with one side of the space adjoining an outdoor recreation access route (ORAR) or trail, as applicable The CGS shall not overlap with the ORAR or trail or another CGS	Bench near restrooms lacks route and clear ground space	Construct firm, stable, and slip resistant pads at least 36" by 48" adjacent to 20% of benches, and locate along an AR as a smart practice.	2015 ABAAS Section: 1011.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
340	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6217016 , -96.985986 4]	There is no accessible route to the amphitheater. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to Penn Farm amphitheater	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the amphitheater.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIL ENTRACES
341	Penn Farm Agricultural History Center: Penn Farm - Exterior Accessible Route	[32.6217778 -96.986785 8]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	2 of 9 picnic tables near restrooms are of an accessible design, but lack a route (ORAR) to them	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
342	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221554 -96.986689 7]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Men's restroom door at Penn Farm - fast close, 15# push	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
343	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221681 ,-96.986693 7]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks compliant signage - lacks Braille, raised characters, and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.6 2010 ADAS Section: 216.2, 703.1,		
344	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221756 -96.986683]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Sinks out of order, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	703.2, 703.5, 703.6 2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
345	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221681 ,-96.986725 9]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
346	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.622166, -96.986680 3]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum for a reach depth of 24 inches (610 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 55.5" above the finished floor (AFF), hook in stall at 66" AFF	Lower hook to max 48" above the finished floor (AFF) to highest operable part. Lower soap to max 44" for a forward reach over the sink.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
347	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221851 -96.986696 4]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	11" toward wall, 25" toward open side	Remount rear grab bar to behind the toilet, 12" to the wall side of center and 24" to the open side and 33" to 36" AFF.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2		Top of bar 33"-36"
348	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221756 -96.986677 6]	The flush handle is located on the wrong side of the toilet. Controls shall be operable with one hand and shall not require tight grasping, pinching or twisting. Controls for the flush valves shall be mounted on the wide side of toilet areas, no more than 44 inches above the floor.	Push button on wall on closed side	Remount flush mechanism on the open side, in the alternative, install an auto flush unit.	2015 ABAAS Section: 604.6 2012 TAS Section: 604.6 2010 ADAS Section: 604.6		Transfer side

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
349	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221819 -96.986709 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Lacks self-closing door and exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7,		
350	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.622159, -96.986693 7]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	5.25" from wall	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet.	604.8.2.2 2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2	4 5 6 dd d	ternate or cation
351	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221756 , -96.986704 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser is behind the front edge of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		2.9 Tel market Servers

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
352	Penn Farm Agricultural History Center: Penn Farm - Men's Restroom	[32.6221819 -96.986683]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 7"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		Note that the second se
353	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221757 -96.986693 8]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Pipe chase - door 29" wide, 1.5" threshold	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Replace doors with doors having 80" overhead clearance and 32" clear width. Repair, provide beveled threshold.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
354	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.62218, -96.986685 8]	Element meets all standards and requirements	Penn Farm women's restroom door complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
355	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6222075 -96.986693 8]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Signage lacks Braille, raised lettering, and ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5,	WOMEN	
356	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221576 ,-96.986704 6]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test self-closing faucets	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	703.6 2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
357	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221576 -96.986672 4]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAXATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
358	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221847 -96.986693 8]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Hook in stall at 65"	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		10 max
359	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221486 -96.986683 1]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	Toilet centerline at 19"	Remount toilets to 16" to 18" from the side wall to centerline.	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2		€ ↓ ↓ 16"-18"
360	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221576 -96.986693 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
361	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221757 -96.986683 1]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP mounted behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		29 Yung Share
362	Penn Farm Agricultural History Center: Penn Farm - Women's Restroom	[32.6221666 -96.986693 8]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 7"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		No state of the st
363	Penn Farm Agricultural History Center: Penn Farm - Park Host Office	[32.6221607 -96.986723 3]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Park Host office - AC lacks clear floor space (CFS)	Remove, or relocate storage in CFS at fixtures and operable parts along the AR.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		48 min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
364	Penn Farm Agricultural History Center: Penn Farm - Park Host Office	[32.6221395 -96.986704 6]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Park Host office - AC controls at 62"	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		umax
365	Penn Farm Agricultural History Center: Penn Farm - Park Host Office	[32.6221448 , -96.986716 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise.	Penn Farm Park Host office door - threshold .75" on both sides, storage on pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, provide beveled threshold.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
366	Penn Farm Agricultural History Center: Penn Farm - Volunteer Park Host and Staff Laundry	[32.6221639 -96.986634 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise.	Park Host laundry door - threshold. 75" on one side, 1" on inside, freezer in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25". For all doors along the public circulation route, provide beveled threshold.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
367	Penn Farm Agricultural History Center: Penn Farm - Volunteer Park Host and Staff Laundry	[32.6221661 -96.986671 7]	The sink is not accessible. A clear floor space at least 30 inches by 48 shall be provided in front of a sink to allow forward approachThe clear floor space shall be on an accessible route and shall extend a maximum of 19 inches underneath the sink. -Sinks shall be mounted with the counter or rim no higher than 34 inches above the finish floorKnee clearance at least 27 inches high, 30 inches wide and 19 inches deep shall be providedHot water and drain pipes exposed under sinks shall be insulated or otherwise configured so as to protect against contact. There shall be no sharp or abrasive surfaces under sinks. -Faucet controls not require tight grasping, pinching or twisting of the wristThe force required to activate controls shall be not greater than 5 lb. Lever-operated, push-type and electronically controlled mechanisms are examples of acceptable designsSelf- closing valves are allowed if the faucet remains open for at least 10 seconds.	Sink rim at 34", but lacks clear floor space (CFS)	Relocate items to provide CFS at sink.	2015 ABAAS Section: 606.2, 606.2 EXCEPTION S: 1, 606.2 E XCEPTIONS: 4, 606.2 EXC EPTIONS: 5, 606.2 EXCEP TIONS: 6, 606.2 EXCEP TIONS: 7, 606.3, 606.4, 606.5 2012 TAS Section: 606.2, 606.2 Exception 1, 606.2 Exception 5, 606.2 Exception 5, 606.2 Exception 7, 606.3, 606.4, 606.5 2010 ADAS Section: 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 5, 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 1, 606.2 Exception 5, 606.2 Exception 5, 606.2 Exception 7, 606.3, 606.4, 606.2 Exception 7, 606.3, 606.4, 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
368	Penn Farm Agricultural History Center: Penn Farm - Volunteer Park Host and Staff Laundry	[32.6221917 -96.986650 2]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Light switch at 56" above the finished floor (AFF), 58.5" to AC controls	Remount operable parts to be in reach range of 15" min to 48" max.	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
369	Penn Farm Agricultural History Center: Penn Farm - Volunteer Park Host and Staff Laundry	[32.6221981 -96.986682 4]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Lacks clear floor space (CFS) at breaker box, AC unit, outlets, and paper towel dispenser	Remove, or relocate storage in CFS at fixtures and operable parts along the AR.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3	<image/>	48 min

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
370	Penn Farm Agricultural History Center: Penn Farm - Volunteer Park Host and Staff Laundry	[32.6221693 -96.9866666 3]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	25.5" to access dryer, lacks access to hot water heater closet and utility sink due to storage	Relocate table and storage to widen AR to compliant 36" clear width.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 40 mm 24 mm 24 mm 24 mm 24 mm 24 mm 24 mm
371	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.6221692 -96.986707 5]	The there is no lower drinking fountain meeting the requirements for persons using wheelchairs. Spout outlets of the lower bowl drinking fountains shall be 36 inches maximum above the finish floor or ground. Lower bowl drinking fountains shall provide knee and toe clearance centered on the unit.	Fountain at restrooms lacks low bowl	Replace drinking fountain with a hi-lo bowl fountain.	2015 ABAAS Section: 602.4 2012 TAS Section: 602.4 2010 ADAS Section: 211.2		5 may - 15 mm

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
372	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.6221611 -96.986669 9]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Fountain protrudes 12.75"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
373	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.6224806 , -96.986393 9]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Penn Farm trail to exhibits lacks form amd stable surface - gravel, tree roots, loose sand	Replace trail surface with one that is firm and stable as a smart practice.	2015 ABAAS Section: 1017.2		
374	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62248, -96.98657]	There is no accessible route to the exhibit. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Plow exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from trail to plow exhibit.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACESSIGLE DATABACES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
375	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62304, -96.98646]	There is no accessible route to the exhibits. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Cluster of 3 exhibits lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to exhibits.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSULE DATIBATIONS
376	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62308, -96.98689]	There is no accessible route to the building. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	building exhibits lack route	Extend an accessible route with crushed stone or other outdoor material from new trail to building and sign.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		CECSSULE UTRANCES
377	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.6233, -96.9866]	There is no accessible route to the cistern. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	cistern exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to cistern.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSULE DATEADED

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
378	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62364, -96.98685]	There is no accessible route to the farm structure. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	building exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to building.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSULE DITIRANCES
379	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62387, -96.98699]	There is no accessible route to the barn and outlying buildings. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	barn and outlying buildings exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to barn and exhibits.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACESSIBLE DITIRANCES
380	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62391, -96.98669]	There is no accessible route to the large barn. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	large barn exhibit lacks route	Create an accessible route with crushed stone or other outdoor material from new trail to large barn.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE DATIRANCES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
381	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62399, -96.98644]	There is no accessible route to the farm equipment. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	farm equipment exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to farm equipment.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSIBLE DATIDANCES
382	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.62384, -96.9866]	There is no accessible route to the thresher. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	thresher exhibit lacks route	Extend an accessible route with crushed stone or other outdoor material from new trail to thresher.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESSULE DITIANCES
383	Penn Farm Agricultural History Center: Penn Farm - Exhibit	[32.6233, -96.98664]	Visual characters shall be 40 inches (1015 mm) minimum above the finish floor or ground. EXCEPTION: Visual characters indicating elevator car controls shall not be required to comply with 703.5.6.	directional signage low, not enough signage	Remount signage to min 40" aff. Consider adding more directional signage for wayfinding.	2015 ABAAS Section: 703.5.6, 703.5.6 EXCEPTION 2012 TAS Section: 703.5.6, 703.5.6 Exception 2010 ADAS Section: 703.5.6, 703.5.6, 703.5.6 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
384	Penn Farm Agricultural History Center: Penn Farm - RV dump station	[32.62329, -96.98617]	Element meets all standards and requirements	Penn Farm dump station complies	None	2010 ADAS Section: N/A		
385	Penn Farm Agricultural History Center: Penn Farm - Administration Building/House	[32.6244257 -96.985095 2]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Administration Building/House - lacks route to the building - grass and steps	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Create an accessible route with crushed stone or other outdoor material from parking or walkway to Administration Building/House entry. Provide a ramp for access.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
386	Penn Farm Agricultural History Center: Penn Farm - Administration Building/House	[32.6244436 -96.985132 8]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. The threshold has a gap	Office - knob, desk in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			greater than 1/2 inch wide. The threshold at					
			a doorway shall be no higher than 1/2 inch.					
			Changes in level between 1/4 inch and 1/2					
			inch must be beveled at 1:2 or less. I/4 inch					
			is the maximum vertical rise. All interior					
			doors must be maintained so that the					
			operating pressure does not exceed 5 lbf to					
			open. The sweep period for doors with					
			closers shall be adjusted so that from an					
			open position of 70 degrees, the door will					
			take at least 3 seconds to move to a point 3					
			inches from the latch, measured to the					
			leading edge of the door. Exterior doors are					
			recommended to be maintained at 8.5 lbf as					
			a smart practice. Force is to be measured at					
			the operating hardware or 30 inches from					
			the hinges, whichever is greater. Hand-					
			activated door opening hardware, handles,					
			pulls, latches, locks, and other operating					
			devices on accessible doors shall have a					
			shape that is easy to grasp with one hand					
			and does not require tight grasping, tight					
			pinching or twisting of the wrist to operate.					
			Hardware shall be 34 inches minimum and					
			48 inches maximum above the finish floor or					
			ground. The bottom 10 inches on the push					
			side must be smooth and free of					
			obstructions (hold open devices). Opening					
			hardware must be mounted between 30 and					
			44 inches above the floor or ground. Doors,					
			gates, and side lights adjacent to doors or					
			gates, containing one or more glazing					
			panels that permit viewing through the					
			panels shall have the bottom of at least one					
			glazed panel located 43 inches (1090 mm)					
			maximum above the finish floor.					
			EXCEPTION: Vision lights with the lowest					
			part more than 66 inches (1675 mm) from					
			the finish floor or ground shall not be					
			required to comply with 404.2.11. Egress					
			doors shall provide a continuous and					
			unobstructed way of egress travel from any					
			point in a building or facility that provides an					
			accessible route to an area of refuge, a					
			horizontal exit, or a public way.					
			nonzoniai exil, or a public way.					

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
387	Penn Farm Agricultural History Center: Penn Farm - Administration Building/House	[32.6244706 -96.985095 2]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11. Egress doors shall provide a continuous and unobstructed way of egress travel from any point in a building or facility that provides an accessible route to an area of refuge, a horizontal exit, or a public way.	Admin building/house entry door - 77" overhead, knob at 32"	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11 Exception	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
388	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T- shaped space.	Lacks turning space - small room	Relocate obstacles to create turning space in restroom.	2015 ABAAS Section: 304.3.1, 304.3.2 2012 TAS Section: 304.3.1, 304.3.2 2010 ADAS Section: 304.3.1, 304.3.2		24 min 12 min 12 min 12 min 12 min 12 min 12 min 12 min
389	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	30.25" between sink and shelf	Remove shelf to widen AR to compliant 36" clear width.	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		24 max 40 min 26 max 28 max 29 min 29 min 29 min 29 min 29 min 29 min 20 max 29 min 29 min 20 max 20
390	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser on wall behind toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		Xeu 9t

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
391	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	Rear grab bar is 8" towards wall	Remount rear grab bar to behind the toilet, 12" to the wall side of center and 24" to the open side and 33" to 36" AFF.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2		Top of bar 33°-36°
392	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Bar ends 51.5" from rear wall, obstructed by window blind	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF. Remove window blind to avoid obstructing access and use of side grab bar.	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
393	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The toilet seat is not located within the range allowed off the floor. The height of accessible water closets shall be a minimum of 17 inches and a maximum of 19 inches measured to the top of a maximum 2-inch high toilet seat.	Seat at 16.5" above the finished floor (AFF)	Replace toilet seat, or re-set or replace toilet to 17" to 19" above the finished floor (AFF).	2015 ABAAS Section: 604.4 2012 TAS Section: 604.4 2010 ADAS Section: 604.4		17" to 19"

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
394	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The required 56 inches by 60 inches clear floor space for the water closet has been obstructed. The clear floor space around the water closet shall be 60 inches minimum measured perpendicular from the side wall and 56 inches minimum measured perpendicular from the rear wall.	Toilet lacks clear floor space - 48" to shelf	Relocate shelf to provide required 60" clearance around toilet.	2015 ABAAS Section: 604.3. 2012 TAS Section: 604.3.1 2010 ADAS Section: 604.3.1		
395	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Fan pull lacks clear floor space (CFS)	Relocate fan controls to an area providing 30" by 48" clear floor space.	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		48 min
396	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The operable part is not accessible because it requires tight grasping, pinching or twisting of the wrist.	Fan pull requires tight pinch	Replace operable part with one usable without a tight pinch or grasp	2015 ABAAS Section: 309.4 2012 TAS Section: 309.4 2010 ADAS Section: 309.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
397	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Fan pull at 55" AFF	Lower operating mechanisms to max 48" above the finished floor (AFF) to highest operable part. See previous finding about relocation of fan switch.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
398	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink lacks insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
399	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Sink lacks knee clearance	Raise sink bowl to provide 27" knee clearance, in the alternative, acquire a shallower model.	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4, 306.3.5 2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1 2010 ADAS Section: 306.3.3, 306.3.2, 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		The clearance a' deep the space
400	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom of mirror at 42" above the finished floor (AFF)	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	38 39 40 41 42 43	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
401	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.62438, -96.98508]	The tactile restroom wall sign is missing the International Symbol of Accessibility (ISA). Accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Accessibility (ISA). Wall signs identifying permanent rooms and spaces of a building shall have be horizontal format and the characters raised 1/32 inch minimum and shall be sans serif uppercase characters a minimum of 5/8 inch and a maximum of 2 inches high. Contracted Grade 2 Braille shall be in a horizontal format and shall be placed a minimum of 3/8 inch and a maximum of 1/2 inch directly below the tactile characters; flush left or centered. Signs with raised characters or Braille shall be located 48 inches minimum above the finish floor or ground surface, measured from the baseline of the lowest tactile character and 60 inches maximum above the finish floor or ground surface, measured from the baseline of the highest tactile character.	Lacks any signage and none with ISA	Acquire and mount signage, including access symbol.	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		RESTROOM
402	Penn Farm Agricultural History Center: Penn Farm - Admin House/Building Restroom	[32.624427, -96.985085 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Hand- activated door opening hardware, handles, pulls, latches, locks, and other operating	Penn Farm Admin Building Restroom door - knobs, small ramp with CILs in pull side clearance, storage in push side clearance, 77.5" high door	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

devices on accessible doors shall have a address that is easy to prase with one hand and does not require light grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches maximum above the finish floor or ground.	Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
	Number			shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or					

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
403	Central Day Use Area: Central Day Use - Parking	[32.62176, -96.97913]	Element meets all standards and requirements	Parking at restroom building 13 - 10 standard, 2 accessible	None	2010 ADAS Section: N/A		
404	Central Day Use Area: Central Day Use - Parking	[32.6252042 , -96.990234 3]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Parking at restroom building 13 - Lacks designated van signage	Add one van parking sign to van accessible stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 60 nches min.
405	Central Day Use Area: Central Day Use - Parking	[32.625241, -96.990314 8]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking at restroom building 13 - access aisle 2.5%, 5.1% in stall near water	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
406	Central Day Use Area: Central Day Use - Parking	[32.6252529 , -96.990428 8]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Large gaps in stall near water	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in slope repair.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		1/2 1/2 1/2 1/2 1/2 1/2 1/2 1/2
407	Central Day Use Area: Central Day Use - Parking	[32.6252652 , -96.99041]	The access aisle is not located on an accessible route of travel to the accessible building entrance. Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.	Accessible stall at water requires travel through unmarked roadway	Reconfigure accessible stalls to avoid requiring pedestrians to cross vehicular way, in the alternative, leave as is with striped crosswalk.	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		
408	Central Day Use Area: Central Day Use - Parking	[32.625654, -96.984789 7]	Element meets all standards and requirements	Parking at fishing pier - 27 standard, 2 accessible	None	2010 ADAS Section: N/A		
409	Central Day Use Area: Central Day Use - Parking	[32.6256476 -96.984792 3]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Parking at fishing pier - Right stall sign at 55.25" above ground level (AGL)	Raise existing accessible parking signs so lowest end of bottom sign is min 60" above ground level (AGL) measured from the surface of the stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6	VIOL FORS SUBJI T TO A	Van Accessible 60 nches min.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
410	Central Day Use Area: Central Day Use - Parking	[32.625571, -96.984773 6]	The accessible route is constructed such that a park vehicle can obstruct the minimum 36 inch width. Parking spaces and access aisles shall be designed so that cars and vans, when parked, cannot obstruct the required clear width of adjacent accessible routes.	2 standard parking spaces could possibly obstruct right accessible stall - recommend removing bumpers and make those two spaces a no parking zone	Mount signage to prohibit cars from parking and obstructing accessible route.	2015 ABAAS Section: 502.7 2012 TAS Section: 502.7 2010 ADAS Section: 502.7		
411	Central Day Use Area: Central Day Use - Parking	[32.62176, -96.97913]	Element meets all standards and requirements	Parking at group pavilion - 27 standard stalls, 4 accessible	None	2010 ADAS Section: N/A		
412	Central Day Use Area: Central Day Use - Parking	[32.6245974 -96.991360 9]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Parking at group pavilion - Stalls at restroom and shelter lack van accessible sign	Add one van parking sign to one van accessible stall at each location.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		e0 nches min.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
413	Central Day Use Area: Central Day Use - Parking	[32.6246006 -96.991515 8]	The accessible parking stall signage is incorrect and/or missing from each accessible parking space. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Parking at group pavilion - spaces near shelter lack R7-8 signs	Replace existing signage with R7-8 signage as a smart practice.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6		RESERVED PARKING
414	Central Day Use Area: Central Day Use - Parking	[32.6246064 -96.991350 1]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Parking at group pavilion - near restrooms - stalls and aisle have large cracks, near shelter cracks in right stall	Resurface stalls and access aisles to eliminate gaps and cracks.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		Max N N N N N N N N N N N N N N N N N N N

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
415	Central Day Use Area: Central Day Use - Parking	[32.6246154 -96.991339 4]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking at group pavilion - access aisle at restrooms - 3%, right stall at restrooms - 4.7%, right stall at shelter 3.1%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		-++-
416	Central Day Use Area: Central Day Use - Parking	[32.62473, -96.98922]	Element meets all standards and requirements	Rec Hall parking - 48 standard, 2 accessible	None	2010 ADAS Section: N/A		
417	Central Day Use Area: Central Day Use - Parking	[32.62473, -96.98922]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Rec Hall parking - 3.4% in left stall, 5.6% right stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
418	Central Day Use Area: Central Day Use - Picnic Area	[32.6257516 -96.984778]	Picnic facilities shall provide outdoor recreation access routes complying with 1016 in accordance with F245.4 and 245.4 of IAC	Cross slopes up to 3.6% on route to Shelter, large area of grass at one shelter entry, stair access only at second shelter entry	Correct slope along ORAR to max 2.08% and remove grass build up for access. Ramp second shelter for access to two shelters as a smart practice.	2015 ABAAS Section: F245.4		
419	Central Day Use Area: Central Day Use - Picnic Area	[32.62575, -96.98478]	The surface of the route to and into the picnic area or shelter must be firm and stable.	Loose dirt and plant overgrowth on route to shelter and on surface of shelter	Establish protocols for regular and frequent inspection and maintenance of walkway and shelter surfaces.	2015 ABAAS Section: 1016.1, 1016.1 EXCEPTION S 1, 1016.1 EXCEPTION S 2, 1016.1 EXCEPTION S 3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
420	Central Day Use Area: Central Day Use - Picnic Area	[32.6258075 ,-96.984738 4]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	3 large gaps in shelter surface	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		demant double of their reg demant properties to their double of their y max
421	Central Day Use Area: Central Day Use - Picnic Area	[32.6258043 -96.984739 8]	The angled support beams extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	Angled support beams at 4 corner supports less than 80" - 72.5" above ground level (AGL)	Raise angled support beams to min 80", or pad object to prevent hazard in overhead clearance.	2015 ABAAS Section: 307.3 2012 TAS Section: 307.3 2010 ADAS Section: 307.3		Any Projection
422	Central Day Use Area: Central Day Use - Picnic Area	[32.6254078 -96.990592 4]	There is no accessible route to the picnic areas. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks route to multiple picnic areas (approximately 40)	Create an accessible route with crushed stone or other outdoor material from parking or walkway to 8 picnic areas.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		ACCESCIL CUTANCE The second s
423	Central Day Use Area: Central Day Use - New Family Restroom Left	[32.6255731 -96.984549 8]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Central Day Use Area New family restroom left door - 25# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
424	Central Day Use Area: Central Day Use - New Family Restroom Left	[32.6255811 -96.984531 7]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Self-closing faucet open for 8 seconds	Adjust timing of sink faucets to remain on for min. 10 seconds.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
425	Central Day Use Area: Central Day Use - New Family Restroom Left	[32.6255731 -96.984545 1]	The baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
426	Central Day Use Area: Central Day Use - New Family Restroom Left	[32.6255651 ,96.984543 8]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3.6% near floor drain and in CFS of sink	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
427	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.6255805 , -96.98459]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Self-closing faucet stays open 4 seconds	Adjust timing of sink faucets to remain on for min. 10 seconds.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
428	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.6255758 , -96.98459]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
429	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.6255726 ,-96.984588 7]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Rear grab bar 36.5" above the finished floor (AFF)	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
430	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.625579, -96.98459]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3.8% near floor drain and in CFS of sink	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
431	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.6255786 , -96.984588 8]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Central Day Use Area New family restroom right door - 23# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
432	Central Day Use Area: Central Day Use - New Family Restroom Right	[32.6255679 , -96.98458]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Plumbing chase at new restrooms near fishing pier - too narrow for access	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. In the alternative, leave as is as correction may be technically infeasible.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
433	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.6252589 -96.990125 6]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Men's restroom at building 13 door - 18# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
434	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62531, -96.99017]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille, raised characters, ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
435	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer projects 4.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1
436	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser behind the front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		2.9 1.9 1.9 1.9 1.9 1.9 1.9 1.9 1.9 1.9 1

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
437	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Right bar 36.5", left bar 36.75"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
438	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall lacks hardware on exterior side, door not self-closing	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
439	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
440	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sinks lack insulated pipes	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY
441	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36.25" above the finished floor (AFF)	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Tere clearance
442	Central Day Use Area: Central Day Use - Men's Restroom - Building 13	[32.62524, -96.99014]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.25"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
443	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.6252589 ,-96.990148 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille, raised characters, ISA	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
						2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
444	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 42"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
445	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Rim of sink at 36"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		The clauser the clauser a deep tof sace

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
446	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY
447	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Hook at 63"	Lower hook in stall to max 48" above the finished floor (AFF).	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
448	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS	84	
449	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door 31", not self- closing, and lacks exterior hardware	Widen stall doors to 32" when opened to 90 degrees. Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	Section: 213.3.1 2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
450	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.6252812 -96.990147 2]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Grab bars at 37"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
451	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser behind the front of the toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7	view of the second seco
452	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 4.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2	
453	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62531, -96.99017]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	3.2% slope at drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3	
454	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62526, -96.99021]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	3.2% cross slope	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
455	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.625286, -96.990157 9]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Women's restroom at building 13 - 10#, closes fast, 2.9% slope in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
456	Central Day Use Area: Central Day Use - Women's Restroom - Building 13	[32.62524, -96.9902]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	2" gap from sidewalk to restroom pad	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		And a finite of the first of th
457	Central Day Use Area: Central Day Use - Men's Restroom Building 12	[32.6243537 -96.991053 9]	Restroom unusable due to damage.	Restroom at Group picnic pavilion will not be due used to damage, did not audit.	If replaced, assure all accessibility standards are followed for the restrooms, doors and routes.	2015 ABAAS Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
458	Central Day Use Area: Central Day Use - Group Picnic Pavilion	[32.62468, -96.99164]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Gap up to 1.75" around perimeter of shelter (all 4 sides), large gaps at 2 corners of shelter closest to parking	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		demend forder of the second se

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
459	Central Day Use Area: Central Day Use - Group Picnic Pavilion	[32.6247439 -96.991648]	The pavilion sign extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	Sign at corner of shelter at 74.5" above ground level (AGL)	Relocate or raise pavilion sign to min 80", or pad object to prevent hazard in overhead clearance.	2015 ABAAS Section: 307.3 2012 TAS Section: 307.3 2010 ADAS Section: 307.3		Any Projection

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
460	Central Day Use Area: Central Day Use - Group Picnic Pavilion	[32.6247431 -96.991648]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	5 of 6 picnic tables are not of an accessible design, lacks 36" CFS around accessible picnic table	Replace 1 picnic table with one of an accessible design as a smart practice. Reposition picnic tables to ensure 36" clear ground space around all usable sides of accessible picnic tables.	2015 ABAAS Section: 1011.4.2		
461	Central Day Use Area: Central Day Use - Group Picnic Pavilion	[32.6247511 -96.991646]	Where provided, at least one of each type of outdoor constructed feature shall comply with 1011. Where more than one of the same type of outdoor constructed feature is provided, at least two of the same type of outdoor constructed feature shall comply with 1011.	Outlet at 54" above ground level (AGL)	Remount operable parts to be in reach range of 15" min to 48" max. In the alternative, leave as is citing safe harbor.	2015 ABAAS Section: F245.2.5.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
462	Central Day Use Area: Central Day Use - Group Picnic Pavilion	[32.6246947 -96.991562]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Cross slopes of 3.6% to 3.9% for 20' from right stall to entry to pavilion	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
	•							
463	Central Day Use Area: Central Day Use - Fishing Pier	[32.6257016 , -96.984728 5]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Gap of 2" on route to fishing pier	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Asmart divides of basel
464	Central Day Use Area: Central Day Use - Fishing Pier	[32.6257724 -96.984793 4]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Gap of 1.75" on route to fishing pier	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		demant divides d'anal

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
465	Central Day Use Area: Central Day Use - Fishing Pier	[32.6256944 -96.984713 8]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Change in elevation (CIL) of 2" on route to fishing pier	Repair, bevel or ramp CIL along route.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		14 max 14 14 14 14 14 14 14 14 14 14 14 14
466	Central Day Use Area: Central Day Use - Fishing Pier	[32.6258333 -96.984852 6]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Change in elevation (CIL) of 1" on route to fishing pier	Repair, bevel or ramp CIL along route.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/4 1/4 1/4 1/4 1/4 1/4
467	Central Day Use Area: Central Day Use - Fishing Pier	[32.62584, -96.98469]	Element meets all standards and requirements	Fishing pier in Central Day Use Area near new restrooms complies	None	2010 ADAS Section: N/A		

Finding NumberArea DescriptionLat/LongFindingAs BuiltRecommendationCitationPhotos	Figure
488 Central Day Use Ava. Central Day Use - Fishing Pier 9 32.8258184 not be steeper than 1.48 The running slope of walking surfaces shall not be steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state road in the steeper than 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state 1.48 Cross slopes of 10.8% to 11.2% to 2.7% to not state 1.48 2012 TAS Section: 1.48 2012 TAS Section: 1.48 Section: 1.48 2012 TAS Section: 1.48 2012 TAS Section: 1.	

Finding Are Number	rea Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
Are	rea: Central Day	[32.6257537 -96.984700 9]	Stairways must have handrails on both sides. Handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground. The top handrails shall extend a minimum of 12 inches beyond the top nosing and shall be parallel with the floor or ground surface. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landrail of an adjacent stair flight. The orientation of at least one handrail, including the extension, shall be in the direction of the run of the stair and perpendicular to the direction of the stair nosing. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a cross-section dimension of 2-1/4 inches maximum. The hand grip portion of handrails shall have a smooth surface with no sharp corners. Gripping surfaces (top or sides) shall be uninterrupted by newel posts, other construction elements or obstructions. Any wall or other surface adjacent to the handrail shall be free of sharp or abrasive elements. Handrails projecting from a wall shall have a space of 1-1/2 inches minimum	Three sets of stairs lack handrails	Install handrails on both sides of stairway, mounted 34" to 38" AFF with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall.	2015 ABAAS Section: 505.2 2012 TAS Section: 505.2 2010 ADAS Section: 505.2		Light for the second se

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
470	Central Day Use Area: Central Day Use - Rec Hall	[32.62509, -96.98873]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	104 kitchen exterior door - door stuck closed, 9" to counter	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
471	Central Day Use Area: Central Day Use - Rec Hall	[32.62486, -96.98888]	Element meets all standards and requirements	Kitchen closet door complies	None	2010 ADAS Section: N/A		
472	Central Day Use Area: Central Day Use - Rec Hall	[32.6251034 , -96.988786]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door.	104 kitchen - 15.5" to column pull side, closes fast	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
473	Central Day Use Area: Central Day Use - Rec Hall	[32.62503, -96.98891]	All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	104 kitchen from hall - 15#, closes fast	For all doors along the public circulation route, inspect, adjust, and maintain 5 lbf to open interior doors. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2010 ADAS Section: 404.2.3, 404.2.4, 404.2.11, 404.2.11 Exception		
474	Central Day Use Area: Central Day Use - Rec Hall	[32.62502, -96.98882]	Element meets all standards and requirements	Kitchen complies	None	2010 ADAS Section: N/A		
475	Central Day Use Area: Central Day Use - Rec Hall	[32.62502, -96.98882]	Element meets all standards and requirements	107 parlor door and room comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
476	Central Day Use Area: Central Day Use - Rec Hall	[32.62477, -96.98877]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Parlor restroom door - 10#	Inspect, adjust, and maintain 5 lbf to open doors.	2015 ABAAS Section: 404.2.9 2012 TAS Section: 404.2.9 2010 ADAS Section: 404.2.9		S BY
477	Central Day Use Area: Central Day Use - Rec Hall	[32.62508, -96.98882]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Parlor- 3.4% slope at floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
478	Central Day Use Area: Central Day Use - Rec Hall	[32.62492, -96.98852]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Door to patio by restrooms - 16# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
479	Central Day Use Area: Central Day Use - Rec Hall	[32.62482, -96.98872]	All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Women's restroom door - 11# push, closes fast	For all doors along the public circulation route, inspect, adjust, and maintain 5 lbf to open interior doors. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2010 ADAS Section: 404.2.3, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
480	Central Day Use Area: Central Day Use - Rec Hall	[32.62176, -96.97913]	The baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Women's restroom - changing table located in stall	Remount baby changing table to a location outside of accessible stall that does not protrude in the open or closed position, with operable parts at max 48" and the changing surface in the open position is max 34".	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
481	Central Day Use Area: Central Day Use - Rec Hall	[32.6249407 -96.988807 4]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Women's restroom - stall door not self- closing	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
482	Central Day Use Area: Central Day Use - Rec Hall	[32.624911, -96.988775 2]	There is a change in level greater than 1/4 inch. I/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Women's restroom - .5" change in elevation (CIL) at floor drain	Repair, bevel or ramp CIL along accessible route (AR) to max .25".	2015 ABAAS Section: 303.3 2012 TAS Section: 303.3 2010 ADAS Section: 303.3		12 12 14 12 14
483	Central Day Use Area: Central Day Use - Rec Hall	[32.62507, -96.98868]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Men's restroom door - 15# push	Inspect, adjust, and maintain 5 lbf to open doors.	2015 ABAAS Section: 404.2.9 2012 TAS Section: 404.2.9 2010 ADAS Section: 404.2.9		o ibr

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
484	Central Day Use Area: Central Day Use - Rec Hall	[32.62507, -96.98868]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Men's Restroom - Self-closing faucet shuts off less than 10 seconds	Adjust timing of sink faucets to remain on for min. 10 seconds.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
485	Central Day Use Area: Central Day Use - Rec Hall	[32.62507, -96.98868]	The baby changing tables is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Men's- Baby changing table located in accessible stall	Remount baby changing table to a location outside of accessible stall that does not protrude in the open or closed position, with operable parts at max 48" and the changing surface in the open position is max 34".	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
486	Central Day Use Area: Central Day Use - Rec Hall	[32.62507, -96.98868]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Men's Restroom - TP mounted too far from front of toilet; loose TP roll on grab bar	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar. Relocate items stored on grab bars.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		yew 9b yes
487	Central Day Use Area: Central Day Use - Rec Hall	[32.62529, -96.98854]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Up to 2" gap in pavers at bottom of ramp at Rec Hall	Correct or fill gaps to be max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		And a second sec

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
488	Central Day Use Area: Central Day Use - Rec Hall	[32.62508, -96.98862]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Multiple gaps (approx. 12) at about 1.5" in multiple spots between pavers on patio; 1" gaps in the two grates	Correct or fill gaps to be max .5". Replace drains with ones having openings max .5".	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		Annual dada of the d
489	Central Day Use Area: Central Day Use - Rec Hall	[32.6251, -96.98868]	Element meets all standards and requirements	Patio stairs and fireplace area comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
490	Central Day Use Area: Central Day Use - Rec Hall	[32.62495, -96.98896]	Visual characters shall be 40 inches (1015 mm) minimum above the finish floor or ground. EXCEPTION: Visual characters indicating elevator car controls shall not be required to comply with 703.5.6.	Park map sign bottom is at 30"	Remount signage to min 40" AFF.	2015 ABAAS Section: 703.5.6, 703.5.6 EXCEPTION 2012 TAS Section: 703.5.6, 703.5.6 Exception 2010 ADAS Section: 703.5.6,		
						703.5.6 Exception		
491	Central Day Use Area: Central Day Use - Rec Hall	[32.62497, -96.98873]	There is no ISA at this entrance. In existing buildings and facilities where not all entrances are accessible, entrances to buildings and facilities that are accessible to and usable by persons with disabilities shall be identified with an International Symbol of Accessibility (ISA). Typically this is 6 inches by 6 inches in size.	Lacks symbol of accessibility at entry	Mount signage at entrance designating it as accessible.	2015 ABAAS Section: F216.6 2012 TAS Section: 216.6 2010 ADAS Section: 216.6		E
492	Central Day Use Area: Central Day Use - Rec Hall	[32.62497, -96.98873]	The tactile text is multi-lined and the Braille is not below the entire text. If text is multi- lined, braille shall be placed below the entire text.	Braille below number and room name on 6 signs	Replace Braille on sign and place Braille below the entire text, Braille shall not be broken up by line.	2015 ABAAS Section: 703.3.2 2012 TAS Section: 703.3.2 2010 ADAS Section: 703.3.2	107 PARLOR	AREA OF REFUGE

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
493	Central Day Use Area: Central Day Use - Rec Hall	[32.62497, -96.98873]	The tactile EXIT sign is missing at the door. Wall signs identifying exits shall have characters raised 1/32 inch minimum and shall be uppercase characters a minimum of 5/8 inch and a maximum of 2 inches high. Braille shall be placed directly below the tactile characters; flush left or centered. Signs shall be located a minimum of 48 inches above the floor, measured from the baseline of the lowest tactile characters and 60 inches maximum above the finish floor or ground surface, measured from the baseline of the highest tactile characters. Where a tactile sign is provided at a door, the sign shall be located on the latch side. Where a tactile sign is provided at double doors the sign shall be located to the right of the right- hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall.	Exit signs overhead and illuminated only	Mount compliant signage at all doors along the egress route.	2015 ABAAS Section: F216.4.1 2012 TAS Section: 216.4.1 2010 ADAS Section: 216.4.1		EXIT
494	Central Day Use Area: Central Day Use - Rec Hall	[32.6251187 .96.988817 9]	Element meets all standards and requirements	Large meeting room at rec hall complies	None	2010 ADAS Section: N/A		
495	Central Day Use Area: Central Day Use - Rec Hall	[32.6250817 -96.988773 6]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Rec hall meeting room doors: side doors - 20# push; back doors - right 18# push, left 20# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
496	Central Day Use Area: Central Day Use - Rec Hall	[32.62507, -96.98878]	Element meets all standards and requirements	Storage room 105 and doors comply	None	2010 ADAS Section: N/A		
497	Central Day Use Area: Central Day Use - Rec Hall	(32.6250313 , -96.988705 1]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	Main entry - both doors 20# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
498	Central Day Use Area: Central Day Use - Elements	[32.62524, -96.9902]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	Drinking fountain at restroom building 13 - Low bowl height fountain only, lacks knee and toe clearance and not deep enough	Replace drinking fountain with a hi-lo bowl fountain.	2015 ABAAS Section: F211.2 2012 TAS Section: 211.2 2010 ADAS Section: 211.2		5 max 205 15 min 380 10 10 10 10 10 10 10 10 10 10 10 10 10
499	Central Day Use Area: Central Day Use - Elements	[32.6255933 , -96.984737 1]	Element meets all standards and requirements	Info sign/map at new restrooms in Central Day Use Area complies	None	2010 ADAS Section: N/A		
500	Central Day Use Area: Central Day Use - Elements	[32.6255865 -96.984561 5]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Fountain at new family Restrooms - both drinking fountains protrude more than 4" - low bowl projects more at 18.25"	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
501	North Day Use Area: North Day Use - Parking	[32.627272, -96.981683 5]	Element meets all standards and requirements	Boat Ramp Parking - Unsure of scoping requirements, lot not lined - 4 accessible parking spaces in 2 locations	None	2010 ADAS Section: N/A		
502	North Day Use Area: North Day Use - Parking	[32.626, -96.98914]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 68 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 3 accessible stalls with a minimum of 1 being designed as van accessible.	Multiple lots along picnic area - 68 stalls, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Specific Specific Name Specific
503	North Day Use Area: North Day Use - Parking	[32.63363, -96.98009]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 25 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Northernmost parking - Lacks identified parking spaces (not striped yet) - approximately 25 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		United File File Heat Material File File 1000 1
504	North Day Use Area: North Day Use - Parking	[32.63234, -96.9796]	Element meets all standards and requirements	Parking at northernmost renovated restroom building - 22 standard, 3 accessible	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
505	North Day Use Area: North Day Use - Parking	[32.63234, -96.9796]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking at northernmost renovated restroom building - Slope of 2.5% in middle of left access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4	PARKING.	-44-
506	North Day Use Area: North Day Use - Parking	[32.6317883 -96.980321 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 25 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Parking just south of northernmost renovated restrooms - Lacks identified parking spaces (not striped yet) - Approximately 25 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Bits Bits <th< td=""></th<>
507	North Day Use Area: North Day Use - Parking	[32.6319753 ,-96.982069 7]	Element meets all standards and requirements	Peninsula parking areas from peninsula entry to small lot just past new restrooms - Approximately 70 standard, 4 accessible	None	2010 ADAS Section: N/A		
508	North Day Use Area: North Day Use - Parking	[32.6298108 -96.984081 9]	Element meets all standards and requirements	South renovated Restrooms - Unsure of scoping requirements, not striped yet - unknown number of standard spaces, 2 accessible	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
509	North Day Use Area: North Day Use - Parking	[32.6325, -96.98272]	Element meets all standards and requirements	2 stalls at intermediate trailhead comply	None	2010 ADAS Section: N/A		
510	North Day Use Area: North Day Use - Exterior Accessible Route	[32.62958, -96.98389]	Element meets all standards and requirements	EAR from parking at southernmost renovated restroom complies	None	2010 ADAS Section: N/A		
511	North Day Use Area: North Day Use - Exterior Accessible Route	[32.63236, -96.97963]	Element meets all standards and requirements	Route from parking to Northernmost restrooms complies	None	2010 ADAS Section: N/A		
512	North Day Use Area: North Day Use - Exterior Accessible Route	[32.6324508 ,-96.982451 5]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	Stairs near new restrooms on peninsula - Lacks visual contrast	Install contrasting strip along front 2" of each tread. The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4 2012 TAS Section: 504.4 Advisory 2010 ADAS Section: 504.4		TERCE STARS I HEAVE WARNEN RIFES PER

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
513	North Day Use Area: North Day Use - Boat Ramp	[32.62724, -96.98221]	The minimum number of boarding piers are not accessible. Where boarding piers are provided at boat launch ramps, at least 5 percent, but no fewer than one, of the boarding piers be accessible.	All 3 piers have significant step up to access	Provide 5%, but not less than one accessible boarding pier at boat launches.	2015 ABAAS Section: F235.3 2010 ADAS Section: 235.3		
514	North Day Use Area: North Day Use - Boat Ramp	[32.6277, -96.98233]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	3 stations with electric and water utility hook- ups, all have clear ground space, but water is on the back side	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice. Extend surface to allow access to water hook up on rear of unit at at least one.	2015 ABAAS Section: 1011.2		
515	North Day Use Area: North Day Use - Swimming Beach	[32.63181, -96.98235]	The surface of beach access routes and resting intervals shall be firm and stable.	Mud overflow on beach access route	Maintain a beach access route to be firm and stable as a smart practice.	2015 ABAAS Section: 1018.3		
516	North Day Use Area: North Day Use - Swimming Beach	[32.63173, -96.98233]	Beach access routes shall connect an entry point to the beach to the: 1. High tide level at tidal beaches; 2. Mean high water level at river beaches; or 3. Normal recreation water level at lake, pond, and reservoir beaches	unsure of typical water level, no connection to current water's edge	Create a beach access route to normal recreational water level of a firm and stable material as a smart practice.	2015 ABAAS Section: 1018.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
517	North Day Use Area: North Day Use - Swimming Beach	[32.6312172 , -96.981844 4]	Play area lacks designated entry. As a smart practice, play area should have a minimum 60" wide entry, free of changes in level, gaps, and slope.	Play area lacks designated entry	Create designated entry by removing 60" portion of play area boundary as a smart practice.	2015 ABAAS Section: F206.1		
						2012 TAS Section: 206.1		
						2010 ADAS Section: 206.1		
518	North Day Use Area: North Day Use - Swimming Beach	[32.6311681 , -96.981924 9]	Play area shall have signage listing designated ages of intended users as a smart practice.	Play area lacks posted ages of intended users	Acquire and install intended user signage and mount at designated entry as a smart practice.	2015 ABAAS Section: F240.1		
						2012 TAS Section: 240.1		
						2010 ADAS Section: 240.1		
519	North Day Use Area: North Day Use - Swimming Beach	[32.6311587 -96.981919 5]	Element meets all standards and requirements	Ground level play components comply - 1 slide, 2 climbers comply	None	2010 ADAS Section: N/A		
520	North Day Use Area: North Day Use - Swimming Beach	[32.6311789 ,-96.981927 5]	The sand play area lacks a transfer down to the surface and/or lacks an accessible ground level play component.	Lacks transfer system; sand access point lacks knee clearance	Install raised sand table with knee clearance or provide a means of transfer to the sand surface as a smart practice.	2012 TAS Section: 240.2.1 Advisory 1 2010 ADAS Section: 240.2.1 Advisory		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
521	North Day Use Area: North Day Use - Swimming Beach	[32.63116, -96.98185]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	Drinking fountain at play area lacks high bowl	Replace drinking fountain with a hi-lo bowl fountain.	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2		5 mar
	1							
522	North Day Use Area: North Day Use - Northernmost Renovated Men's Restroom	[32.6324052 -96.979842]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Northernmost renovated men's restroom door - slope of 6.6% in pull side clearance, fast close, 13# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
523	North Day Use Area: North Day Use - Northernmost Renovated Men's Restroom	[32.6324383 -96.979817 6]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
524	North Day Use Area: North Day Use - Northernmost Renovated Men's Restroom	[32.6324192 -96.979796 1]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
525	North Day Use Area: North Day Use - Northernmost Renovated Women's Restroom	[32.6324342 -96.979816]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.25"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3		
526	North Day Use Area: North Day Use - Northernmost Renovated Women's Restroom	[32.6323958 -96.979808]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
527	North Day Use Area: North Day Use - Northernmost Renovated Women's Restroom	[32.6324406 , -96.979821 4]	The toilet is not located within the range allowed from the side wall or partition. The centerline of the toilet must be 16 to 18 inches from the side wall.	19" towards partition	Remount toilets to 16" to 18" from the side wall to centerline.	2015 ABAAS Section: 604.2 2012 TAS Section: 604.2 2010 ADAS Section: 604.2		€ ↓ 16"-18"
528	North Day Use Area: North Day Use - Northernmost Renovated Women's Restroom	[32.6324406 -96.979810 7]	The toilet seat is not located within the range allowed off the floor. The height of accessible water closets shall be a minimum of 17 inches and a maximum of 19 inches measured to the top of a maximum 2-inch high toilet seat.	Toilet seat at 19.75" above the finished floor (AFF)	Replace toilet seat, or re-set or replace toilet to 17" to 19" above the finished floor (AFF).	2015 ABAAS Section: 604.4 2012 TAS Section: 604.4 2010 ADAS Section: 604.4		17" to 19"
529	North Day Use Area: North Day Use - Northernmost Renovated Women's Restroom	[32.6324406 -96.979810 7]	The rear grab bar is not 36" long or is not mounted in the correct location. The rear grab bar must be a minimum of 36" long and extend from the toilet centerline a minimum 12" towards the wall side and a minimum 24" towards the open side of the toilet. Grab bars shall be installed in a horizontal position, 33 inches minimum and 36 inches maximum above the finish floor measured to the top of the gripping surface and the space between the grab bar and the top of the tank shall be 1-1/2 inches minimum.	23" towards open side, 13" towards side wall	Remount rear grab bar to behind the toilet, 12" to the wall side of center and 24" to the open side and 33" to 36" AFF.	2015 ABAAS Section: 604.5.2 2012 TAS Section: 604.5.2 2010 ADAS Section: 604.5.2		Top of bar 33"-36"

r Use [32.632440 h Day , -96.97980 nost 3] ted 1's om	, slopes greater than 5 percent and cross 979805 slopes greater than 2 percent across the	Slope of 4.1% near floor drain, 2.7% in front of accessible stall	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
y Use [32.632445 h Day , -96.97980 nost 3] ted 3] ted 55 m	, and gates shall comply with 404.2.4. 979803 Maneuvering clearances shall extend the 3] full width of the doorway and the required	Northernmost renovated women's restroom door - 20# push, slope of 2.7% in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
/ Use [32.632120 h Day , /ilion -96.98333 7]	, requirements 983335	Route to Pavilion complies	None	2010 ADAS Section: N/A		
	, requirements	2 of 5 shelters on peninsula comply	None	2010 ADAS Section: N/A		
h /ili	Day on -96. Jse [32.6 Day	Day , requirements -96.983335 7] Jse [32.6323343] Element meets all standards and requirements on -96.983695	Day ion, -96.983335 7]requirementscompliesJse Day on[32.6323343 , -96.983695Element meets all standards and requirements2 of 5 shelters on peninsula comply	Day ion, -96.983335 7]requirementscompliesJse Day on[32.6323343 , , -96.983695Element meets all standards and requirements2 of 5 shelters on peninsula complyNone	Day ion-96.983335 7]requirementscompliesSection: N/AJse Day on[32.6323343 , -96.983695Element meets all standards and requirements2 of 5 shelters on peninsula complyNone2010 ADAS Section: N/A	Day on, -96.983335 7]requirementscompliesSection: N/AJse Day on[32.6323343 , -96.983695Element meets all standards and requirements2 of 5 shelters on peninsula complyNone2010 ADAS Section: N/A

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
534	North Day Use Area: North Day Use - Picnic Areas	[32.63183, -96.98046]	Element meets all standards and requirements	1 in small cluster of 5 complies	None	2010 ADAS Section: N/A		
535	North Day Use Area: North Day Use - Picnic Areas	[32.63183, -96.98046]	Element meets all standards and requirements	3 in cluster of 12 comply, but have mud overflow in them	None	2010 ADAS Section: N/A		
536	North Day Use Area: North Day Use - Picnic Areas	[32.6319978 , -96.981398 3]	Element meets all standards and requirements	2 in second cluster of 5 comply, but one has mud overflow in it	None	2010 ADAS Section: N/A		
537	North Day Use Area: North Day Use - Picnic Areas	[32.63245, -96.98273]	Element meets all standards and requirements	1 of 6 on water past intermediate trailhead comply, but has mud on the route	None	2010 ADAS Section: N/A		
538	North Day Use Area: North Day Use - Picnic Areas	[32.63255, -96.98048]	Element meets all standards and requirements	3 of 10 picnic at trailhead near northernmost restroom comply	None	2010 ADAS Section: N/A		
539	North Day Use Area: North Day Use - Picnic Areas	[32.6312361 .96.981871 7]	Element meets all standards and requirements	6 of 24 at play area comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
540	North Day Use Area: North Day Use - Picnic Areas	[32.63205, -96.98229]	Element meets all standards and requirements	Water spigot complies	None	2010 ADAS Section: N/A		
541	North Day Use Area: North Day Use - Picnic Areas	[32.6304693 -96.982857 6]	The accessible parking stall is not wide enough. Each parking space must be at least 11 feet wide and shall be marked to define the width. The measurements of parking spaces and access aisles shall be made from the centerline of the markings. Alternatively, the stall can be 8 feet wide minimum and the access aisle may be 8 feet wide. The measurements of parking spaces and access aisles shall be made from the centerline of the markings. Where the parking space is not adjacent to another parking space or access aisle, the measurement shall be permitted to include the full width of the line defining the parking space.	Upper lot past play area - 2 stalls - right stall marked van, only 8'8" with 5' aisle	Repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: 502.2 2012 TAS Section: 502.2 2010 ADAS Section: 502.2	101 102 103 104 105 106 107 104 100 110	
542	North Day Use Area: North Day Use - Picnic Areas	[32.6292608 -96.984102 9]	Element meets all standards and requirements	6 in cluster of 22+ picnic areas middle restroom complies	None	2010 ADAS Section: N/A		
543	North Day Use Area: North Day Use - Picnic Areas	[32.6278232 , -96.982745 7]	Element meets all standards and requirements	1 in cluster of 8 picnic areas at boat ramp restroom complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
544	North Day Use Area: North Day Use - Picnic Areas	[32.6308915 , -96.982250 2]	Element meets all standards and requirements	2 in cluster of 7 picnic areas past playground complies	None	2010 ADAS Section: N/A		
545	North Day Use Area: North Day Use - Picnic Areas	[32.62922, -96.98347]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Route to upper shelters - one side accessed by stairs; other route has 3.2% to 4.6% cross just before leveling out for 28 panels up to the stairs	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
546	North Day Use Area: North Day Use - Picnic Areas	[32.63108, -96.9821]	Element meets all standards and requirements	3 in cluster of 5 upper picnic areas comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
547	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.63232, -96.98246]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
548	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.63232, -96.98246]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes are partly insulated	Fully insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
549	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.63232, -96.98246]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
550	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.63232, -96.98246]	The accessible toilet compartment does not provide proper toe clearance on the front and/or side partition. The front partition and at least one side partition shall provide a toe clearance of 9 inches minimum above the finish floor and 6 inches deep minimum beyond the compartment-side face of the partition, exclusive of partition support members. Toe clearance at the side partition is not required in a compartment greater than 66 inches wide. Toe clearance at the front partition is not required where the depth is minimum 62 inches for a wall hung toilet and minimum 65 inches for a floor mounted toilet.	Only toe clearance is under door	Provide toe clearance at the front and side partitions, or enlarge stall to provide the same.	2015 ABAAS Section: 604.8.1.4 2012 TAS Section: 604.8.1.4 2010 ADAS Section: 604.8.1.4		ann ann ann

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
551	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.63232, -96.98246]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Rear grab bar at 36.25" above the finished floor (AFF)	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
552	North Day Use Area: North Day Use - New Men's Restroom On Penninsula	[32.6323, -96.98257]	Element meets all standards and requirements	New men's restroom on peninsula - gate and entry to restroom complies	None	2010 ADAS Section: N/A		
553	North Day Use Area: North Day Use - New Women's Restroom on Peninsula	[32.6322993 -96.982472 2]	Element meets all standards and requirements	New women's restroom on peninsula - gate and entry to restroom complies	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
554	North Day Use Area: North Day Use - New Women's Restroom on Peninsula	[32.6323174 -96.982525 8]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
555	North Day Use Area: North Day Use - New Women's Restroom on Peninsula	[32.6322722 -96.982536 6]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes partly insulated	Fully insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
556	North Day Use Area: North Day Use - New Women's Restroom on Peninsula	[32.6322812 -96.982536 6]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
557	North Day Use Area: North Day Use - New Women's Restroom on Peninsula	[32.6322903 ,-96.982515 1]	The accessible toilet compartment does not provide proper toe clearance on the front and/or side partition. The front partition and at least one side partition shall provide a toe clearance of 9 inches minimum above the finish floor and 6 inches deep minimum beyond the compartment-side face of the partition, exclusive of partition support members. Toe clearance at the side partition is not required in a compartment greater than 66 inches wide. Toe clearance at the front partition is not required where the depth is minimum 62 inches for a wall hung toilet and minimum 65 inches for a floor mounted toilet.	Only toe clearance is under door	Provide toe clearance at the front and side partitions, or enlarge stall to provide the same	2015 ABAAS Section: 604.8.1.4 2012 TAS Section: 604.8.1.4 2010 ADAS Section: 604.8.1.4		ann. ann. ann. ann. ann. ann. ann.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
558	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Left	[32.6323099 , -96.982524 4]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	North Day Use - New Family Restroom On Peninsula Left door - 20# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
559	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Left	[32.6322826 -96.982517 3]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
560	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Left	[32.632305, -96.982506 6]	The baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
561	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Left	[32.6322954 -96.982517 3]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both grab bars are 36.5" AFF	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
562	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Left	[32.6322922 -96.982490 5]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3% near floor drain and in clear floor space (CFS) of sink	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
563	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Right	[32.6322828 -96.982474 9]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	North Day Use - New Family Restroom On Peninsula Right door - 25# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
564	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Right	[32.6323236 , -96.982504 4]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
565	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Right	[32.6323012 -96.982480 2]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
566	North Day Use Area: North Day Use - New Family Restroom On Peninsula - Right	[32.6323044 -96.982482 9]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 2.6% near floor drain and in CFS of sink	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
567	North Day Use Area: North Day Use - Southernmost Renovated Restroom Women's	[32.6295581 -96.983898 5]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Southernmost renovated restroom women's door - 10# push, fast close	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers.	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		
568	North Day Use Area: North Day Use - Southernmost Renovated Restroom Women's	[32.6295179 -96.983893 6]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
569	North Day Use Area: North Day Use - Southernmost Renovated Restroom Women's	[32.6295371 -96.983904 3]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.8% at drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
570	North Day Use Area: North Day Use - Southernmost Renovated Restroom Men's	[32.6295326 -96.983893 9]	Element meets all standards and requirements	Southernmost renovated men's restroom complies	None	2010 ADAS Section: N/A		
571	North Day Use Area: North Day Use - Southernmost Renovated Restroom Men's	[32.629539, -96.983896 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Southernmost renovated men's restroom door - 20# push, slope of 4.5% in pull side clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
572	North Day Use Area: North Day Use - Southernmost Renovated Restroom Men's	[32.6295414 , -96.983895 6]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Water off, unable to test	Water shut off - unable to test. Assure sink faucets remain on for min. 10 seconds when reopened.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		
573	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Right	[32.62793, -96.98255]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	North Day Use - New Family Restrooms Near Boat Ramp Parking - Right door - 20# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
574	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Right	[32.627999, -96.982458 1]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.		Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
575	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Right	[32.6280054 -96.982448 7]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3.2% near floor drain and in CFS of sink	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
576	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Left	[32.6280215 ,-96.982460 4]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Rim of sink at 34.25" AFF	Lower sinks to max 34" above the finished floor (AFF) to front of rim. In the alternative, leave as is citing construction tolerance.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		Ter clearance
577	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Left	[32.6280454 -96.982436 2]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever- operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Self-closing faucet stays open for 4 seconds	Adjust timing of sink faucets to remain on for min. 10 seconds.	2015 ABAAS Section: 606.4 2012 TAS Section: 606.4 2010 ADAS Section: 606.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
578	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Left	[32.6280294 -96.982451]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 18.5" when open	Relocate baby changing table to a location where the fixture does not impede the required clearance at the toilet in both the open and closed positions.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
579	North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Left	[32.6280199 -96.982464 4]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Slope of 3.4% near floor drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

580North Day Use Area: North Day Use - New Family Restrooms Near Boat Ramp Parking - Left[32.6280087Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authorityNorth Day Use - New Family Restrooms Near Boat Ramp Parking - Left door - 20# pushInspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.2010 ADAS Section: 404.2.9	Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
		Area: North Day Use - New Family Restrooms Near Boat Ramp	, -96.982463	open; fire doors shall have a minimum opening force allowable by the appropriate	Family Restrooms Near Boat Ramp Parking - Left door -		Section:		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
581	North Day Use Area: North Day Use - Elements	[32.6324168 , -96.979802 4]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	Drinking fountain at northernmost renovated restroom - lacks high bowl	Add second high bowl fountain for standing persons.	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2	J.J.	5 may
582	North Day Use Area: North Day Use - Elements	[32.6324068 -96.979775 6]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking fountain at northernmost renovated restroom - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		
583	North Day Use Area: North Day Use - Elements	[32.6324456 -96.979797 1]	The 30 inches minimum by 48 inches minimum clear floor space required at the operable part is not flat (2% or 1:48 maximum slope) in all directions. Changes in level are not permitted at required clear floor or ground space except that slopes not steeper than 1:48 shall be permitted.	Drinking fountain at northernmost renovated restroom - has forward approach, but slope of 2.3% in clear floor space (CFS)	Correct or repair slope in CFS to max 2.08%.	2015 ABAAS Section: 305.2 2012 TAS Section: 305.2 2010 ADAS Section: 305.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
584	North Day Use Area: North Day Use - Elements	[32.6322617 -96.982497]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking fountain at new restrooms on peninsula - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		
585	North Day Use Area: North Day Use - Elements	[32.6322707 -96.982497]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Drinking fountains at new restrooms on peninsula - protrude more than 4" into pedestrian way	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		The second secon
586	North Day Use Area: North Day Use - Elements	[32.6323019 -96.982519 5]	Element meets all standards and requirements	2 of 2 accessible (5 total) outdoor rinsing showers at new restrooms building on peninsula of North Day Use Area comply	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
587	North Day Use Area: North Day Use - Elements	[32.6295497 , -96.983900 2]	There is no drinking fountain for standing persons. Spout outlets of drinking fountains for standing persons shall be 38 inches minimum and 43 inches maximum above the finish floor or ground.	Drinking fountain at southernmost renovated restrooms - lacks high bowl	Add second high bowl fountain for standing persons.	2015 ABAAS Section: 602.7 2012 TAS Section: 602.7 2010 ADAS Section: 602.7, 211.2		5 million of the second
588	North Day Use Area: North Day Use - Elements	[32.6295369 -96.983889 5]	The water flow from the spout is too low. The spout shall provide a flow of water 4 inches high minimum.	Drinking fountain at southernmost renovated restrooms - Water off, unable to test	Water shut off - unable to test. Assure spout flow height is min. 4" when reopened.	2015 ABAAS Section: 602.6 2012 TAS Section: 602.6 2010 ADAS Section: 602.6		
589	North Day Use Area: North Day Use - Elements	[32.62812, -96.98247]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	Drinking fountain at new restrooms near boat ramp - Lacks knee clearance - 26.5"	Raise drinking fountain to provide required 27" knee clearance.	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2		PILL - INCICLANCE PILL - INCICLANCE THE OFFICE

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
590	North Day Use Area: North Day Use - Elements	[32.62812, -96.98247]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Drinking fountains at new restrooms near boat ramp - protrude more than 4" into pedestrian way	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		A CONTRACTOR OF THE OFFICE OFF
591	North Day Use Area: North Day Use - Accessible Trail	[32.63232, -96.9798]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	2.6% to 4.3% on first 18 panels at trailhead near northernmost restroom	Correct or repair pathway cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1017.2	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
592	North Day Use Area: North Day Use - Accessible Trail	[32.63243, -96.98026]	The surface of trails, passing spaces, and resting intervals shall be firm and stable.	Mud overflow on trail just past first picnic area	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice.	2015 ABAAS Section: 1017.2		
593	North Day Use Area: North Day Use - Accessible Trail	[32.63197, -96.98139]	The surface of trails, passing spaces, and resting intervals shall be firm and stable.	Mud overflow on trail at cluster of 12 picnic areas at water	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice.	2015 ABAAS Section: 1017.2		
594	North Day Use Area: North Day Use - Accessible Trail	[32.62176, -96.97913]	Element meets all standards and requirements	Signage complies	None	2010 ADAS Section: N/A		
595	North Day Use Area: North Day Use - Accessible Trail	[32.63184, -96.98046]	The surface of trails, passing spaces, and resting intervals shall be firm and stable.	Mud overflow on trail at cluster of 5 picnic areas	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice.	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
596	North Day Use Area: North Day Use - Accessible Trail	[32.63205, -96.98252]	Element meets all standards and requirements	Ramp from restroom near play area complies	None	2010 ADAS Section: N/A		
597	North Day Use Area: North Day Use - Accessible Trail	[32.63089, -96.98196]	The tree extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	Tree overhangs trail near play area	Trim tree branches to provide min 80" overhead clearance.	2015 ABAAS Section: 307.3 2012 TAS Section: 307.3 2010 ADAS Section: 307.3		Any Projection
598	North Day Use Area: North Day Use - Accessible Trail	[32.631, -96.98227]	The surface of trails, passing spaces, and resting intervals shall be firm and stable.	Mud overflow on trail after play area before stone bench	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice.	2015 ABAAS Section: 1017.2		
599	North Day Use Area: North Day Use - Accessible Trail	[32.63051, -96.98257]	The surface of trails, passing spaces, and resting intervals shall be firm and stable.	Mud overflow on trail at middle restroom	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice.	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
600	North Day Use Area: North Day Use - Accessible Trail	[32.631, -96.98221]	Element meets all standards and requirements	5 stone benches comply	None	2010 ADAS Section: N/A		
	1		1	Γ	1			
601	North Day Use Area: North Day Use - Employee Spaces	[32.6324414 -96.979794 9]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Northernmost renovated restroom plumbers chase - Lacks clearance on push and pull sides, knobs	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. In the alternative, leave as is as correction may be technically infeasible. Replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
602	North Day Use Area: North Day Use - Employee Spaces	[32.6322994 -96.982494 2]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Utility Chase/Room 102 at new restrooms building on peninsula - fast close, 20# push, small space - lacks clearance on push side	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. In the alternative, leave as is as correction may be technically infeasible. Inspect, adjust, and maintain closing speed on door closers. Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
603	North Day Use Area: North Day Use - Employee Spaces	[32.6280094 -96.982434 1]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Utility Chase/Room 111 at new restrooms near boat ramp parking - lacks clearance on pull side, plant overgrowth on approach and no route, 22# push, lacks push side clearance due to small space	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Provide required maneuvering clearance on push and pull side of doors. In the alternative, leave as is citing construction tolerance. Provide a route from parking to door. Repair, bevel, or ramp CILs at door entries to max .25". Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
604	Lakeview Camping Area: Lakeview - Parking	[32.6291109 , -96.978916 8]	Element meets all standards and requirements	4 standard stalls, one accessible	None	2010 ADAS Section: N/A		
605	Lakeview Camping Area: Lakeview - Parking	[32.6291241 -96.978910 1]	The access aisle is missing at the accessible parking stall. Access aisles serving parking spaces shall adjoin an accessible route. Two parking spaces shall be permitted to share a common access aisle.	Lacks marked access aisle	Restripe stall, adding one 5' adjacent access aisle, with proper signage and striping.	2015 ABAAS Section: 502.3.1 2012 TAS Section: 502.3.1 2010 ADAS Section: 502.3.1		Annual for the set of
606	Lakeview Camping Area: Lakeview - Parking	[32.6291172 -96.978926 2]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 4 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Lacks a van accessible space	Add van parking sign to 1 accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		Massist of Resident Massist Section (Massist) 1 1 <tr< td=""></tr<>

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
607	Lakeview Camping Area: Lakeview - Parking	[32.6291337 -96.978928 8]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	3% in stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		4-4-
608	Lakeview Camping Area: Lakeview - Parking	[32.6291525 -96.978926 2]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Surface degraded	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in slope correction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		1/2 1/2 1/2 1/2
609	Lakeview Camping Area: Lakeview - Parking	[32.6291453 -96.978916 8]	The accessible parking stall signage is incorrect and/or missing from each accessible parking space. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Stall lacks R7-8 sign	Replace existing signage with R7-8 signage as a smart practice.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6		RESERVED PARKING
610	Lakeview	[32.62906,	Element meets all standards and	Dump station	None	2010 ADAS		
	Camping Area: Lakeview - RV dump station	-96.97766]	requirements	complies		Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
611	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291631 -96.978716 5]	The sloped portion of the threshold is too steep. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise.	Lakeview men's restroom door - 9.7% slope at threshold	Replace thresholds at doors with beveled ADA thresholds.	2015 ABAAS Section: 404.2.5 2012 TAS Section: 404.2.5 2010 ADAS Section: 404.2.5		¹ / ₂ ¹ / ₂ ² / ₂ ² / ₂ ² / ₂
612	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291635 -96.978706 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom of mirror at 41.5"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	2 22 23 24 45 45 45 45 45 45 45 45 45 45 45 45 45	
613	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291337 -96.978711 6]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	36" to sink rim	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		there character
614	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291293 -96.978706 2]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		ACCESSIBLE LAVATORY

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
615	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291461 -96.978722 3]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.		Lower hook to max 48" above the finished floor (AFF) to highest operable part. Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
616	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291505 -96.978716 9]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
617	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291425 -96.978700 8]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20" to partition	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 16" to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uiu 09 35-37
618	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291421 -96.978727 7]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	One at 37", one at 36.75"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
619	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291421 -96.978722 3]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP mounted right at toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		y un start by the start of the
620	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291204 -96.978719 6]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
621	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291605 -96.978711 6]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.5% slope in clear floor space at urinal	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
622	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291395 .96.978700 8]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hook at shower at 71"	Remount at least one hook to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
623	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291695 -96.978700 8]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench		Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos Figure
624	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291378 -96.978706 2]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks compliant configuration for accessible shower	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6	STANDARD ROLL-IN TYPE SHOWER COMMANDER
625	Lakeview Camping Area: Lakeview - Men's Restroom	[32.6291342 -96.978732 4]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Lacks route to pipe chase	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Create an accessible route with crushed stone or other outdoor material from parking or walkway to pipe chase.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	
626	Lakeview Camping Area: Lakeview - Women's Restroom	[32.62914, -96.97884]	The running slope of walking surfaces shall not be steeper than 1:20. The cross slope of walking surfaces shall not be steeper than 1:48.	Parking to restroom 2.9% cross slope	Correct running slopes to max 5% and cross to max 2.08%.	2012 TAS Section: 403.3 2010 ADAS Section: 403.3	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
627	Lakeview Camping Area: Lakeview - Women's Restroom	[32.62912, -96.97878]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" change in elevation (CIL) in path to restroom	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/2 1/2 1/2 1/2
628	Lakeview Camping Area: Lakeview - Women's Restroom	[32.629147, -96.978725]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of mirror at 41.25"	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	38 39 40 41 42 43 44 4	
629	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291699 , -96.978706 2]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim at 36"	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3	3 34 35 35 37 38	Ter clearance
630	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291275 -96.978727 7]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink pipes lack insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
631	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291785 -96.978700 8]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Soap dispenser at 56" over sink	Lower soap dispenser to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
632	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291377 -96.978711 6]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
633	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291333 -96.978727 7]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	19.5" from side wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls, or 16"to 18" in new wheelchair stall.	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		uite 09
634	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291514 -96.978743 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self- closing and lacks exterior hardware	Adjust stall door to be self-closing. Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
635	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291374 -96.978716 9]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Both bars at 37"	Remount grab bars in accessible stall to 33" to 36" above the finished floor (AFF).	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		
636	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291379 -96.978725]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP mounted behind front of toilet	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
637	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291593 -96.978700 8]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	4% cross at drain	Correct or repair slope to max 2.08% in restroom.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
638	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291695 -96.978700 8]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hook at shower 72"	Remount at least one hook to max 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
639	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291311 -96.978690 1]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground. Clear floor or ground space complying with 305 shall be provided and shall be positioned at the end of the bench seat and parallel to the short axis of the bench	Changing bench depth 16", lacks clear floor space on short axis	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF and provide required clear floor space on the short axis of the bench.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		Bench
640	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291198 -96.978727 7]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Shower fails to meet accessible configuration	Create an accessible shower in locker/bathing room.	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		SIADAGE ORLINITYS SHOWEN
641	Lakeview Camping Area: Lakeview - Women's Restroom	[32.6291197 -96.978727 3]	The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. I/4 inch is the maximum vertical rise. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Lakeview women's restroom door - 10# push, 16.5% slope at threshold	For all doors along the public circulation route, provide beveled threshold. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
642	Lakeview Camping Area: Lakeview - Playground	[32.6291709 -96.979655 7]	There is no accessible route to the play area. Accessible routes serving play areas shall comply with Chapter 4 and 1008.2 and shall be permitted to use the exceptions in 1008.2.1 through 1008.2.3. Where accessible routes serve ground level play components, the vertical clearance shall be 80 inches high (2030 mm) minimum.	Lacks route to play area	Create an AR to the play area within the site.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 1008.2 2010 ADAS Section: 206.2.2		CCSSUL CLAMDIN
643	Lakeview Camping Area: Lakeview - Playground	[32.6291643 -96.979647 7]	Play area lacks designated entry. As a smart practice, play area should have a minimum 60" wide entry, free of changes in level, gaps, and slope.	Lacks designated entry - continuous border	Create designated entry by removing 60" portion of play area boundary as a smart practice.	2015 ABAAS Section: F206.1 2012 TAS Section: 206.1 2010 ADAS Section: 206.1		
644	Lakeview Camping Area: Lakeview - Playground	[32.6291801 -96.979642 3]	Play area shall have signage listing designated ages of intended users as a smart practice.	Lacks posted ages of intended users	Acquire and install intended user signage and mount at designated entry as a smart practice.	2015 ABAAS Section: F240.1 2012 TAS Section: 240.1 2010 ADAS Section: 240.1		
645	Lakeview Camping Area: Lakeview - Playground	[32.6291821 -96.979634 3]	Compliance with ASTM F 1951 for accessibility for ground surfaces on accessible routes, clear floor or ground spaces, and turning spaces has not been determined. Ground surfaces shall comply with ASTM F 1951. Ground surfaces shall be inspected and maintained regularly and frequently to ensure continued compliance with ASTM F 1951.	Surface appears to be wood chips	Replace existing surface with an accessible surface such as EWF, PIP or tiles, with compliant slopes and CILs.	2012 TAS Section: 1008.2.6.1 2010 ADAS Section: 1008.2.6.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
646	Lakeview Camping Area: Lakeview - Playground	[32.6291565 ,-96.979650 3]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Low fill creates change in elevation (CIL) at border	Frequently inspect and regularly maintain accessible portions of play area surface that are comprised of loose fill such as EWF so that surface is level with other surfaces.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		1/4 max 1/4 1/2 1/2 1/2
647	Lakeview Camping Area: Lakeview - Playground	[32.6291672 -96.979647 7]	There are not enough accessible elevated play components. Where Elevated Play Components are provided, at least 50 percent shall be on an accessible route. An accessible route may be a ramp of transfer system.	0 of 7 on route due to lack of ramp or transfer	Install transfer platform if feasible. In the alternative, leave as is until replaced.	2012 TAS Section: 240.2.2 2010 ADAS Section: 240.2.2		
648	Lakeview Camping Area: Lakeview - Sample Campsite	[32.62931, -96.97903]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	70 campsites, none accessible - parking surface degraded, no route to site elements, site elements not of accessible design	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
649	Eagle Ford Camping Area: EF - Parking	[32.6358014 -96.978035 1]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 7 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	overflow near site 91 - 7 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Bits Bits <th< td=""></th<>
650	Eagle Ford Camping Area: EF - Parking	[32.6356585 -96.978295 4]	Element meets all standards and requirements	Restroom parking - 3 standard, 2 accessible	None	2010 ADAS Section: N/A		
651	Eagle Ford Camping Area: EF - Parking	[32.6356681 ,-96.978367 8]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Restroom parking - 3.2% aisle, 3.6% left stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
652	Eagle Ford Camping Area: EF - Parking	[32.6356768 -96.978357 1]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Restroom parking - 2 ruts where there likely was older striping	Resurface access aisle to eliminate ruts, CILs, gaps and cracks. Cost included in slope correction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		Max N N N N N N N N N N N N N N N N N N N

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
653	Eagle Ford Camping Area: EF - Parking	[32.6357192 , 96.978370 5]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Lacks van accessible sign	Add one van parking sign to van accessible stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 60 nches min.
654	Eagle Ford Camping Area: EF - Parking	[32.6342, -96.97644]	Element meets all standards and requirements	Restroom building 3 parking - 7 standard, 2 accessible	None	2010 ADAS Section: N/A		
655	Eagle Ford Camping Area: EF - Parking	[32.6342415 -96.976562]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 7 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Restroom building 3 parking - lacks van signage	Add van parking sign to van accessible stall.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		Sector of Decision of Decisiono

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
656	Eagle Ford Camping Area: EF - Parking	[32.6342439 -96.976562]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Restroom building 3 parking - left stall 2.6%, access aisle 2.9%, right stall 2.9%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
657	Eagle Ford Camping Area: EF - Parking	[32.6349707 -96.977097 6]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 6 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Parking near campsite 89 - 6 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Description Material Allowing Charling Name Scale No - No

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
658	Eagle Ford Camping Area: EF - Parking	[32.6352733 , -96.980254 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 9 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Overflow parking near campsite 126 - 9 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Non- No- Non- Non-
659	Eagle Ford	[32.6341401	Restrooms building slated for demolition.	staff indicated both	If restrooms are replaced in the future,	2015 ABAAS		
	Camping Area: EF - Men's/Women's Restroom 3	, -96.97658 78], [32.6358297 , -96.978347 3]		restroom buildings to be torn down, similar to Shady Ridge	assure all accessibility standards are followed for restrooms, doors and route.	Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended		
660	Eagle Ford	[32.6341348	Restrooms slated for demolition.	staff indicated both	If restrooms are replaced in the future,	2015 ABAAS		Γ
000	Camping Area: EF - Men's/Women's Restroom 4	[32.6341348 , -96.97660 02], [32.6358597 , -96.978349]		restroom buildings in this section will be torn down	followed for restrooms, doors and route.	Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
661	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	The surface of the outdoor recreation access route, passing spaces, and/or resting intervals are not firm and stable. The surface of outdoor recreation access route, passing spaces, and resting intervals shall be firm and stable, having a width of 36", max gaps of .5" and tread obstacles of .5" or less.	Some deterioration along one side, 2" gap along parking stall	Correct surface of ORAR to be firm and stable, a min 36" wide and having gaps and changes in level of max .5".	2015 ABAAS Section: 1016. 2		
662	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	The outdoor recreation access route has obstacles that are too high. Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch in height measured vertically to the highest point.	1" from parking, 2" at electric hook up	Repair, bevel, or ramp CIL along ORAR.	2015 ABAAS Section: 1016.5		
663	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Slopes of 2.9% at fire pit, 3.3% at hook, 3.6% at parking	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
664	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	Clear ground space 48 inches (1220 mm) by 48 inches (1220 mm) should be provided on all usable sides of the fire ring, grill, fireplace, and woodstove. Center the space on each usable side of the grill, fireplace, and woodstove.	Clear ground space (CGS) does not go all the way around fire ring	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice.	2015 ABAAS Section: 1011.2		
665	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	3 campsites designated as accessible in this section, 71 total campsites	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		
666	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	A minimum of one of each type of outdoor constructed feature does not have mobility features. Where provided, at least one of each type of outdoor constructed features with mobility features must be provided.	Camp hook about 67"	Provide accessible outdoor constructed features at the required number of camp units based on the total number provided. Remount camp hook to be in reach range of 15" min to 48" max.	2015 ABAAS Section: F244.2.3.1, F245.2.5.1		
667	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum. EXCEPTION: Where two adjacent parking spaces are provided for recreational vehicles, one parking space shall be permitted to be 16 feet (4880 mm) wide minimum.	Parking space 235" wide - narrower at head of stall	Correct RV parking space to be 20' wide minimum; or 16' for two adjacent spaces as a smart practice.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
668	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	Electrical outlets too far to reach	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice.	2015 ABAAS Section: 1011.2		
669	Eagle Ford Camping Area: EF - Campsite #111	[32.63583, -96.98016]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground.	Water spout at 26"	Remount water spouts to 28" min or 36" max above the ground as a smart practice.	2015 ABAAS Section: 1011.6		
670	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	The outdoor recreation access route has obstacles openings that are greater than 1/2 inch wide. Openings in the surface of outdoor recreation access routes shall not allow the passage of a sphere more than 1/2 inch in diameter.	1.75" gap approaching picnic area, 5" gap at picnic area	Correct or fill gaps along ORAR.	2015 ABAAS Section: 1016.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
671	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	The outdoor recreation access route has obstacles that are too high. Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch in height measured vertically to the highest point.	Anchor near picnic table is a 1" hazard	Repair, bevel or ramp CIL along AR.	2015 ABAAS Section: 1016.5		
672	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	2.7% slope	Correct or repair ORAR cross slope to max 2.08% as a smart practice.	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		
673	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	Picnic tables are required to have clear ground space 36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches.	2.9%, lacks width around table	Reposition picnic table to provide required 36" clear ground space around all usable portions of the table as a smart practice. Correct running slopes to max 5% and cross to max 2.08%.	2015 ABAAS Section: 1011.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
674	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	Clear ground space 48 inches (1220 mm) by 48 inches (1220 mm) should be provided on all usable sides of the fire ring, grill, fireplace, and woodstove. Center the space on each usable side of the grill, fireplace, and woodstove.	Fire ring lacks clear ground space	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice.	2015 ABAAS Section: 1011.2		
675	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Slopes of 3.2% and 2.9% in parking space	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION		
676	Eagle Ford Camping Area: EF - Campsite #112	[32.63618, -96.98029]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground.	Water spout at 20.75" above ground level (AGL)	Remount water spouts to 28" min or 36" max above the ground as a smart practice.	2015 ABAAS Section: 1011.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
677	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	The outdoor recreation access route has obstacles openings that are greater than 1/2 inch wide. Openings in the surface of outdoor recreation access routes shall not allow the passage of a sphere more than 1/2 inch in diameter.	1.5" gap approaching picnic area, 1.5" gap at route to restroom building	Correct or fill gaps along ORAR.	2015 ABAAS Section: 1016.6		
678	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	The outdoor recreation access route has obstacles that are too high. Obstacles on outdoor recreation access routes, passing spaces, and resting intervals shall not exceed 1/2 inch in height measured vertically to the highest point.	1.5" change in in elevation (CIL) at parking space	Repair, bevel or ramp CIL along ORAR.	2015 ABAAS Section: 1016.5		
679	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	Picnic tables are required to have clear ground space 36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches.	Picnic table lacks 36" clear ground space (CGS)	Reposition picnic table to provide required 36" clear ground space around all usable portions of the table as a smart practice.	2015 ABAAS Section: 1011.2.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
680	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	Clear ground space 48 inches (1220 mm) by 48 inches (1220 mm) should be provided on all usable sides of the fire ring, grill, fireplace, and woodstove. Center the space on each usable side of the grill, fireplace, and woodstove.	Fire ring lacks clear ground space (CGS)	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice.	2015 ABAAS Section: 1011.2		
681	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground.	Fire building surface just above ground level	Correct fire building surface to be 9" min above the ground as a smart practice. In the alternative, replace fire ring with an accessible mode.	2015 ABAAS Section: 1011.5.1		
682	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	A minimum of one of each type of outdoor constructed feature does not have mobility features. Where provided, at least one of each type of outdoor constructed features with mobility features must be provided.	Camp hooks are high	Provide accessible outdoor constructed features at the required number of camp units based on the total number provided. Remount camp hooks to be in reach range of 15" min to 48" max.	2015 ABAAS Section: F244.2.3.1, F245.2.5.1		
683	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	2.9% slope near utilities	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
684	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	6.7% slope at utilities, lacks clear ground space	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice.	2015 ABAAS Section: 1011.2		
685	Eagle Ford Camping Area: EF - Campsite #124	[32.63595, -96.97852]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground.	Water spout at 25.5" above ground level (AGL)	Remount water spouts to 28" min or 36" max above the ground as a smart practice.	2015 ABAAS Section: 1011.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
686	Shady Ridge Camping Area: SR - Parking	[32.635609, -96.975197 3]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 6 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Overflow parking near site 70 - 6 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Watch Alexisten Secondaria Secondaria 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 101 1 1 102 1 1 103 1 1 103 1 1 103 1 1 103 1 1 103 1 1 103 1 1 103 1 1 103 1 1
687	Shady Ridge Camping Area: SR - Parking	[32.62176, -96.97913]	Element meets all standards and requirements	Parking near campsite 10 - 4 standard, 1 accessible	None	2010 ADAS Section: N/A		
688	Shady Ridge Camping Area: SR - Parking	[32.6359562 -96.974477 7]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 4 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Parking near campsite 10 - lacks designated van stall	Add van parking sign to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		Matrix I data have Matrix I data have No 1 No <t< td=""></t<>

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
689	Shady Ridge Camping Area: SR - Parking	[32.6359144 -96.974461 6]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking near campsite 10 - stall - 4.2%, access aisle - 4.4%	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
690	Shady Ridge Camping Area: SR - Parking	[32.6368064 -96.975809 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 7 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Overflow parking near campsite 21 - 7 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Number / Rest Number / Rest No.1 1 No.1

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
691	Shady Ridge Camping Area: SR - Parking	[32.6386018 -96.979515 5]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 12 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Parking areas near campsite 52 - 12 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Name of any print have Name of any print have 12.0 -
692	Shady Ridge Camping Area: SR - Parking	[32.637945, -96.978090 6]	Element meets all standards and requirements	Parking near northernmost restrooms - 4 standard, 1 accessible	None	2010 ADAS Section: N/A		
693	Shady Ridge Camping Area: SR - Parking	[32.6378342 -96.978239 5]	The striping and markings for the accessible parking stall, loading/unloading access aisle are dilapidated and in need of repair and/or maintenance.	Parking near northernmost restrooms -needs to be repainted	Repaint stalls and access aisles with a high quality paint.	2015 ABAAS Section: 502.3.3 2012 TAS Section: 502.3.3 2010 ADAS Section: 502.3.3		VAN CAR
694	Shady Ridge Camping Area: SR - Parking	[32.6379428 -96.978089 3]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Parking near northernmost restrooms - Lacks van accessible signage	Add one van parking sign to van accessible stall.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		Van Accessible 60 nches min.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
695	Shady Ridge Camping Area: SR - Parking	[32.6379541 ,-96.978073 2]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Parking near northernmost restrooms - stall 2.9% slope	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		4
696	Shady Ridge Camping Area: SR - Parking	[32.6379405 -96.978062 5]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Parking near northernmost restrooms -areas of stall need to be resurfaced	Resurface stalls and access aisles to eliminate gaps and cracks. Cost included in slope correction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		Max N N N N N N N N N N N N N N N N N N N
697	Shady Ridge Camping Area: SR - Women's/Men's Restroom 1	[32.6378524 , -96.97825 56], [32.6358557 , -96.974575 6]	Restroom slated for demolition.	staff indicated both restroom buildings will be torn down and replaced, currently has ambulatory stall and inaccessible showers	If restrooms are replaced in the future, assure all accessibility standards are followed for restrooms, doors and route.	2015 ABAAS Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
698	Shady Ridge Camping Area: SR - Women's/Men's Restroom 2	[32.6358873 , -96.97461 58], [32.6378208 , -96.978242 2]	Restrooms slated for demolition.	staff indicated both restroom buildings will be torn down and replaced, currently has ambulatory stall and inaccessible showers	If restrooms are replaced in the future, assure all accessibility standards are followed for restrooms, doors and route.	2015 ABAAS Section: Reco mmended 2012 TAS Section: Reco mmended 2010 ADAS Section: Reco mmended		
699	Shady Ridge Camping Area: SR - Sample Campsite	[32.63581, -96.9744]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 78 campsites accessible - area undergoing renovation in near future, site includes paved parking stall, picnic table, hook, fire pit, water spout, electric hook up	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
700	Trails: Duck Pond Trail	[32.6115258 , -96.988783 6]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Duck Pond Trail - surface is large gravel	Replace surface of trail to be firm and stable.	2015 ABAAS Section: 1017.2		
701	Trails: Duck Pond Trail	[32.6114929 -96.988738]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks route to trailhead elements - shade structure, sign, water spigot, garbage	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
702	Trails: Duck Pond Trail	[32.6116747 .96.988628 1]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 10 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of one accessible stalls with a minimum of one being designed as van accessible.	Duck pond trailhead - 10 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Verbalter of binary basis Research binary basis 100 1

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
703	Trails: Duck Pond Toilet	[32.6107061 -96.986114 3]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	Lacks accessible restroom at Duck Pond Trail	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1 2012 TAS Section: 603.1 2010 ADAS Section: 603.1		OF MIN CLEAR OF MIN CLEAR OF MIN CLEAR OF MIN CLEAR OF MIN CLEAR
704	Trails: Duck Pond Scenic Viewpoint	[32.61359, -96.9827]	There is no accessible route to the overlook. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Dirt and grass route to overlook	Create an accessible route with crushed stone or other outdoor material from parking to overlook. See trail surface replacement recommendation.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2	<image/>	ACESSIL ENTRACES

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
705	Trails: Talala Trail	[32.6164288 -96.981873 6]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Talala Trail Lcks firm and stable surface - natural surface	Replace trail surface to be firm and stable.	2015 ABAAS Section: 1017.2		
706	Trails: Talala Trail	[32.6164014 -96.981393 4]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 10 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Talala Trail parking - 10 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		Market Patro Attempts Market Patro Attempts 1 1

Finding Ar Number	Area Description Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
	Trails: Talala Trail [32.61634 -96.98155	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks ORAR to Trailhead, stairs, info signs, bench and garbage can - 130' needed to "Preserving Our Prairie" sign and start of trail	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1	<image/>	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
708	Trails: Talala Trail Toilet	[32.616308, -96.984924 9]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	Talala Trail lacks accessible toilet - Trail surface not compliant to access toilet	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1 2012 TAS Section: 603.1 2010 ADAS Section: 603.1	<image/>	BO' MIN CLEAR TO MIN BO' MIN CLEAR TO MIN BO'
709	Trails: Talala Trail Scenic Viewpoint	[32.6169529 -96.986940 6]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Talala Trail Overlook - lacks ORAR due to non compliant surface	Repair surface or ORAR to be firm and stable as a smart practice. See previous finding recommending trail resurface.	2015 ABAAS Section: 1016. 2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
710	Trails: DORBA Trail	[32.60997, -96.99733]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	DORBA Trail surface - loose rock and dirt	Leave as is DORBA trail as surface change would change the nature of the activity.	2015 ABAAS Section: 1017.2		
711	Trails: DORBA Trail	[32.60996, -96.99728]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Lacks route (ORAR) to signage and garbage at trailhead	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
712	Trails: Duck Pond and Talala Primitive Camping Campsites	[32.6108596 -96.988173 1]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	Duck Pond Trail and Talala Trail primitive camping (30 total sites/areas) - lacks any features and campsites	Create the required number of accessible camp sites per table F244.2 as a smart practice.	2015 ABAAS Section: F244.2		