

# Access Audit Site Report



**McKinney Falls State Park**  
**5808 McKinney Falls Pkwy**  
**Austin, TX 78744**  
**Accessibility Evaluation**  
**Inspection Date: 11/11/2021**  
**Inspectors: Tanya Scheibe**

Prepared By  
**WT Group**

Engineering with Precision, Pace & Passion.  
(224) 293 - 6451  
[www.wtengineering.com](http://www.wtengineering.com)

**Table of Contents**

---

<b>Cover Letter</b>	<b>3</b>
<b>MCKINNEY FALLS STATE PARK PROGRAM REPORT 202301</b>	<b>5</b>
<b>Findings</b>	<b>13</b>
<b>Exterior</b>	<b>13</b>
<b>Headquarters</b>	<b>51</b>
<b>Cabin Area</b>	<b>68</b>
<b>Youth Group Camping Area</b>	<b>86</b>
<b>Big Cedar/Moss Loop Camping Areas</b>	<b>87</b>
<b>Grapevine Loop Camping Area</b>	<b>99</b>
<b>Little Oak Camping Area</b>	<b>114</b>
<b>Big Oak Camping Area</b>	<b>127</b>
<b>Group Dining Hall</b>	<b>137</b>
<b>Park Sites</b>	<b>155</b>
<b>Smith Visitor Center</b>	<b>161</b>
<b>Upper Falls</b>	<b>175</b>
<b>Picnic Area</b>	<b>178</b>
<b>Homestead Trail Trailhead</b>	<b>188</b>
<b>Picnic Trail Trailhead</b>	<b>197</b>
<b>Employee Spaces</b>	<b>198</b>
<b>Trails</b>	<b>205</b>
<b>Amphitheater Restrooms</b>	<b>218</b>

July 28, 2023

Jessica Burke, ADA Coordinator  
Support Resources  
Texas Parks and Wildlife Department  
4200 Smith School Road  
Austin, TX 78744

Dear Jessica,

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the McKinney Falls State Park located at 5808 McKinney Falls Pkwy, Austin, TX 78744. The facility was inspected on 11/11/2021.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.

2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and findings new to the technical standards such as recreation elements

3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.

4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.

5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.

Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.

If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.

Legend of Abbreviations:

AFF... Above the finished floor  
AGL... Above Ground Level  
AR... Accessible Route  
CIL... Change in Level  
CFS... Clear Floor Space  
EPC... Elevated Play Component  
GLPC... Ground Level Play Component

Sincerely,



Tanya Scheibe, RAS #1369

**TEXAS PARKS AND WILDLIFE DEPARTMENT  
McKINNEY FALLS STATE PARK**

**AMERICANS WITH DISABILITIES ACT COMPLIANCE INITIATIVE  
PROGRAM AND POLICY REPORT  
JULY 28, 2023**

## **INTRODUCTION**

The Texas Parks and Wildlife Department (TPWD) is subject to the many requirements of the Americans with Disabilities Act (ADA). To assist it in meeting those requirements, TPWD retained The WT Group, LLC (WTG) Accessibility Practice in 2021.

Title II of the ADA applies to TPWD sites, along with 89,000 other units of state and local government. WTG has a broad scope of work that matches the ADA requirements found in title II. It includes:

- Schedule and conduct project management meetings;
- Conduct access audits of 89 sites, including McKinney Falls State Park;
- Prepare a site report that describes deficits at McKinney Falls State Park, and suggests solutions to those deficits;
- Provide guidance regarding the programs or opportunities Texans can enjoy at McKinney Falls State Park;
- Conduct community engagement events to determine the access preferences and priorities of Texans who visit McKinney Falls State Park;
- Provide a McKinney Falls State Park Transition Plan that identifies deficits, notes solutions, identifies the officer responsible for barrier removal, and notes the phase or timing of barrier removal;
- Provide a GIS shapefile regarding the accessibility of McKinney Falls State Park;
- Provide a method of tracking barrier removal at McKinney Falls; and
- Report to TPWD leadership and stakeholders.

## **THIS REPORT**

This report addresses program and policy advice, and then the WTG observations of deficits at McKinney Falls State Park. Other deliverables are provided under separate cover.



### **What is a Program?**

A unit of state or local government is required to make the “programs” it offers accessible to people with and without disabilities. The term “program” is broadly defined as an opportunity made available by the state to the public, and the term public includes both people with and without disabilities. As an example, if a state park offers camping it must make certain that some campsites are of an accessible design.

The number to be made accessible is called scoping and it is usually a percentage or ratio of the similar sites. For example, if a state park has outdoor constructed features such as grills, fire pits, and benches, it must make 20% of an accessible design. Those 20% accessible must be dispersed throughout the park.

In an ADA context, “programs” at a state park or state natural area include but are not limited to:

Hiking	Fishing
Camping	Bird Watching
Swimming	Playgrounds
Lodging	Beaches
Boating	Interpretive activities
Parking	Visitor Centers
Trams	Picnicking
Sports fields	Viewing areas
Restrooms	Grilling

### **The Federal and Texas Accessibility Standards**

The current Texas Accessibility Standards (TAS 2012) became effective in 2012 after an amendment process. Those Standards are almost identical to the federal 2010 Standards for Accessible Design, and both effectively address parking, entries, restrooms, and other typical building elements. They also address playgrounds, boating and fishing areas, and sports fields and courts.

They do not however address some of the assets at McKinney Falls State Park. Trails, campsites, and picnic areas are not yet a final and enforceable state or federal standard.

That will change at the end of 2023 or early 2024. The Texas Department of Licensing and Regulation (TDLR) has signaled its intent to adopt the pending federal guidance for key outdoor assets integral to TPWD sites like McKinney Falls State Park. This includes trails, beaches, campsites, picnic areas, viewing areas, and constructed park assets like grills, fire pits, and benches.

In discussing the Standards, it is important to use the correct definition of park assets. Most definitions are found in TAS 2012 at section 106. As noted above, TDLR plans to add the pending federal guidance regarding some outdoor areas to TAS. It is important to remember that the Standards set the floor, not the ceiling. Making a slope more gentle, or a route wider, is always a smart practice with universal design benefits.

Some selected definitions of park assets common to TPWD are noted below.

- **Trail:** A pedestrian route developed primarily for outdoor recreational purposes. A pedestrian route developed primarily to connect elements, spaces, or facilities within a site is not a trail.
- **Trailhead:** An outdoor space that is designed by an entity responsible for administering or maintaining a trail to serve as an access point to the trail. The junction of two or more trails or the undeveloped junction of a trail and a road is not a trailhead.
- **Picnic Facility:** A site or portion of a site developed for outdoor recreational purposes that contains picnic units.
- **Picnic Unit:** An outdoor space in a picnic facility used for picnicking that contains outdoor constructed features.
- **Outdoor Constructed Features:** Picnic tables, fire rings, grills, fireplaces, wood stoves, trash and recycling receptacles, water hydrants, utility and sewage hookups, outdoor rinsing showers, benches, and viewing scopes provided at outdoor recreation facilities.
- **Camp Shelter:** A partially enclosed structure that provides campers and hikers cover from weather and that does not contain plumbing fixtures or kitchen appliances. Camp shelters are not transient lodging facilities or residential dwelling units.
- **Camping Facility:** A site or portion of a site developed for outdoor recreational purposes that contains camping units.
- **Camping Unit:** An outdoor space in a camping facility used for camping that contains outdoor constructed features, parking spaces for recreational vehicles, tent pads or tent platforms, or camp shelters.
- **Viewing Area:** An outdoor space developed for viewing landscapes, wildlife, or other points of interest.
- **Boarding Pier:** A portion of a pier where a boat is temporarily secured for the purpose of embarking or disembarking.
- **Boat Launch Ramp:** A sloped surface designed for launching and retrieving trailered boats and other watercraft to and from a body of water.
- **Gangway:** A variable-sloped pedestrian walkway that links a fixed structure or land with a floating structure. Gangways that connect to vessels are not addressed by these Standards.
- **Transition Plate:** A sloping pedestrian walking surface located at the end(s) of a gangway.
- **Play Area:** A portion of a site containing play components designed and constructed for children.
- **Play Component:** An element intended to generate specific opportunities for play, socialization, or learning. Play components are manufactured or natural; and are stand-alone or part of a composite play structure.

Two other key outdoor assets are not included in the definitions. Both are defined below.

- **Beach access routes:** A beach access route (BAR) connects an entry point to the beach to the water, as defined below:
  - At a tidal beach, to the high tide level
  - At a river beach, to the mean high water level
  - At a lake, pond, or reservoir beach, to the normal recreation water level

A BAR can be temporarily placed at a beach for all hours the beach is open, and need not be a permanent fixture.

- **Outdoor Recreation Access Routes (ORAR):** A route that connects outdoor recreation assets at an outdoor recreation site. An ORAR is not a trail.

### Conditions for Exceptions at Certain Outdoor Recreation Assets

In developing the scoping and technical requirements for accessibility at beaches, trails, and other outdoor developed areas, a wide net was cast to assure a variety of perspectives. The process involved:

- Officials from states with beaches and trails
- Officials from local entities with beaches and trails
- People with disabilities
- Landscape architects and civil engineers
- Parks and recreation officials

Throughout the process, all agreed that there are times that an existing beach, a new beach, an existing trail, or a new trail cannot meet the technical requirements for accessibility. The belief of regulatory bodies however is that these conditions should arise infrequently. The four conditions for exception are defined and discussed below.

- Section 1019.1.1: ***Compliance is not practicable due to terrain.***

This is best clarified as naturally occurring terrain. It is applicable to both existing trails, and new trails. When locating and designing new trails, making the trail accessible should be a very high priority. ***This is especially important at McKinney Falls State Park, as only one of the seven trails throughout the Park are accessible.***

- Section 1019.1.2: ***Compliance cannot be accomplished with the prevailing construction practices.***

This is best clarified as a reference to prohibitions on the use of foreign soil or motorized equipment. As an example, if a trail bed is being carved by TPWD staff and volunteers on their hands and knees, with pick axes, shovels, and hoes, all because of a prohibition on motorized equipment in the park, this exception may apply

- Section 1019.1.3: ***Compliance would fundamentally alter the function or purpose of the facility or the setting.***



This is best clarified as having a clear understanding of the purpose of the asset. A sharply ascending trail in a mountainous West Texas state park may have the intended use of endurance training. To “flatten” the trail is possible from a design perspective, but the trail then loses its function or purpose.

- Section 1019.1.4: ***Compliance is limited or precluded by any of the following laws, or by decisions or opinions issued or agreements executed pursuant to any of the following laws:***

Endangered Species Act (16 USC 1531 et seq.);

National Environmental Policy Act (42 USC 4321 et seq.);

National Historic Preservation Act (16 USC 470 et seq.);

Wilderness Act (16 USC 1131 et seq.); or

Other federal, State of Texas, or local laws the purpose of which is to preserve threatened or endangered species; the environment; or archeological, cultural, historical, or other significant natural features.

There are other mitigating factors regarding accessibility. Four are discussed below.

- Construction Tolerance (see 104.1.1 Construction and Manufacturing Tolerances): All dimensions are subject to conventional industry tolerances except where the requirement is stated as a range with specific minimum and maximum end points. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Equivalent Facilitation (see 103 Equivalent Facilitation): Nothing in these requirements prevents the use of designs, products, or technologies as alternatives to those prescribed, if they result in substantially equivalent or greater accessibility and usability. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Technical Infeasibility (see 106 Definitions): With respect to an alteration of a building or a facility, a condition wherein compliance with a requirement of this Standard has little likelihood of accomplishment because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements. This is likely most applicable to making transition plan retrofits.
- Safe Harbor (see US DOJ title II section 35.151(c)): If a public entity has constructed or altered required elements of a path of travel in accordance with the specifications in either the 1991 Standards or the Uniform Federal Accessibility Standards, or TAS 1994, before March 15, 2012, the public entity is not required to retrofit such elements to reflect incremental changes in the 2010 Standards solely because of an alteration to a primary function area served by that path of travel.

***It is important to note that the 1991 Standards and TAS 1994 did not address technical requirements for recreation assets, such as boating areas, fishing areas,***

*beaches, campsites, trails, picnic areas, playgrounds, sports fields, sports courts, and more. The Safe Harbor approach cannot be applied to such assets.*

## **Campsites**

We have sorted campsites into several categories. These include tent only campsites, recreational vehicle campsites, shelter sites, and sites that combine features in a hybrid approach, such as an RV site with utilities.

In evaluating McKinney Falls State Park, WTG used TAS 2012, the pending outdoor developed areas guidance, and smart practices that make public spaces and outdoor recreation assets more accessible to people with disabilities. We also applied the concepts of construction tolerance, technical infeasibility, safe harbor, equivalent facilitation, and other imitations on when a site must be made accessible.

## **What is Inclusion?**

The title II regulation requires McKinney Falls State Park programs to be available in the most integrated setting. This is defined as the setting in which people with and without disabilities interact together. Using the camping example above, inclusive camping would locate accessible campsites amidst inaccessible campsites to facilitate interaction between campers with and without disabilities.

While all programs must be inclusive, that does not mean that everyone with every type of disability or health condition must be allowed to participate in every program. The concept of essential eligibility allows McKinney Falls State Park to apply neutral conditions to determine who uses programs. Again, using camping, if there are 20 campsites and a person with a disability is the 21<sup>st</sup> person to register, the neutral concept of “capacity” applies and that camper has no place to camp. If that camper is the 20<sup>th</sup> person to seek camping but does not pay the campsite fee, the neutral concept of paying the same fees can apply and that camper will not camp at McKinney Falls.

## **How Can Programs in General Be Made Accessible?**

The title II regulation at section 35.150(b) lists a number of ways to make McKinney Falls State Park programs accessible. These include but are not limited to:

- Removing architectural barriers;
- Removing communication barriers;
- Changing rules and policies;
- Providing additional staff training;
- Providing different staff ratios;
- Providing adaptive equipment;
- Providing auxiliary aids and services such as a sign language interpreter;

- Providing accessible transportation when transportation is part of the opportunity;
- Reassignment of services to accessible locations;
- Conducting duplicate opportunities, one in accessible location and the other in an inaccessible location;
- Designing and constructing new facilities that are therefore fully compliant;
- Home visits; and
- Other methods that make programs accessible.

McKinney Falls staff should be aware of, and ready to, provide such modifications.

### **Are the McKinney Falls State Park Programs Accessible and Inclusive?**

In our review of the opportunities available at McKinney Falls, we saw:

- One playground at Day Use;
- Six cabins at the Cabin Area;
- 80 hybrid tent/RV campsites at Big Oak, Little Oak, Big Cedar/Moss Loop, and Grapevine Loop;
- One group campsite at Youth Group Camping Area;
- Seven trails throughout the Park; and
- Four picnic areas at Day Use.

### **Of these, the accessibility status and our recommendation is:**

- Make the playground at Day Use accessible;
- Maintain the accessible cabin at the Cabin Area and implement all site report retrofits, leaving the other five as is and inaccessible until later altered for another purpose; and
- Make four of the 80 hybrid tent/RV campsites at Big Oak, Little Oak, Big Cedar/Moss Loop, and Grapevine Loop accessible and disperse the accessible campsites throughout the Park;
- Leave the other 76 hybrid tent/RV campsites as is and inaccessible until later altered for another purpose;
- Make the one group campsite at Youth Group Camping Area accessible;
- Maintain the accessible trail and implement the site report retrofits;

- Make one more trail accessible, leaving the remaining five trails as is and inaccessible;
- Make one of the four picnic areas accessible, leaving the remaining three picnic areas as is and inaccessible until later altered.

### **Camping Clarification**

A number of campsites of each type provided within the park (see the Outdoor Developed Area Guidelines at 244.2, which will eventually be a part of the revisions to TAS 2012) must be retrofit to make the program of camping accessible, and to meet the soon-to-be-adopted State of Texas standard.



We have sorted campsites into two types: hybrid (usable by tent or RV), and group. TPWD or McKinney Falls staff can also distinguish these sites by amenities provided (covered tables, water only, electric, scenic views, etc.).


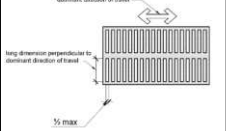

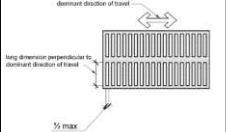

TPWD is prohibited from using contractors or concessionaires that discriminate on the basis of disability. If concessionaires are to provide outdoor recreation experiences at the Park, those must be accessible to and inclusive of people with disabilities.

### **Conclusion**



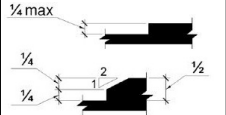


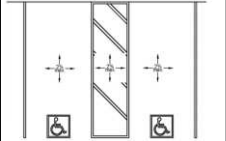

The staff at McKinney Falls State Park offer experiences and assets desired by park visitors. Those same experiences and assets must be accessible to and usable by people with disabilities. See the following site report to identify barriers and recommendations for barrier removal.

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
1	Exterior: Exterior Accessible Route	[30.1808657 , -97.722072 2]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1.5" gap near trail map at Headquarters (HQ)	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		
2	Exterior: Exterior Accessible Route	[30.1808226 , -97.722031 6]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" Change in Level (CIL) at entry to HQ by bench	Repair, bevel or ramp CIL along Accessible Route (AR)	2012 TAS Section: 303.2, 303.3  2010 ADAS Section: 303.2, 303.3		
3	Exterior: Exterior Accessible Route	[30.180881 , -97.722093 6], [30.1807449 , -97.721926 6]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	HQ building - 4.2% slope near fee station, 3.2% slope near entry, 3.8% slope near ice machine	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		


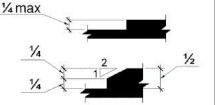

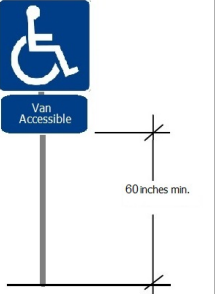

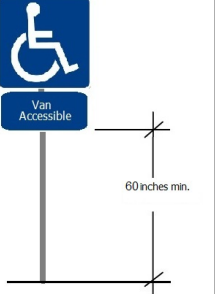
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
4	Exterior: Exterior Accessible Route	[30.1801164 , -97.72468 56], [30.1801959 , -97.724792 2]	The running slope of walking surfaces shall not be steeper than 1:20.	13.1% slope at bottom of path to Big Oak Restroom (RR) building (no showers), 11.2% slope half way up, 10.2% slope at top	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
5	Exterior: Exterior Accessible Route	[30.1801437 , -97.724718 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Big Oak RR Building (non shower) - 1" CIL at tree	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3  2010 ADAS Section: 303.2, 303.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
6	Exterior: Exterior Accessible Route	[30.1801042 , -97.724685 6]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Big oak RR building (non shower) - 1.5" gap at level landing to RR	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
7	Exterior: Exterior Accessible Route	[30.1786724 , -97.723832 6]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	To little oak RR building - 1.5" gap at top of path	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
8	Exterior: Exterior Accessible Route	[30.1786844 , -97.723886 3]	The running slope of walking surfaces shall not be steeper than 1:20.	To little oak RR - 5.4% slope in middle of path	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		

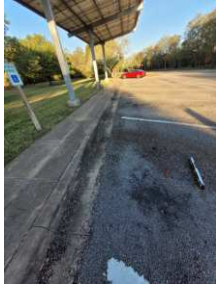

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

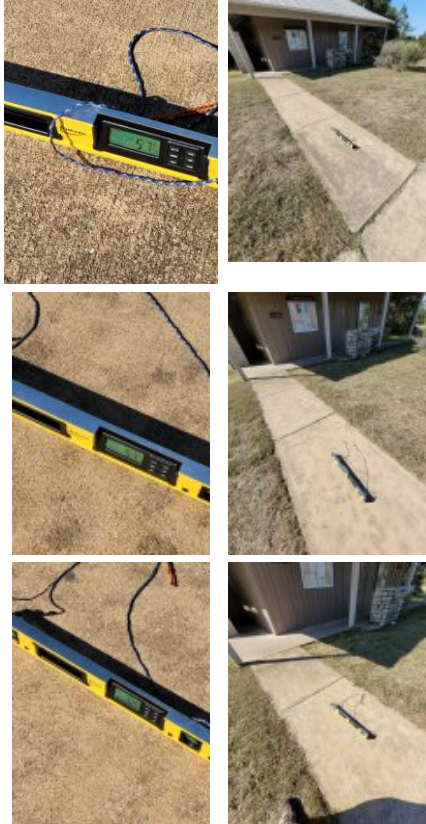
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
9	Exterior: Exterior Accessible Route	[30.1787073 , -97.72395 33], [30.1786827 , -97.723868 2]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Little oak RR building - 1" CIL at covered entry to RR, 1" CIL past tree on path	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3  2010 ADAS Section: 303.2, 303.3	 	
10	Exterior: Headquarters Parking	[30.1808985 , -97.722171]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	3.4% cross slope along parking space	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4	 	
11	Exterior: Headquarters Parking	[30.1808854 , -97.722154 2]	The access aisle is on the driver's side of the stall. Access aisles must be located on the passenger side of the stall for angled van accessible stalls.	Access aisle on wrong side	Relocate access aisle to the passenger side of the stall	2015 ABAAS Section: 502.3.4  2012 TAS Section: 502.3.4  2010 ADAS Section: 502.3.4		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
12	Exterior: Headquarters Parking	[30.1808608 , -97.7221804]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Ramp projects into aisle	Remove built up curb ramp from access aisle	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
13	Exterior: Headquarters Parking	[30.1808764 , -97.7222258]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	48 inch to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AFF	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
14	Exterior: Headquarters Parking	[30.1808787 , -97.7222375]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Parking stall lacks van accessible sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		


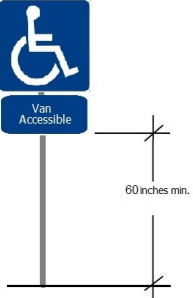

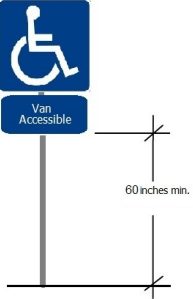

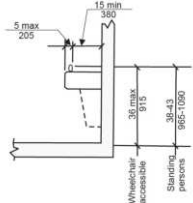
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
15	Exterior: Headquarters Parking	[30.1808898, -97.7222059]	The accessible route is constructed such that a park vehicle can obstruct the minimum 36 inch width. Parking spaces and access aisles shall be designed so that cars and vans, when parked, cannot obstruct the required clear width of adjacent accessible routes.	Stall lacks wheel stops or sign	Mount signage to prohibit cars from parking and obstructing accessible route	2015 ABAAS Section: 502.7 2012 TAS Section: 502.7 2010 ADAS Section: 502.7		
16	Exterior: Headquarters Parking	[30.18076, -97.722]	Element meets all standards and requirements	HQ parking meets scoping requirements - 11 standard, 1 accessible	None	2010 ADAS Section: N/A		
17	Exterior: Cabin Area Restroom Parking	[30.17823, -97.72888]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Firewood vending lacks AR, lacks CFS, card swipe and screen high	Provide an accessible route to each element within the site. Provide Clear Ground Surface (CGS) at operating mechanisms Lower operating mechanisms along the route to 48' Above Ground Level (AGL) max.	2010 ADAS Section: 206.2.2, 206.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
18	Exterior: Cabin Area Restroom Parking	[30.178333, -97.728913 7], [30.178378, -97.728875 5]	The running slope of walking surfaces shall not be steeper than 1:20.	5.7% slope and 5.8% slope along route near RR	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
19	Exterior: Cabin Area Restroom Parking	[30.1783289 , -97.72891 57], [30.1783879 , -97.728872 8]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Two 1 inch gaps on route near RR	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
20	Exterior: Cabin Area Restroom Parking	[30.1782567 , -97.728859 4]	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	Loose gravel on route at access aisle	Maintain accessible route surfaces to be free of loose materials.	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		
21	Exterior: Cabin Area Restroom Parking	[30.1782696 , -97.728840 3]	The accessible parking stall signage is incorrect and/or missing from each accessible parking space. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Parking sign is missing	Acquire and mount at appropriate heights and locations accessible parking signs where missing	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6		


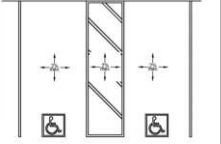

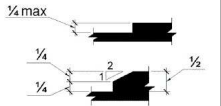

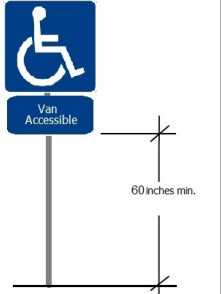
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


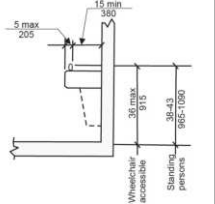

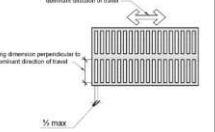

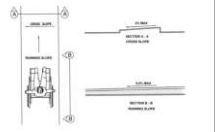

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
22	Exterior: Cabin Area Restroom Parking	[30.1782673 , -97.728842 3]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Lacks signage - unable to measure height	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL. Cost included in previous finding	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
23	Exterior: Cabin Area Restroom Parking	[30.1782723 , -97.728839]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Van signage missing	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'.	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
24	Exterior: Cabin Area Restroom Parking	[30.18076, -97.722]	Element meets all standards and requirements	Cabin Area restroom parking meets scoping requirements - 7 standard, 1 accessible	None	2010 ADAS Section: N/A		
25	Exterior: Big Cedar Camping Area Restroom Parking	[30.17531, -97.72687]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	Inaccessible drinking fountain	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2 2012 TAS Section: 211.2 2010 ADAS Section: 211.2		

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
26	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753164 , -97.726888 8]	The running slope of walking surfaces shall not be steeper than 1:20.	7.8% slope along route to RR	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
27	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753198 , -97.726889 4]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Up to 3" gap on route to RR	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
28	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753657 , -97.726898 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	CIL at route to parking	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		
29	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753687 , -97.726874 9]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 4 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Lacks van stall	Add van parking sign to one accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' per the table	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		


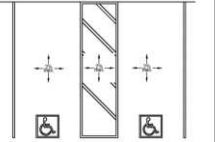

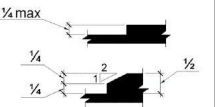

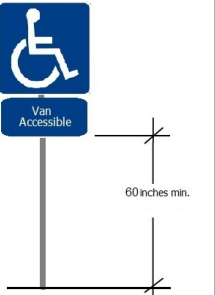
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
30	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753821, -97.7268736]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.9% slope at stall, 4.1% slope at aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
31	Exterior: Big Cedar Camping Area Restroom Parking	[30.1753831, -97.7268756]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Surface becomes loose from binder layer at parking space	Resurface accessible stalls and access aisles with a firm, stable, and slip resistant material	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
32	Exterior: Big Cedar Camping Area Restroom Parking	[30.175343, -97.7268897]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	52.5" AGL to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
33	Exterior: Big Cedar Camping Area Restroom Parking	[30.18076, -97.722]	Element meets all standards and requirements	Big Cedar Restroom parking meets scoping requirements - 3 standard, 1 accessible	None	2010 ADAS Section: N/A		


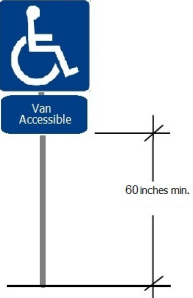



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
34	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1770677 , -97.726223 3]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	Drinking fountain is inaccessible	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2  2012 TAS Section: 211.2  2010 ADAS Section: 211.2		
35	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1771067 , -97.726214 3]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" gap at route near firewood vending	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		
36	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772013 , -97.726152]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	10.1% slope at parking	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
37	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772026 , -97.726153 2]	The running slope of walking surfaces shall not be steeper than 1:20.	7.4% slope at parking	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		



**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


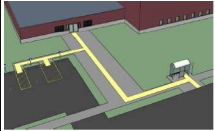


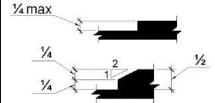

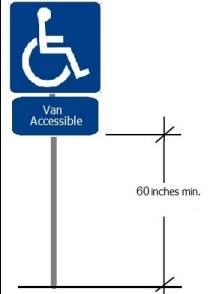
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
38	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772385 , -97.726154 5]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	5.8% slope at stall, 5.6% slope at aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		
39	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772444 , -97.726144 7]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Surface becomes loose from binder in stall	Resurface accessible stalls and access aisles with a firm, stable, and slip resistant material	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		
40	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772153 , -97.726127 3]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	About 47" AGL to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6  2012 TAS Section: 502.6  2010 ADAS Section: 502.6		



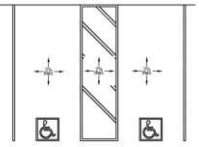
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


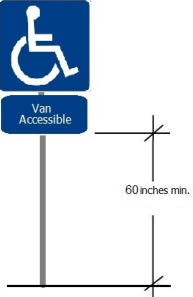

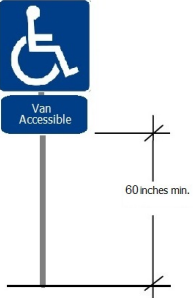
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
41	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.1772111, -97.7261306]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Van stall lacks van sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
42	Exterior: Grapevine Loop Camping Area Restroom Parking	[30.18076, -97.722]	Element meets all standards and requirements	Grapevine Loop Restroom parking meets scoping requirements - 5 standard, 1 accessible	None	2010 ADAS Section: N/A		
43	Exterior: Little Oak Camping Area Restroom Parking	[30.1786346, -97.7238735]	Element meets all standards and requirements	Parking scoping complies- 4 standard parking spaces, 1 accessible parking space	None	2010 ADAS Section: N/A		
44	Exterior: Little Oak Camping Area Restroom Parking	[30.178644, -97.7238702]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of (4) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	No van space, stall and aisle lack minimum dimensions	Add van parking sign to 1 accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8'.	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
45	Exterior: Little Oak Camping Area Restroom Parking	[30.1786378 , -97.723872 2]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Stall slope: - 4.4%, 3.5%, access aisle - 6.8% slope	Repair or correct slope of parking space and access aisle to max 2.08% in any direction.	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
46	Exterior: Little Oak Camping Area Restroom Parking	[30.1786368 , -97.723865 5]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Stall and access aisle full of loose gravel and tree debris	Resurface accessible stalls and access aisles with a firm, stable, and slip resistant material	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		



**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
47	Exterior: Little Oak Camping Area Restroom Parking	[30.178632, -97.723876 2]	The access aisle is not located on an accessible route of travel to the accessible building entrance. Accessible parking spaces serving a particular building shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. In buildings with multiple accessible entrances with adjacent parking, accessible parking spaces shall be dispersed and located closest to the accessible entrances.	Access Aisle (AA) on other side of path to RR	Reconfigure accessible stalls to avoid requiring pedestrians to cross vehicular way, in the alternative, leave as is with striped crosswalk	2015 ABAAS Section: F208.3.1 2012 TAS Section: 208.3.1 2010 ADAS Section: 208.3.1		
48	Exterior: Big Oak Camping Area Restroom Parking	[30.1802174, -97.724811 9]	Element meets all standards and requirements	parking scoping complies- 2 standard parking spaces, 1 accessible parking spaces	None	2010 ADAS Section: N/A		
49	Exterior: Big Oak Camping Area Restroom Parking	[30.1802198, -97.724816 5]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Loose gravel within stall and lot	Resurface accessible stalls and access aisles with a firm, stable, and slip resistant material	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
50	Exterior: Big Oak Camping Area Restroom Parking	[30.1802151, -97.724822 7]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	No signage for van, sizing is 11 and 5	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		


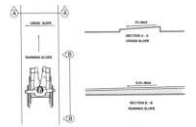

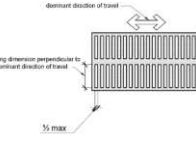

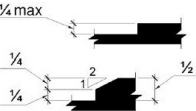
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
51	Exterior: Group Dining Hall Parking	[30.1800307 , -97.728657 2]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (65) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (3) accessible stalls with a minimum of (1) being designed as van accessible.	65 standard spaces, 2 accessible spaces	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		
52	Exterior: Group Dining Hall Parking	[30.1800006 , -97.728654 7]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.9% slope in two locations at Dining Hall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
53	Exterior: Group Dining Hall Parking	[30.1800018 , -97.728706]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	50 inch to bottom of sign at Dining Hall, 52.5 inch to bottom of sign at Amphitheater Restroom	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
54	Exterior: Group Dining Hall Parking	[30.1799989 , -97.728668]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Stall at Dining Hall lacks van sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		






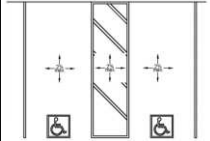
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
55	Exterior: Smith Visitor Center Parking	[30.184013, -97.7246178]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	2.3% slope in parking space and 2.2% slope in access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
56	Exterior: Smith Visitor Center Parking	[30.1840472, -97.7246413]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	59.5 inch to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		


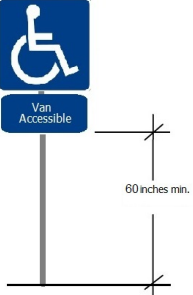

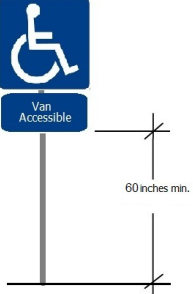
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
57	Exterior: Smith Visitor Center Parking	[30.1835902 , -97.724795 1]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Loose gravel and dirt at electric charging station, lacks CGS, loose fines at sign	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		
58	Exterior: Smith Visitor Center Parking	[30.1832762 , -97.724812 6]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Lacks accessible route to Chimney Swift Tower	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
59	Exterior: Smith Visitor Center Parking	[30.1838861, -97.7248126], [30.183932, -97.7247469]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	Cross slopes: 2.7% and 5.6% along route at Visitor Center	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
60	Exterior: Smith Visitor Center Parking	[30.183923, -97.7248427]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1 inch gap along route	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
61	Exterior: Smith Visitor Center Parking	[30.1840541, -97.7246174]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1 inch gap at access aisle to walk	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		



**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

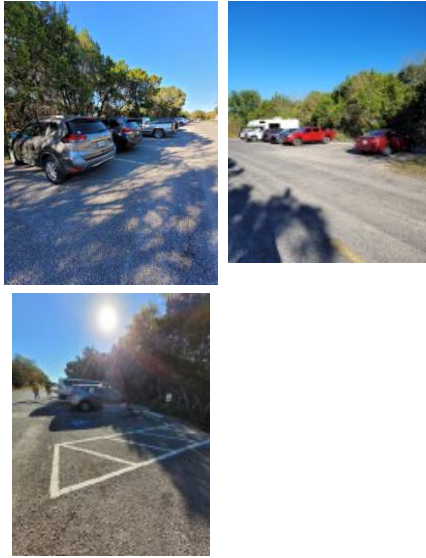



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
62	Exterior: Upper Falls Parking	[30.1837929 , -97.725784 6]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (75) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (3) accessible stalls with a minimum of (1) being designed as van accessible.	1 accessible space, 75 standard spaces	Create two or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		
63	Exterior: Upper Falls Parking	[30.1837529 , -97.725783 9]	The vehicle route to the accessible parking contains vertical clearances less than 98 inches. A minimum vertical clearance of 98 inches must be provided at accessible parking spaces and along at least one vehicle access route to such spaces from site entrances and exits.	77 inches to branch	Raise obstructions over van stalls to provide 98" vertical clearance	2015 ABAAS Section: 502.5  2012 TAS Section: 502.5  2010 ADAS Section: 502.5		
64	Exterior: Upper Falls Parking	[30.1837645 , -97.725785 3]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	3% slope in parking stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		


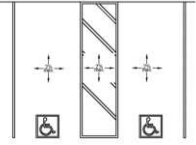

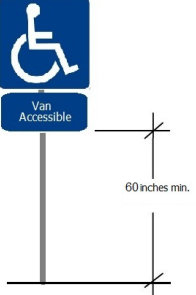
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
65	Exterior: Upper Falls Parking	[30.183737, -97.725787 3]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	52 inch to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
66	Exterior: Upper Falls Parking	[30.1837365, -97.725785 9]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Stall lacks van sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		


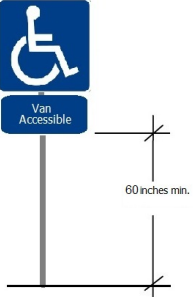
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
67	Exterior: Upper Falls Restroom Parking	[30.183512, -97.727384 2], [30.1833095, -97.727390 9]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1.5" gap, 2" gap, 1.25" gap, and 1" gap along route to Restroom (RR) parking	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		
68	Exterior: Upper Falls Restroom Parking	[30.1833066, -97.727315 5]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	5.9% slope right stall where flared	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		
69	Exterior: Upper Falls Restroom Parking	[30.18076, -97.722]	Element meets all standards and requirements	Upper Falls Restroom parking meets scoping requirements - 26 standard, 2 accessible	None	2010 ADAS Section: N/A		

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure																																				
70	Exterior: Picnic Trail Trailhead Parking	[30.1836988, -97.7227049]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (20) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	20 standard, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		<table border="1"> <thead> <tr> <th>Total Number of Parking Spaces</th> <th>Minimum Number of Accessible Parking Spaces</th> </tr> </thead> <tbody> <tr><td>10</td><td>1</td></tr> <tr><td>11-20</td><td>2</td></tr> <tr><td>21-30</td><td>3</td></tr> <tr><td>31-40</td><td>4</td></tr> <tr><td>41-50</td><td>5</td></tr> <tr><td>51-60</td><td>6</td></tr> <tr><td>61-70</td><td>7</td></tr> <tr><td>71-80</td><td>8</td></tr> <tr><td>81-90</td><td>9</td></tr> <tr><td>91-100</td><td>10</td></tr> <tr><td>101-150</td><td>15</td></tr> <tr><td>151-200</td><td>20</td></tr> <tr><td>201-250</td><td>25</td></tr> <tr><td>251-300</td><td>30</td></tr> <tr><td>301-400</td><td>40</td></tr> <tr><td>401-500</td><td>50</td></tr> <tr><td>500 and over</td><td>5% (plus 1 for each 100 or fraction thereof over 500)</td></tr> </tbody> </table>	Total Number of Parking Spaces	Minimum Number of Accessible Parking Spaces	10	1	11-20	2	21-30	3	31-40	4	41-50	5	51-60	6	61-70	7	71-80	8	81-90	9	91-100	10	101-150	15	151-200	20	201-250	25	251-300	30	301-400	40	401-500	50	500 and over	5% (plus 1 for each 100 or fraction thereof over 500)
Total Number of Parking Spaces	Minimum Number of Accessible Parking Spaces																																											
10	1																																											
11-20	2																																											
21-30	3																																											
31-40	4																																											
41-50	5																																											
51-60	6																																											
61-70	7																																											
71-80	8																																											
81-90	9																																											
91-100	10																																											
101-150	15																																											
151-200	20																																											
201-250	25																																											
251-300	30																																											
301-400	40																																											
401-500	50																																											
500 and over	5% (plus 1 for each 100 or fraction thereof over 500)																																											
71	Exterior: Picnic Trail Trailhead Parking	[30.183674, -97.7232419]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	33 benches and grilles not on accessible route, water spout, trash can and bench not on accessible route	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2																																						


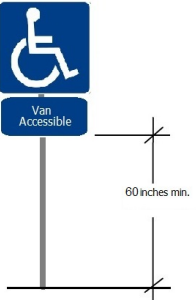

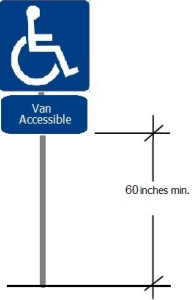

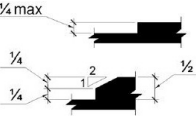
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
72	Exterior: Homestead Trail Trailhead Parking	[30.1859624 , -97.721538 7]	There are not enough accessible stalls There are 39 accessible parking stalls including 1 designated for a van. There should be a minimum of 2 accessible parking stalls including a minimum of 1 van accessible stalls.	Parking area closest to trailhead: parking lacks required number of accessible parking spaces - 1 accessible space, 39 standard spaces	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		
73	Exterior: Homestead Trail Trailhead Parking	[30.1859627 , -97.721558 8]	The vehicle route to the accessible parking contains vertical clearances less than 98 inches. A minimum vertical clearance of 98 inches must be provided at accessible parking spaces and along at least one vehicle access route to such spaces from site entrances and exits.	Branches at 70 inches at parking space	Raise obstructions over van stalls to provide 98" vertical clearance	2015 ABAAS Section: 502.5  2012 TAS Section: 502.5  2010 ADAS Section: 502.5		


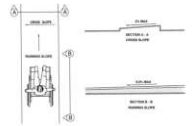

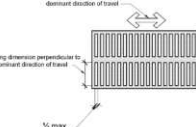
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
74	Exterior: Homestead Trail Trailhead Parking	[30.1859672 , -97.721530 6]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Slopes: 2.3% at access aisle and 3.1% stall	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		
75	Exterior: Homestead Trail Trailhead Parking	[30.1859671 , -97.721567 5]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	36 inches to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6  2012 TAS Section: 502.6  2010 ADAS Section: 502.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
76	Exterior: Homestead Trail Trailhead Parking	[30.185966, -97.721567 5]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Stall lacks van sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6  2012 TAS Section: 502.6  2010 ADAS Section: 502.6		


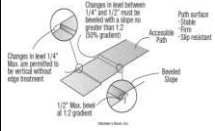


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
77	Exterior: Picnic Area Parking	[30.1828281 , -97.723291 5]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Slope of 2.2% at head and 3.8% at foot of stall, slope of 4.6% at middle of AA	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		
78	Exterior: Picnic Area Parking	[30.1828318 , -97.723292 8]	The parking stall contains abrupt edges and surface irregularities over a 1/4 inch vertical. Parking spaces and access aisles serving them shall be stable, firm, and slip resistant. Access aisles shall be at the same level as the parking spaces they serve. Changes in level are not permitted and shall not be sloped steeper than 2% in any direction.	Lacks firm, stable, and slip resistant surface (loose rock on course concrete)	Resurface accessible stalls and access aisles with a firm, stable, and slip resistant material	2015 ABAAS Section: 502.4  2012 TAS Section: 502.4  2010 ADAS Section: 502.4		


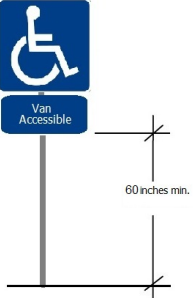

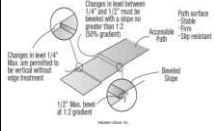
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
79	Exterior: Picnic Area Parking	[30.1828478 , -97.7233203]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	Bottom edge of lowest parking sign is 43" AGL	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
80	Exterior: Picnic Area Parking	[30.1828486 , -97.7233237]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Stall lacks van accessible sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
81	Exterior: Picnic Area Parking	[30.1829428 , -97.7233078]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	2" CIL toward women's and men's restroom	Repair, bevel or ramp CIL along AR.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		


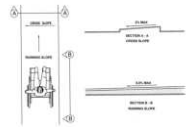
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
82	Exterior: Picnic Area Parking	[30.1829289 , -97.7233017]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	2.7% slope along route toward men's restroom	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
83	Exterior: Picnic Area Parking	[30.1828764 , -97.7233199], [30.1829002 , -97.7233058]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Two 1.25 inch gaps along route toward women's and men's restroom, 2 inch toward men's restroom	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		



**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
84	Exterior: Picnic Area Parking	[30.1828723 , -97.7233044]	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	Loose gravel on route	Resurface AR where deterioration occurs	2015 ABAAS Section: 302.1  2012 TAS Section: 302.1  2010 ADAS Section: 302.1		
85	Exterior: Picnic Area Parking	[30.18076, -97.722]	Element meets all standards and requirements	Parking near playground picnic area restroom meets scoping requirements - 14 standard, 1 accessible	None	2010 ADAS Section: N/A		

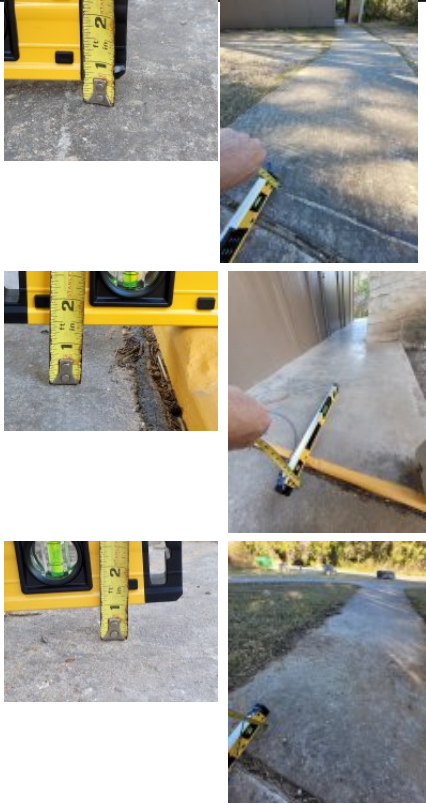
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
86	Exterior: Lower Falls Restroom Parking	[30.1847455, -97.7221851]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Slopes: 3.2% in stall and 3% in aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
87	Exterior: Lower Falls Restroom Parking	[30.18476, -97.7222119]	The parking sign is mounted too low. Parking space identification signs shall include the International Symbol of Accessibility complying with. Signs identifying van parking spaces shall contain the designation "van accessible." Signs shall be 60 inches minimum above the finish floor or ground surface measured to the bottom of the sign.	49" to bottom of sign	Raise existing accessible parking signs so lowest end of bottom sign is min 60" AGL	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
88	Exterior: Lower Falls Restroom Parking	[30.1859681, -97.7215655]	The van stall is missing a sign identifying it as a van accessible stall. Parking space identification signs shall include the International Symbol of Accessibility. Signs identifying van parking spaces shall contain the designation "van accessible."	Stall lacks van sign	Add one van parking sign to van accessible stall and ensure stall and access aisle are 11' and 5' or 8' and 8'	2015 ABAAS Section: 502.6 2012 TAS Section: 502.6 2010 ADAS Section: 502.6		
89	Exterior: Lower Falls Restroom Parking	[30.1848172, -97.7222068], [30.1851008, -97.7221733]	The accessible route contains loose gravel and/or surfaces that do not provide for a stable, firm slip resistant surface.	Loose gravel on accessible route from parking to restroom, sand on route,	Resurface AR where deterioration occurs	2015 ABAAS Section: 302.1 2012 TAS Section: 302.1 2010 ADAS Section: 302.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
90	Exterior: Lower Falls Restroom Parking	[30.1848516, -97.7221887], [30.1851082, -97.7221914]	The accessible route of travel contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	Cross slope along route: 4.1% at large rocks and green dumpster and 3% at restrooms.	Correct or repair cross slope along AR to max 2.08%.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								
91	Exterior: Lower Falls Restroom Parking	[30.1850058, -97.7221331], [30.1851025, -97.7221941]	Changes in level greater than ½ inch (13 mm) high shall be ramped, and shall comply with 405 or 406.	Changes in Level: two at .75", two at .5", 1.5", and 1"	Repair, bevel, or ramp CIL along AR	2015 ABAAS Section: 303.4 2012 TAS Section: 303.4 2010 ADAS Section: 303.4		



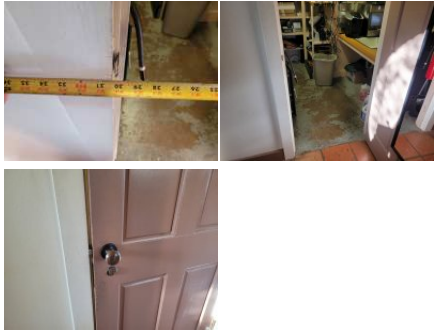
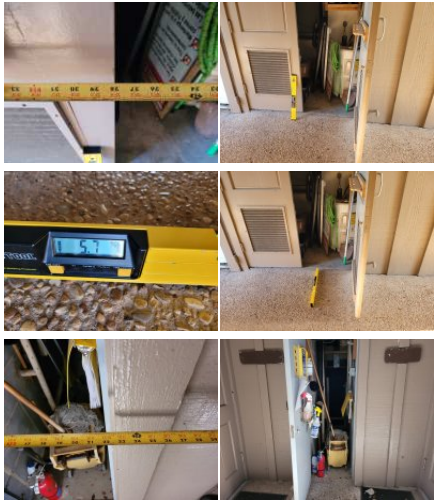
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								


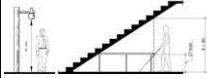


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
92	Exterior: Lower Falls Restroom Parking	[30.1849888, -97.7221475], [30.1851101, -97.7222038]	The running slope of walking surfaces shall not be steeper than 1:20.	Running slope along route: 6.4% and 7.5% at curve path intersection, and 5.6% approaching restrooms	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
93	Exterior: Lower Falls Restroom Parking	[30.18076, -97.722]	Element meets all standards and requirements	Lower Falls Restroom parking meets scoping requirements - 16 standard, 1 accessible	None	2010 ADAS Section: N/A		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
94	Headquarters: Headquarters Building	[30.1807882 , -97.722177 2]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Dog bag dispenser lacks AR at HQ	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		
95	Headquarters: Headquarters Building	[30.1808374 , -97.722151 1]	Element meets all standards and requirements	Trail map complies	None	2010 ADAS Section: N/A		
96	Headquarters: Headquarters Building	[30.18079, -97.722023 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. and floor and ground surfaces shall comply with 402.4.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground.	HQ entry - 2.6% slope, glass starts at 9" AFF	For all doors along the public circulation route, provide required maneuvering clearance and floor and ground slope on push and pull side of doors For all doors along the public circulation route, provide kick plate on push side of door from floor to 10" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
97	Headquarters: Headquarters Building	[30.1808113 , -97.7220263]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. and floor and ground slope per 402.4.4. Maneuvering clearances and floor and ground slope shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground.	Back entry- 12#, closes fast, glass starts at 9", 3.1%, counter, 10.25" push side	For all doors along the public circulation route, provide required maneuvering clearance and floor and ground slope on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, provide kick plate on push side of door from floor to 10" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
98	Headquarters: Headquarters Building	[30.1807813 , -97.7220134]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	22.5" to enter, office doors (2) have knobs and lack pull side clearance	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. For all doors along the public circulation route, replace hardware with lever hardware where indicated Remove existing service shelf Lower 36" wide segment of service counter to max 36" AFF	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		


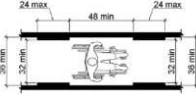

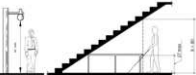

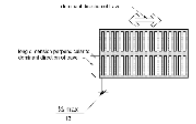
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
99	Headquarters: Headquarters Building	[30.18076, -97.722]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T-shaped space.	37" wide route	Relocate obstacles to create turning space in employee space	2015 ABAAS Section: 304.3.1, 304.3.2  2012 TAS Section: 304.3.1, 304.3.2  2010 ADAS Section: 304.3.1, 304.3.2		
100	Headquarters: Headquarters Building	[30.18076, -97.722]	The shelves are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Shelves high	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		


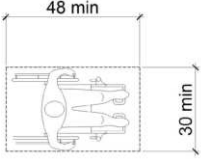



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
101	Headquarters: Headquarters Building	[30.1807911, -97.7219994]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Break room/storage- 29.5" wide, knob	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
102	Headquarters: Headquarters Building	[30.1807944, -97.7220134]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Mechanical- 28" wide, 5.7% slope, equipment push side; pipe chase- 22" wide, storage push side	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. Correct or repair floor slope at door CFS to max 2.08% For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, replace hardware with lever hardware where indicated	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		


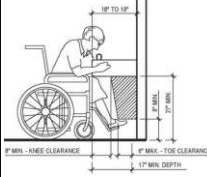


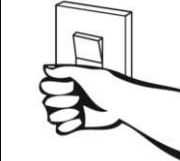
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
103	Headquarters: Headquarters Building	[30.1808319 , -97.7220335]	The pay station projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Self pay station near entry shelf protrudes 12"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
104	Headquarters: Headquarters Building	[30.1807437 , -97.7221225], [30.1808011 , -97.7220552]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Picnic table and bike rack lack accessible route	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		
105	Headquarters: Headquarters Building	[30.1808789 , -97.7221034]	Element meets all standards and requirements	Trash can located on accessible route	None	2010 ADAS Section: N/A		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
106	Headquarters: Headquarters Building	[30.1808321 , -97.721913 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Over 6" curb and steps prevent access	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		
107	Headquarters: Headquarters Building	[30.1808346 , -97.721911 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	29" wide door	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		

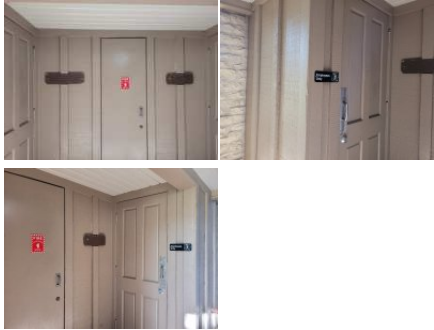
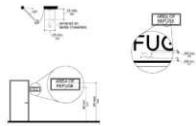

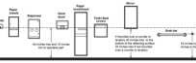



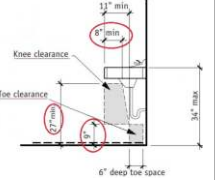

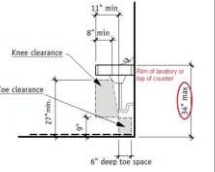
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
108	Headquarters: Headquarters Building	[30.1807961 , -97.722021 5]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	Racks reduce width to 32"	Relocate merchandise to widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1  2012 TAS Section: 403.5.1  2010 ADAS Section: 403.5.1		
109	Headquarters: Headquarters Building	[30.1807862 , -97.722012 1]	The rack projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Two racks project 12"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
110	Headquarters: Headquarters Building	[30.1807993 , -97.722016 1]	Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch (13 mm) diameter except as allowed in 407.4.3, 409.4.3, 410.4, 810.5.3 and 810.10. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	1" to 1.5" gaps	Fill and maintain gaps to max .5"	2015 ABAAS Section: 302.3  2012 TAS Section: 302.3  2010 ADAS Section: 302.3		


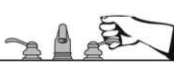
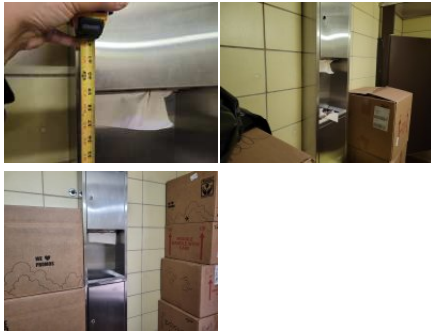
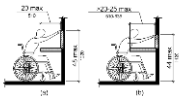
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
111	Headquarters: Headquarters Building	[30.1807928 , -97.7220215]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Counter lacks clear floor space for a forward approach	Provide required 30" by 48" CFS at operable parts. Cost to relocate service counter included in separate finding	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		
112	Headquarters: Headquarters Building	[30.1807862 , -97.7220134]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	49.5" high counter lacks knee space	Provide tables and work surfaces at 28" to 34" AFF with required knee and toe clearances. Cost included in separate finding	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		
113	Headquarters: Headquarters Building	[30.1808033 , -97.7219936]	Element meets all standards and requirements	Ice machine complies	None	2010 ADAS Section: N/A		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
114	Headquarters: Headquarters Building	[30.1807665, -97.7220097]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	Drinking fountain does not have knee clearance	Replace drinking fountain with a hi-lo bowl fountain	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2		
115	Headquarters: Headquarters Building	[30.1807656, -97.721999]	Element meets all standards and requirements	Compliant recycling bins have maneuvering clearance	None	2010 ADAS Section: N/A		
116	Headquarters: Headquarters Building	[30.1808074, -97.7220478]	The lid is not accessible because it requires tight grasping, pinching or twisting of the wrist.	Envelope depository lid requires tight pinch	Replace lid with an operable part usable without a tight pinch or grasp	2015 ABAAS Section: 309.4 2012 TAS Section: 309.4 2010 ADAS Section: 309.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
117	Headquarters: Headquarters Staff Restrooms	[30.18052, -97.72205]	<p>Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.</p>	Left- 11#, closes fast, 27" wide, wall push side, storage push side	<p>For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice</p>	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


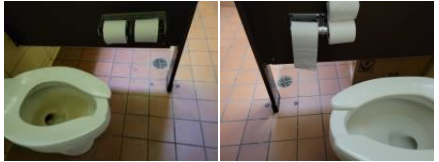
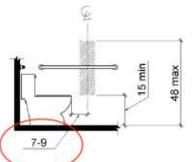

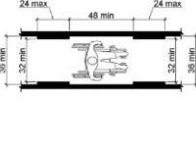
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
118	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
119	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	41" to bottom of mirror	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		


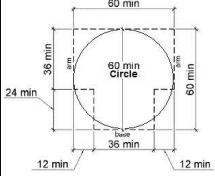

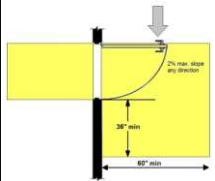
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
120	Headquarters: Headquarters Staff Restrooms	[30.1807715 , -97.722]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	One has storage under sink	Remove storage to provide 8" deep knee clearance	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4 , 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		
121	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Top of rim, 1 at 35", 1 at 34.5"	Lower sinks to max 34" AFF to front of rim	2015 ABAAS Section: 606.3  2012 TAS Section: 606.3  2010 ADAS Section: 606.3		


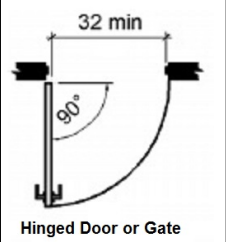

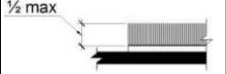
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
122	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The faucet controls require twisting of the wrist. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever-operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	One sink has knobs	Replace faucet controls with lever controls	2015 ABAAS Section: 606.4  2012 TAS Section: 606.4  2010 ADAS Section: 606.4		
123	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59" AFF	Lower operating mechanisms in restroom to max 48" AFF to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		

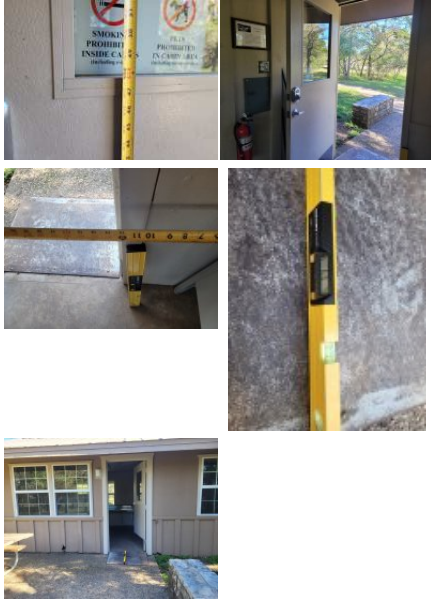

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
124	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
125	Headquarters: Headquarters Staff Restrooms	[30.1807731 , -97.722005 4]	The stall door must have compliant hardware on both sides. The stall door must be self-closing.	Stall door lacks exterior hardware, not self closing	Adjust stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
126	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The door to the ambulatory compartment swings into the minimum required compartment area. Toilet compartment doors shall not swing into the minimum required compartment area.	Stall door door swings in	Replace stall door of ambulatory stall with one that swings out and is self-closing. Cost included in previous finding.	2015 ABAAS Section: 604.8.2.2  2012 TAS Section: 604.8.2.2  2010 ADAS Section: 604.8.2.2		


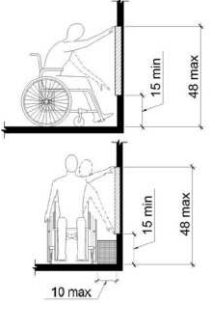


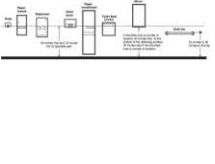

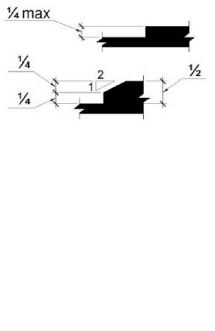


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
127	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" grab bars	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
128	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet paper too close	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
129	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	Route reduces with storage	Remove storage to widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1  2012 TAS Section: 403.5.1  2010 ADAS Section: 403.5.1		




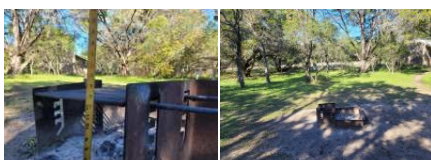
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
130	Headquarters: Headquarters Staff Restrooms	[30.18076, -97.722]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T-shaped space.	Storage prevents turning	Relocate obstacles to create turning space in RR	2015 ABAAS Section: 304.3.1, 304.3.2  2012 TAS Section: 304.3.1, 304.3.2  2010 ADAS Section: 304.3.1, 304.3.2		
131	Headquarters: Headquarters Staff Restrooms	[30.1807707 , -97.721989 7]	The landing at the door does not have a compliant landing. Doors with an approach from the hinge side must have a landing on the pull side that is a minimum of 60 inches in depth perpendicular to the door in a close position by a minimum width dimension of 36 inches plus the door width. The additional 36 inches must extend past the door on the latch side. The entire landing must be free of obstructions and must be flat (2% max. slope is considered flat in any direction).	Right restroom- 3.7% slope at exterior side of door	Correct or repair landing slope at maneuvering clearance on pull side of door to max 2.08%	2015 ABAAS Section: 404.2.4.1  2012 TAS Section: 404.2.4.1  2010 ADAS Section: 404.2.4.1		


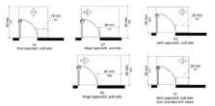

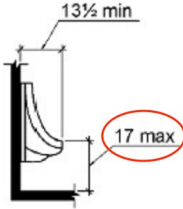

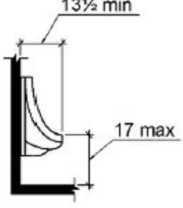
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
132	Headquarters: Headquarters Staff Restrooms	[30.180774, -97.722001 7]	The door opening does not provide at least 32 inches between the face of the door and the opposite stop. Door openings shall provide a clear width of 32 inches minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. There shall be no projections into the required clear opening width lower than 34 inches above the finish floor or ground. Projections into the clear opening width between 34 inches and 80 inches above the finish floor or ground shall not exceed 4 inches.	Right restroom- 28" wide door	Replace door with one having 32" clear width	2015 ABAAS Section: 404.2.3  2012 TAS Section: 404.2.3  2010 ADAS Section: 404.2.3		 <p>Hinged Door or Gate</p>
133	Headquarters: Headquarters Staff Restrooms	[30.1807641 , -97.721997 7]	Mats shall be securely attached and shall have a firm cushion, pad, or backing or no cushion or pad. Carpet or carpet tile shall have a level loop, textured loop, level cut pile, or level cut/uncut pile texture. Pile height shall be 1/2 inch maximum. Exposed edges of carpet shall be fastened to floor surfaces and shall have trim on the entire length of the exposed edge.	Right restroom- mat loose	Secure mat to prevent tripping hazard	2015 ABAAS Section: 302.2  2012 TAS Section: 302.2  2010 ADAS Section: 302.2		 <p>1/2 max</p>



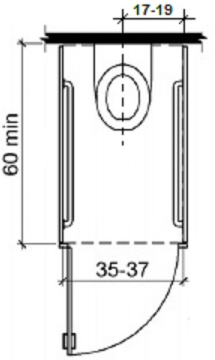

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
134	Cabin Area: Cabin Area - Cabin 6	[30.1787447 , -97.728670 8]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Floor and ground surface slopes shall comply with 402.4.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.	Cabin entry- 6.5% slope, window 47.5", desk pull side	For all doors along the public circulation route, provide required maneuvering clearance and floor and ground slope on push and pull side of doors For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
135	Cabin Area: Cabin Area - Cabin 6	[30.1787474 , -97.728662 6]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Table and recycle can at hooks CFS	Remove, or relocate storage in CFS at fixtures and operable parts along the AR	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
136	Cabin Area: Cabin Area - Cabin 6	[30.1787486 , -97.728670 7]	The A/C and hooks are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	A/C high, hooks high	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		
137	Cabin Area: Cabin Area - Cabin 6	[30.178758, -97.728665 5]	Element meets all standards and requirements	Beds comply	None	2010 ADAS Section: N/A		
138	Cabin Area: Cabin Area - Cabin 6	[30.1787567 , -97.728671 3]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror in bedroom 37.5", lacks CFS due to bed	Lower mirror not over a sink or counter to max 35" AFF to the reflective surface. Relocate mirror to provide 30" x 48' CFS at mirror	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
139	Cabin Area: Cabin Area - Cabin 6	[30.1786095 , -97.72888 13], [30.1786999 , -97.728714 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Route has two .75" CILs between cabin and parking area	Repair, bevel or ramp change in level along accessible route.	2012 TAAS Section: 303.2, 303.3  2010 ADAS Section: 303.2, 303.3		




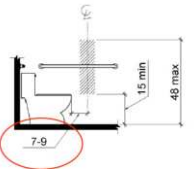
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


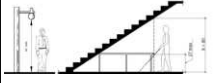

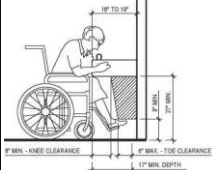

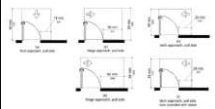
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
140	Cabin Area: Cabin Area - Cabin 6	[30.1787717 , -97.728692 8]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	Route lacks 36" pad around table	Provide required 36" clear ground space around all usable portions of the table as a smart practice	2015 ABAAS Section: 1011.2.1		
141	Cabin Area: Cabin Area - Cabin 6	[30.1787926 , -97.728723 8]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Fire ring lacks AR	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		
142	Cabin Area: Cabin Area - Cabin 6	[30.1787915 , -97.728727]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	Fire surface at ground	Correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
143	Cabin Area: Cabin Area - Cabin 6	[30.1787926 , -97.728728 3]	Where provided, cooking surfaces shall be 15 inches (380 mm) minimum and 34 inches (865 mm) maximum above the ground	Cooking surface 13" AGL	Raise or lower cooking surface to be 15" min to 34" max above the ground; in the alternative, replace with a compliant surface as a smart practice	2015 ABAAS Section: 1011.5.2		
144	Cabin Area: Cabin Area - Cabin 6	[30.1787921 , -97.728726 6]	A minimum of one of each type of outdoor constructed feature does not have mobility features. Where provided, at least one of each type of outdoor constructed features with mobility features must be provided.	Grill/fire ring fail	Provide accessible outdoor constructed features at the required number of camp units based on the total number provided.	2015 ABAAS Section: F244.2.3.1, F245.2.5.1		


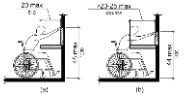

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
145	Cabin Area: Cabin Area Men's Restroom	[30.1783537 , -97.728979 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Column reduces maneuvering clearance	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
146	Cabin Area: Cabin Area Men's Restroom	[30.1783419 , -97.728984 5]	The rim of the urinal is too high. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	18" to urinal rim	Lower urinal so that rim height is max 17" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
147	Cabin Area: Cabin Area Men's Restroom	[30.1783476 , -97.728973 7]	The bowl of the urinal does not extend out from the wall far enough. Urinals must project a minimum of 13-1/2 inches measured from the outer face of the urinal rim to the back of the fixture and be a maximum of 17 inches above the floor.	12 inch urinal depth	Replace urinal with one having a 13.5" min depth mounted at max 17" to rim with flush controls max 48" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		

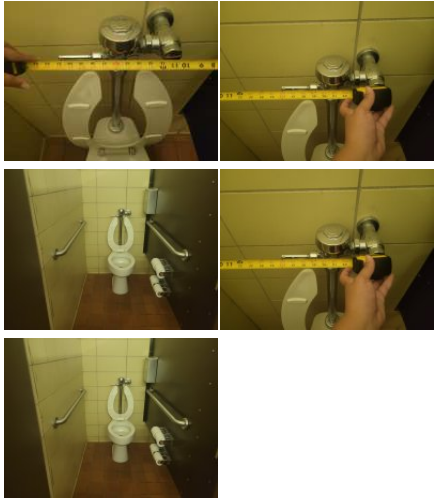
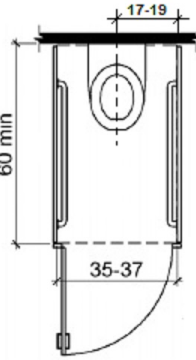

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
148	Cabin Area: Cabin Area Men's Restroom	[30.1783583 , -97.7289724]	There are not enough accessible toilet compartments. The room contains 3 toilet compartments. A minimum of 1 must be wheelchair accessible .	Only ambulatory stall provided	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
149	Cabin Area: Cabin Area Men's Restroom	[30.1783441 , -97.7289711]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20" to centerline of toilet to wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		
150	Cabin Area: Cabin Area Men's Restroom	[30.1783296 , -97.7289791]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall lacks self-closing door	Adjust or replace stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		




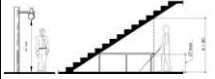

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
151	Cabin Area: Cabin Area Men's Restroom	[30.1783507 , -97.728971 1]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Edge of grab bar 50" to face of wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF	2015 ABAAS Section: 604.5.1  2012 TAS Section: 604.5.1  2010 ADAS Section: 604.5.1		
152	Cabin Area: Cabin Area Men's Restroom	[30.1783498 , -97.728976 4]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	36.5" to top of bar	Remount grab bars in accessible stall to 33" to 36" AFF	2015 ABAAS Section: 609.3, 609.4  2012 TAS Section: 609.4, 609.3  2010 ADAS Section: 609.3, 609.4		
153	Cabin Area: Cabin Area Men's Restroom	[30.1783539 , -97.728984 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Toilet Paper (TP) 5" to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		


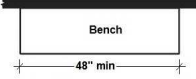

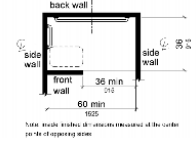
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
154	Cabin Area: Cabin Area Men's Restroom	[30.1783519 , -97.728968 4]	The sink projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sinks protrude	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
155	Cabin Area: Cabin Area Men's Restroom	[30.178288, -97.729006 1]	There is not enough knee clearance under the drinking fountain. The drinking fountain must have a clear knee space between the bottom of the apron and the floor not less than 27 inches in height, 30 inches in width, and 8 inches in depth.	Drinking fountain lacks knee space	Replace drinking fountain with a hi-lo bowl fountain	2015 ABAAS Section: 602.2  2012 TAS Section: 602.2  2010 ADAS Section: 602.2		
156	Cabin Area: Cabin Area Women's Restroom	[30.1783636 , -97.728985 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Women's- 47" back pull side with closer	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		



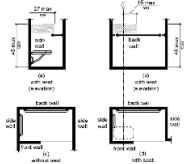

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
157	Cabin Area: Cabin Area Women's Restroom	[30.1783567 , -97.728988 1]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59" AFF	Lower operating mechanisms in RR to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
158	Cabin Area: Cabin Area Women's Restroom	[30.1783534 , -97.72898]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
159	Cabin Area: Cabin Area Women's Restroom	[30.1783534 , -97.72898]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Dimension from centerline of toilet to wall, R side 15.75", L side 21"	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		
160	Cabin Area: Cabin Area Women's Restroom	[30.1783534 , -97.728972]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Grab bars extend 49.5"	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF	2015 ABAAS Section: 604.5.1  2012 TAS Section: 604.5.1  2010 ADAS Section: 604.5.1		


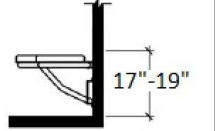

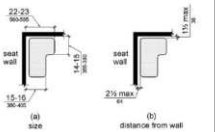
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
161	Cabin Area: Cabin Area Women's Restroom	[30.1783534 , -97.728972]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	36.75", trash can too close above bar	Remount trash can max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 609.3, 609.4  2012 TAS Section: 609.4, 609.3  2010 ADAS Section: 609.3, 609.4		
162	Cabin Area: Cabin Area Women's Restroom	[30.1783338 , -97.728985 4]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too far from front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		



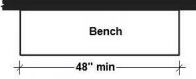
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
163	Cabin Area: Cabin Area Women's Restroom	[30.1783502 , -97.728982 7]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sinks protrude	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
164	Cabin Area: Cabin Area Men's Shower	[30.1783442 , -97.728956 3]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	71" to coat hook over bench	Remount at least one hook to max 46" AFF over bench	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5  2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5  2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
165	Cabin Area: Cabin Area Men's Shower	[30.1783422 , -97.728965 7]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Bench, 12" deep, 15.5" high	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
166	Cabin Area: Cabin Area Men's Shower	[30.1783556 , -97.728973 7]	Alternate roll-in type shower compartments shall be 36 inches (915 mm) wide and 60 inches (1525 mm) deep minimum clear inside dimensions measured at center points of opposing sides. A 36 inch (915 mm) wide minimum entry shall be provided at one end of the long side of the compartment.	32" wide opening, 49.5" wide compartment	Correct shower stall, if feasible, to compliant dimensions for an alternate roll in shower of 36" deep by 60" wide with a 36" opening on the long dimension	2015 ABAAS Section: 608.2.3  2012 TAS Section: 608.2.3  2010 ADAS Section: 608.2.3		 <small>Note: width includes 48" clearance measured at the center points of opposing sides.</small>


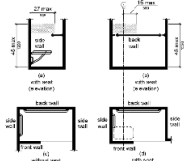

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
167	Cabin Area: Cabin Area Men's Shower	[30.1783208 , -97.728973 7]	The grab bar is located above the seat In alternate roll-in type shower compartments, grab bars shall be provided on the back wall and the side wall farthest from the compartment entry. Grab bars shall not be provided above the seat. Grab bars shall be installed 6 inches maximum from adjacent walls.	Grab bar does not extend to seat	Provide grab bars in the shower mounted in the correct locations for the shower type	2015 ABAAS Section: 608.3.3  2012 TAS Section: 608.3.3  2010 ADAS Section: 608.3.3		
168	Cabin Area: Cabin Area Men's Shower	[30.1783464 , -97.728960 3]	The operable parts of controls are incorrectly installed. In alternate roll-in type shower compartments, the controls, faucets, and shower spray unit shall be located above the grab bar, but no higher than 48 inches (1220 mm) above the shower floor. Where a seat is provided, the controls, faucets, and shower spray unit shall be located on the side wall adjacent to the seat 27 inches (685 mm) maximum from the side wall behind the seat or shall be located on the back wall opposite the seat 15 inches (380 mm) maximum, left or right, of the centerline of the seat. Where a seat is not provided, the controls, faucets, and shower spray unit shall be installed on the side wall farthest from the compartment entry.	66" to shower hose	Remount shower controls to the correct location in the alternate shower	2015 ABAAS Section: 608.5.3  2012 TAS Section: 608.5.3  2010 ADAS Section: 608.5.3		
169	Cabin Area: Cabin Area Men's Shower	[30.1783356 , -97.728973 7]	The force required to operate the element exceeds the maximum. The force required to activate operable parts is 5 pounds maximum.	12# force required at fixed shower head	Adjust operating mechanism to be usable with 5 #f or less	2015 ABAAS Section: 309.4  2012 TAS Section: 309.4  2010 ADAS Section: 309.4		

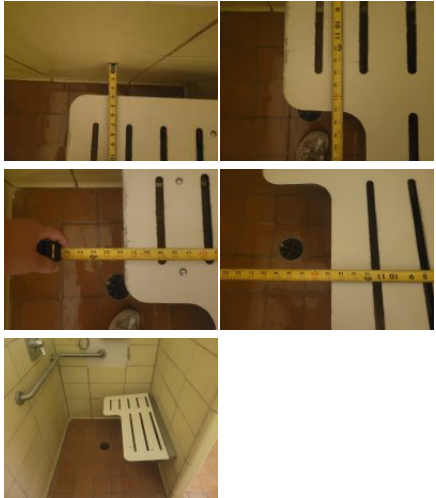
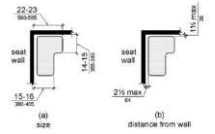




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
170	Cabin Area: Cabin Area Men's Shower	[30.1783443 , -97.728971 1]	The shower seat height is noncompliant. A seat in a standard roll-in shower compartment shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches of the compartment entry. A seat in an alternate roll-in type shower compartment shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches of the compartment entry. The top of the seat shall be 17 inches minimum and 19 inches maximum above the bathroom finish floor.	16.5" to seat	Remount shower seat to the correct location and height in the shower	2015 ABAAS Section: 610.3  2012 TAS Section: 610.3  2010 ADAS Section: 610.3		
171	Cabin Area: Cabin Area Men's Shower	[30.1783465 , -97.728971 1]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	4" gap, 14.75" seat dimension, 17" dimension	Remount shower seat to the correct location and height in the shower. Cost included in previous finding	2015 ABAAS Section: 610.3.2  2012 TAS Section: 610.3.2  2010 ADAS Section: 610.3.2		



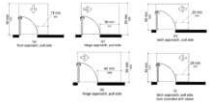

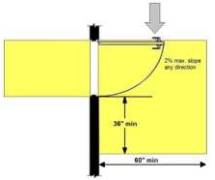
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
172	Cabin Area: Cabin Area Women's Shower	[30.1783433 , -97.728979 1]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hooks are mounted high and over bench	Remount at least one hook to max 46" AFF over bench	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5  2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5  2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
173	Cabin Area: Cabin Area Women's Shower	[30.1783488 , -97.728981 8]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Small benches only	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		


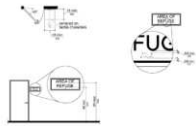

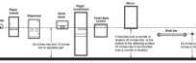
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
174	Cabin Area: Cabin Area Women's Shower	[30.1783437 , -97.728969 7]	Alternate roll-in type shower compartments shall be 36 inches (915 mm) wide and 60 inches (1525 mm) deep minimum clear inside dimensions measured at center points of opposing sides. A 36 inch (915 mm) wide minimum entry shall be provided at one end of the long side of the compartment.	Alternate shower, 40" wide, 32" opening	Correct shower stall, if feasible, to compliant dimensions for an alternate roll in shower of 36" deep by 60" wide with a 36" opening on the long dimension	2015 ABAAS Section: 608.2.3  2012 TAS Section: 608.2.3  2010 ADAS Section: 608.2.3		
175	Cabin Area: Cabin Area Women's Shower	[30.1783447 , -97.728971 1]	The grab bar is located above the seat In alternate roll-in type shower compartments, grab bars shall be provided on the back wall and the side wall farthest from the compartment entry. Grab bars shall not be provided above the seat. Grab bars shall be installed 6 inches maximum from adjacent walls.	Grab bar does not extend across long wall	Provide grab bars in the shower mounted in the correct locations for the shower type	2015 ABAAS Section: 608.3.3  2012 TAS Section: 608.3.3  2010 ADAS Section: 608.3.3		
176	Cabin Area: Cabin Area Women's Shower	[30.1783426 , -97.728973 7]	The operable parts of controls are incorrectly installed. In alternate roll-in type shower compartments, the controls, faucets, and shower spray unit shall be located above the grab bar, but no higher than 48 inches (1220 mm) above the shower floor. Where a seat is provided, the controls, faucets, and shower spray unit shall be located on the side wall adjacent to the seat 27 inches (685 mm) maximum from the side wall behind the seat or shall be located on the back wall opposite the seat 15 inches (380 mm) maximum, left or right, of the centerline of the seat. Where a seat is not provided, the controls, faucets, and shower spray unit shall be installed on the side wall farthest from the compartment entry.	Shower control 56"	Remount shower controls to the correct location in the alternate shower	2015 ABAAS Section: 608.5.3  2012 TAS Section: 608.5.3  2010 ADAS Section: 608.5.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
177	Cabin Area: Cabin Area Women's Shower	[30.1783367 , -97.728973 7]	The operable parts of controls are incorrectly installed. In alternate roll-in type shower compartments, the controls, faucets, and shower spray unit shall be located above the grab bar, but no higher than 48 inches (1220 mm) above the shower floor. Where a seat is provided, the controls, faucets, and shower spray unit shall be located on the side wall adjacent to the seat 27 inches (685 mm) maximum from the side wall behind the seat or shall be located on the back wall opposite the seat 15 inches (380 mm) maximum, left or right, of the centerline of the seat. Where a seat is not provided, the controls, faucets, and shower spray unit shall be installed on the side wall farthest from the compartment entry.	Handheld shower 32.5" from seat wall	Remount shower controls to the correct location in the alternate shower	2015 ABAAS Section: 608.5.3  2012 TAS Section: 608.5.3  2010 ADAS Section: 608.5.3		
178	Cabin Area: Cabin Area Women's Shower	[30.1783569 , -97.728969 7]	Where a seat is provided in a standard roll-in shower compartment, it shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. Where a seat is provided in an alternate roll-in type shower compartment, it shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches (75 mm) of the compartment entry. In transfer-type showers, the seat shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. The top of the seat shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the bathroom finish floor. Seats shall comply with 610.3.1 or 610.3.2.	3.5" from seat to edge of wall	Provide the correct seat based on shower type.	2015 ABAAS Section: 610.3  2012 TAS Section: 610.3  2010 ADAS Section: 610.3		


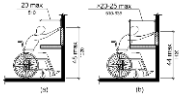
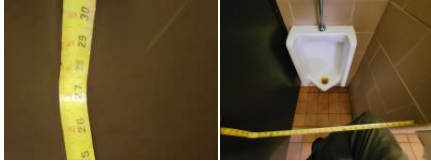
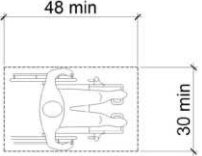
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
179	Cabin Area: Cabin Area Women's Shower	[30.1783433 , -97.728987 2]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Multiple dimensions fail	Remount shower seat to the correct location and height in the shower	2015 ABAAS Section: 610.3.2  2012 TAS Section: 610.3.2  2010 ADAS Section: 610.3.2		





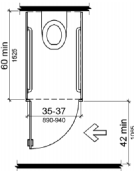
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure																																														
180	Youth Group Camping Area: Youth Camping	[30.1768074 , -97.730028 7]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	No route to youth camping, dirt path; site includes 3 tent pads, 7 tables, 5 hooks, 2 fire ring/grill, large fire ring	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2																																																
181	Youth Group Camping Area: Youth Camping	[30.1774908 , -97.729195 7]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (12) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Gravel lot, no accessible stalls	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		<table border="1"> <thead> <tr> <th>Total Number of Parking Spaces Provided at Facility</th> <th>Minimum Number of Required Accessible Parking Spaces</th> </tr> </thead> <tbody> <tr><td>1-20</td><td>1</td></tr> <tr><td>21-50</td><td>2</td></tr> <tr><td>51-100</td><td>3</td></tr> <tr><td>101-150</td><td>4</td></tr> <tr><td>151-200</td><td>5</td></tr> <tr><td>201-250</td><td>6</td></tr> <tr><td>251-300</td><td>7</td></tr> <tr><td>301-350</td><td>8</td></tr> <tr><td>351-400</td><td>9</td></tr> <tr><td>401-450</td><td>10</td></tr> <tr><td>451-500</td><td>11</td></tr> <tr><td>501-550</td><td>12</td></tr> <tr><td>551-600</td><td>13</td></tr> <tr><td>601-650</td><td>14</td></tr> <tr><td>651-700</td><td>15</td></tr> <tr><td>701-750</td><td>16</td></tr> <tr><td>751-800</td><td>17</td></tr> <tr><td>801-850</td><td>18</td></tr> <tr><td>851-900</td><td>19</td></tr> <tr><td>901-950</td><td>20</td></tr> <tr><td>951-1,000</td><td>21</td></tr> <tr><td>1,001-1,000</td><td>22</td></tr> </tbody> </table> <p>Source: 2010 ADA Standards for Accessible Design, Table 503</p>	Total Number of Parking Spaces Provided at Facility	Minimum Number of Required Accessible Parking Spaces	1-20	1	21-50	2	51-100	3	101-150	4	151-200	5	201-250	6	251-300	7	301-350	8	351-400	9	401-450	10	451-500	11	501-550	12	551-600	13	601-650	14	651-700	15	701-750	16	751-800	17	801-850	18	851-900	19	901-950	20	951-1,000	21	1,001-1,000	22
Total Number of Parking Spaces Provided at Facility	Minimum Number of Required Accessible Parking Spaces																																																					
1-20	1																																																					
21-50	2																																																					
51-100	3																																																					
101-150	4																																																					
151-200	5																																																					
201-250	6																																																					
251-300	7																																																					
301-350	8																																																					
351-400	9																																																					
401-450	10																																																					
451-500	11																																																					
501-550	12																																																					
551-600	13																																																					
601-650	14																																																					
651-700	15																																																					
701-750	16																																																					
751-800	17																																																					
801-850	18																																																					
851-900	19																																																					
901-950	20																																																					
951-1,000	21																																																					
1,001-1,000	22																																																					



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
182	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753168 , -97.726861 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	custodian- 30" wide door	For all doors along the circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		
183	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753231 , -97.726853 5]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Masonry and column restrict maneuvering clearance	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
184	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753315 , -97.726848 1]	The landing at the door does not have a compliant landing. Doors with an approach from the hinge side must have a landing on the pull side that is a minimum of 60 inches in depth perpendicular to the door in a close position by a minimum width dimension of 36 inches plus the door width. The additional 36 inches must extend past the door on the latch side. The entire landing must be free of obstructions and must be flat (2% max. slope is considered flat in any direction).	3% slope at door CFS	For all doors along the public circulation route, correct or repair slope at doorway landing to max 2.08% in any direction for level CFS	2015 ABAAS Section: 404.2.4.1  2012 TAS Section: 404.2.4.1  2010 ADAS Section: 404.2.4.1		


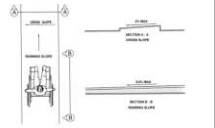

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
185	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753247 , -97.726849 4]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks braille and tactile characters	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
186	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753248 , -97.726850 8]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror, 41" to bottom, 70" to top	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		


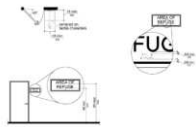

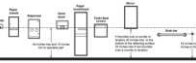



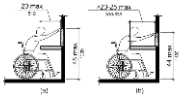

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
187	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753227 , -97.726852 1]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	52" to coat hook	Lower operating mechanisms in stall to max 48" AFF to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
188	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753251 , -97.726854 8]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	27" wide clearance at urinal	Relocate privacy wall at urinal to provide 30" CFS	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		


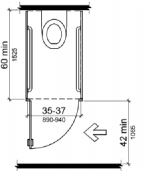

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
189	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753238 , -97.726852 1]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks accessible stall, ambulatory stall provided	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
190	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753255 , -97.726860 8]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	40" wide x 56" long stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1	  	




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
191	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753254 , -97.726856 1]	The stall door must be self-closing.	Stall lacks self-closing door	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
192	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753155 , -97.726862 2]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" long gab bars	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
193	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Men's Restroom	[30.1753222 , -97.726853 5]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	3.2% slope near floor drain	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
194	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753218 , -97.726856 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Women's RR- 34" to stone wall within latch side clearance on pull side, 8" to wall push side, 17#, closes fast	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
195	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.175319, -97.726854 8]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters, mounted above door	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
196	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753205, -97.726856 1]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	41" to bottom of mirror	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
197	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753282 , -97.726848 1]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59" AFF	Lower operating mechanisms in RR to max 48" AFF to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
198	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753228 , -97.726853 5]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
199	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753176 , -97.726856 8]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	59.5" deep stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
200	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753159 , -97.726856 1]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door 30", not self-closing	Widen stall doors to 32" when opened to 90 degrees Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


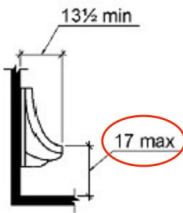


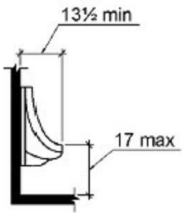
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
201	Big Cedar/Moss Loop Camping Areas: Big Cedar Camping Area Women's Restroom	[30.1753243 , -97.726857 5]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" grab bars both sides	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
202	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770349 , -97.726918 5]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	No AR to any amenities	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
203	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770257 , -97.726895 7]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	Table not of accessible design	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		


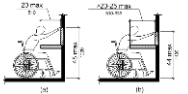
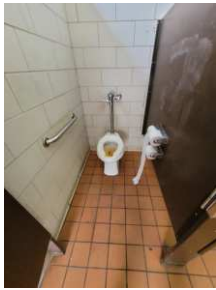



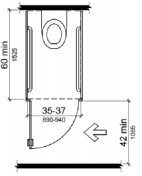
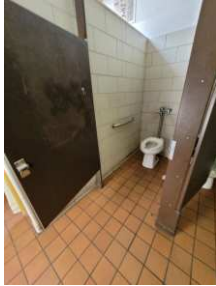
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
204	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770088 , -97.7269078]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Grill not on accessible surface	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		
205	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770155 , -97.7269004]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	Grill at ground level	Correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
206	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770062 , -97.7269232]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground	Spigot 21" AFF	Remount water spouts to 28" min or 36" max above the ground as a smart practice	2015 ABAAS Section: 1011.6		



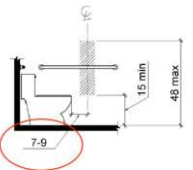

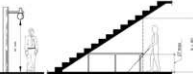
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
207	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770083 , -97.7269138]	A clear floor space at the tent pad and/or tent platform is not provided. Clear ground space shall be provided on all usable sides of tent pads and tent platforms. The clear ground space shall be 48 inches wide minimum. The surface of the clear ground space shall be firm and stable. The surface shall allow use of tent stakes and other tent securement devices. The slope of the surface of tent pads, tent platforms, and clear ground spaces shall not be steeper than 1:48 in any direction. Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted where necessary for drainage.	Non compliant surface at tent pads	Replace existing surface around tent platform with an accessible surface such as EWF, boardwalk, crushed stone, or asphalt with compliant slopes and CILs	2015 ABAAS Section: 1013.2		
208	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770108 , -97.726895]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum. EXCEPTION: Where two adjacent parking spaces are provided for recreational vehicles, one parking space shall be permitted to be 16 feet (4880 mm) wide minimum.	Site 52, RV - 13' width	Correct RV parking space to be 20' wide minimum; or 16' for two adjacent spaces as a smart practice.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION		
209	Big Cedar/Moss Loop Camping Areas: Big Cedar Campsite	[30.1770036 , -97.7269084]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 84 campsites designated accessible, sample sites viewed in each area	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		


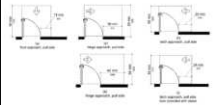



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
210	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770594 , -97.726227 2]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	30" wide door	For all doors along the circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		
211	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770481 , -97.726237 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
212	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770578 , -97.726235 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror, 41" to bottom, 70" to top	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
213	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770708 , -97.726235 2]	The rim of the urinal is too high. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	19" to urinal rim	Lower urinal so that rim height is max 17" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
214	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770568 , -97.726243 3]	The urinal is located in an area that does not provide the required clear floor space for a front approach. The surrounding elements of a urinal must provide a minimum of 30 by 48 inches of clear floor space for a front approach.	27" width at urinal	Relocate privacy wall at urinal to provide 30" CFS	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
215	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.177061 , -97.726228 5]	The bowl of the urinal does not extend out from the wall far enough. Urinals must project a minimum of 13-1/2 inches measured from the outer face of the urinal rim to the back of the fixture and be a maximum of 17 inches above the floor.	12.5" urinal depth	Replace urinal with one having a 13.5" min depth mounted at max 17" to rim with flush controls max 48" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
216	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770665 , -97.726237 9]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	53" to coat hook	Lower operating mechanisms in stall to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
217	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770577 , -97.726243 3]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks accessible stall, ambulatory stall provided	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		


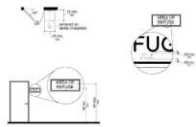

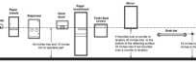
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
218	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770631 , -97.726224 5]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Stall 58" deep, 40" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
219	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770512 , -97.726243 3]	The stall door must be self-closing.	Stall lacks self-closing door	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


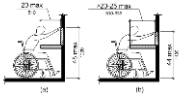

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
220	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770688 , -97.726239 2]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	Only one 24" long bar provided in the stall	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
221	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770677 , -97.726241 9]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	2" from edge of toilet to centerline of TP	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
222	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770668 , -97.726233 9]	The sink projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sinks projects into route	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		


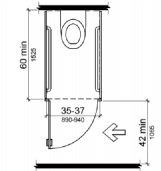
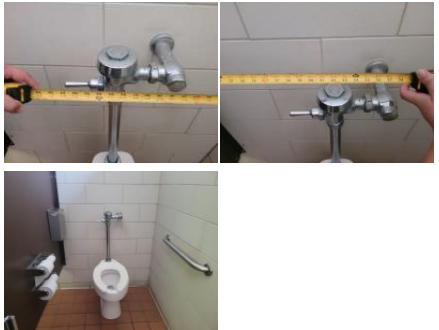
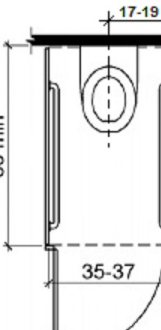

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
223	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770641 , -97.7262325]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Column restricts maneuvering clearance	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
224	Grapevine Loop Camping Area: Grapevine Loop Camping Men's Restroom	[30.1770779 , -97.7262097]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Lacks accessible route from sidewalk to firewood vending area	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		
225	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770631 , -97.726238]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width	Women's RR- 12#, closes fast, 48" back pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception	 	



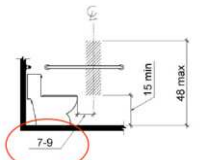

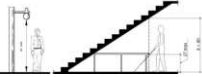



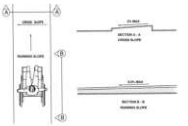

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			<p>between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.</p>					


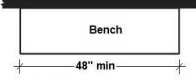

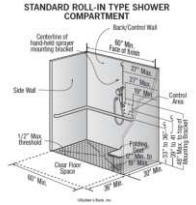
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
226	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770659 , -97.726237 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters, mounted above door	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
227	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770623 , -97.726232 5]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror 41"	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		



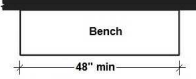
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
228	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770663 , -97.7262325]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59", hook 56"	Lower operating mechanisms in RR to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
229	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770552 , -97.7262379]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Narrow stall that will not meet wheelchair or ambulatory requirements	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
230	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770627 , -97.726239 2]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Stall 45" wide, 59.75" deep	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
231	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770611 , -97.726231 2]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Toilet reach range is too far both sides	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		
232	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.177066 , -97.726232 5]	The stall door fails to comply with some of the door requirements. The stall door must be a minimum of 32" wide and must be self-closing.	Stall door 31", not self-closing	Widen stall doors to 32" when opened to 90 degrees Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


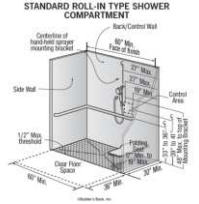
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
233	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770601 , -97.726237 9]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" bar on one side only	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
234	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770696 , -97.726227 2]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too close to edge of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
235	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770563 , -97.726231 2]	The sink projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Sinks protrude into route	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		


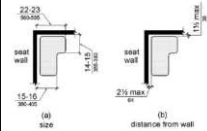

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
236	Grapevine Loop Camping Area: Grapevine Loop Camping Women's Restroom	[30.1770645 , -97.726248 6]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.6% slope at shower drain	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
237	Grapevine Loop Camping Area: Grapevine Loop Camping Area Men's Shower	[30.1770557 , -97.726243 3]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	68.5" AFF to coat hook	Remount at least one hook to max 48" AFF	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5  2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5  2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		


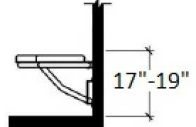


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
238	Grapevine Loop Camping Area: Grapevine Loop Camping Area Men's Shower	[30.1770725 , -97.7262325]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	11" deep seat, 16" high	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
239	Grapevine Loop Camping Area: Grapevine Loop Camping Area Men's Shower	[30.1770784 , -97.7262218]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Shower lacks accessible features	Create an accessible shower in locker/bathing room	2015 ABAAS Section: F213.3.6  2012 TAS Section: 213.3.6  2010 ADAS Section: 213.3.6		


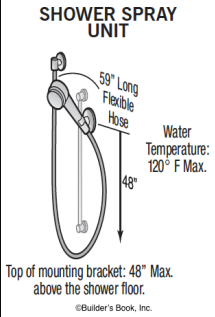


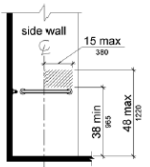
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
240	Grapevine Loop Camping Area: Grapevine Loop Camping Area Women's Shower	[30.1770616 , -97.726241 9]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Hooks at showers high and over benches	Remount at least one hook to max 46" AFF over bench	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5  2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5  2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
241	Grapevine Loop Camping Area: Grapevine Loop Camping Area Women's Shower	[30.1770557 , -97.726237 9]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Small benches only	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		

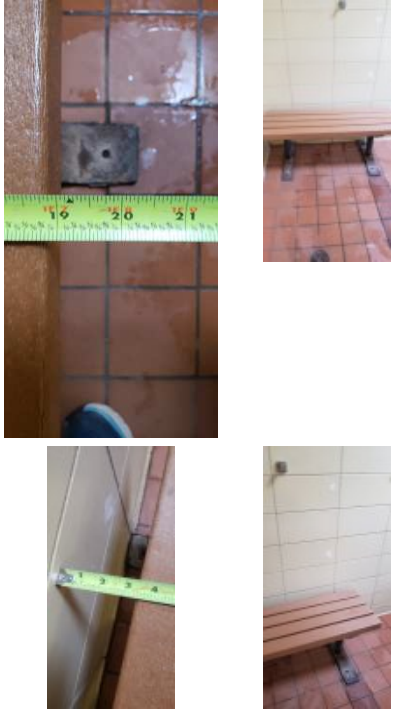
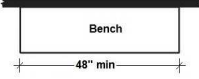

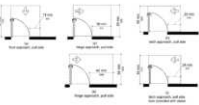



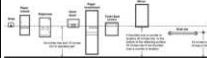


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
242	Grapevine Loop Camping Area: Grapevine Loop Camping Area Women's Shower	[30.1770543 , -97.726240 6]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Lacks accessible shower	Create an accessible shower in locker/bathing room	2015 ABAAS Section: F213.3.6  2012 TAS Section: 213.3.6  2010 ADAS Section: 213.3.6		


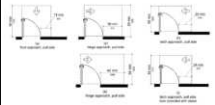
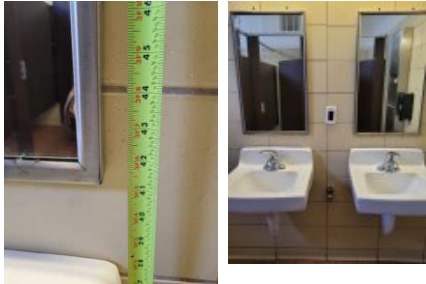
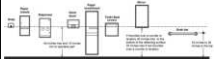
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
243	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787836 , -97.723976 8]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Seat 16" wide per section	Remount shower seat to the correct location and height in the shower. Cost for compliant seat included in separate finding	2015 ABAAS Section: 610.3.2  2012 TAS Section: 610.3.2  2010 ADAS Section: 610.3.2		
244	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787794 , -97.723971 4]	Where a seat is provided in a standard roll-in shower compartment, it shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. Where a seat is provided in an alternate roll-in type shower compartment, it shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches (75 mm) of the compartment entry. In transfer-type showers, the seat shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. The top of the seat shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the bathroom finish floor. Seats shall comply with 610.3.1 or 610.3.2.	Seat 11" from edge	Provide the correct seat based on shower type.	2015 ABAAS Section: 610.3  2012 TAS Section: 610.3  2010 ADAS Section: 610.3		

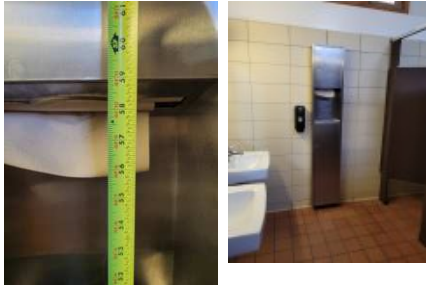
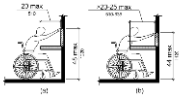

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
245	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787938 , -97.723984 8]	The shower seat height is noncompliant. A seat in a standard roll-in shower compartment shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches of the compartment entry. A seat in an alternate roll-in type shower compartment shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches of the compartment entry. The top of the seat shall be 17 inches minimum and 19 inches maximum above the bathroom finish floor.	Seat 21" AFF	Remount shower seat to the correct location and height in the shower. Separate finding includes cost for compliant seat	2015 ABAAS Section: 610.3  2012 TAS Section: 610.3  2010 ADAS Section: 610.3		
246	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787917 , -97.723973 4]	The operable part is not accessible because it requires tight grasping, pinching or twisting of the wrist.	Knob on one shower, other shower less than 5# push	Replace operable part with one usable without a tight pinch or grasp	2015 ABAAS Section: 309.4  2012 TAS Section: 309.4  2010 ADAS Section: 309.4		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
247	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787937 , -97.723966 1]	There is no hand held sprayer unit. The sprayer unit must have a 59 inches hose and be mounted 48 inches maximum to the top of mounting bracket off the floor. The shower spray unit shall have an on/off control with a non-positive shutoff. If an adjustable-height shower head on a vertical bar is used, the bar shall be installed so as not to obstruct the use of grab bars.	49" AFF to shower spray	Replace shower control with a compliant lever control with a shower head on a 59" hose and usable as hand held	2015 ABAAS Section: 608.6  2012 TAS Section: 608.6  2010 ADAS Section: 608.6		<p><b>SHOWER SPRAY UNIT</b></p>  <p>Water Temperature: 120° F Max.</p> <p>Top of mounting bracket: 48" Max. above the shower floor.</p> <p>©Builder's Book, Inc.</p>
248	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787834 , -97.723971 4]	Shower controls are in the incorrect location In transfer type shower compartments, the controls, faucets, and shower spray unit shall be installed on the side wall opposite the seat 38 inches (965 mm) minimum and 48 inches (1220 mm) maximum above the shower floor and shall be located on the control wall 15 inches (380 mm) maximum from the centerline of the seat toward the shower opening.	Controls 24.5" from opening	Remount shower controls to the correct location in the transfer shower	2015 ABAAS Section: 608.5.1  2012 TAS Section: 608.5.1  2010 ADAS Section: 608.5.1	 	


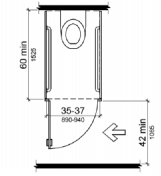
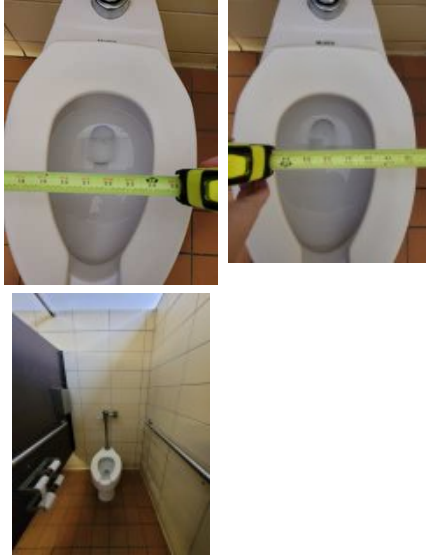
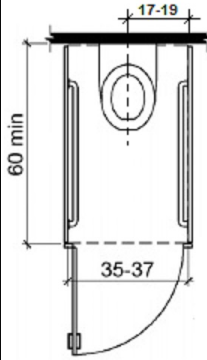
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
249	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787938 , -97.723952 6]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Bench is 19" deep, 3" from wall	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
250	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787663 , -97.723952 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Lacks clearance due to wall	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
251	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787866 , -97.723968 7]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror at 42" AFF	Lower mirror so bottom reflective surface is max 40" AFF and 74" at the top.	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
252	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787779 , -97.723968 1]	The bowl of the urinal does not extend out from the wall far enough. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	Urinal projects less than 13.5"	Replace urinal with one having a 13.5" min depth mounted at max 17" to rim with flush controls max 48" AFF.	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
253	Little Oak Camping Area: Little Oak Camping Area Men's Restroom	[30.1787771 , -97.723974 1]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door is 31" wide and not self-closing	Widen stall doors to 32" when opened to 90 degrees. Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
254	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787752 , -97.723952 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Lacks clearance due to brick work	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
255	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787771 , -97.723983 5]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirrors 41.5" AFF to bottom	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
256	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787817 , -97.7239634]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels - 56" AFF	Lower dispenser to max 46" above the finished floor (AFF) for a side reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
257	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787991 , -97.723958]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	2 standard stalls, 1 ambulatory stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		






Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
258	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787959 , -97.723974 1]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Ambulatory stall 43" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
259	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787926 , -97.723972 8]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	22.5" from partition wall, 22" from cement wall	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
260	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787752 , -97.723963 4]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Both grab bars mounted 8" from wall, 50" to end	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" AFF	2015 ABAAS Section: 604.5.1  2012 TAS Section: 604.5.1  2010 ADAS Section: 604.5.1		
261	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787749 , -97.723966 1]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	4.5" overhead spacing to grab bar on partition wall	Remount napkin disposal, 15" to 48" above the finished floor (AFF) and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 609.3, 609.4  2012 TAS Section: 609.4, 609.3  2010 ADAS Section: 609.3, 609.4		


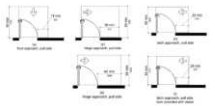

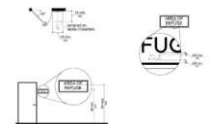
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
262	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.178786, -97.723975 4]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Bench 15.5" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" AFF	2012 TAS Section: 903.4, 903.2, 903.3, 903.5  2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
263	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787982, -97.723966 1]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	48" depth, by 36" wide	Reduce transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1  2012 TAS Section: 608.2.1  2010 ADAS Section: 608.2.1		

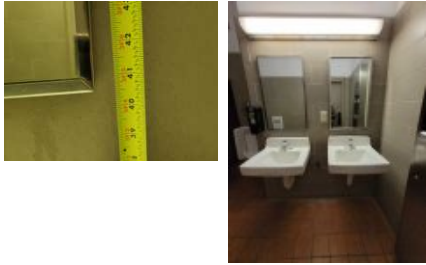
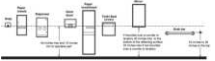
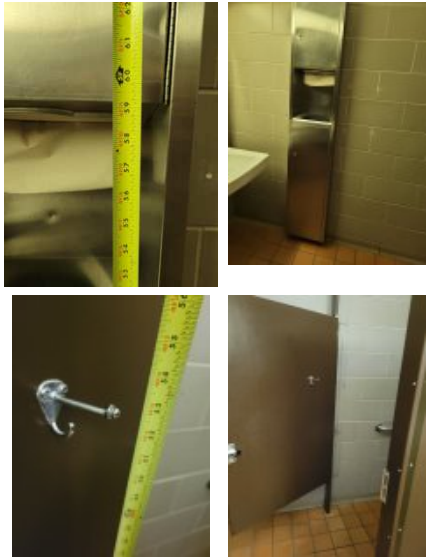
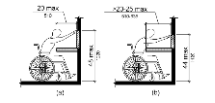
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
264	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787855 , -97.7239674]	A folding or non-folding seat shall be provided in transfer type shower compartments. A folding seat shall be provided in roll-in type showers required in transient lodging guest rooms with mobility features complying with 806.2. Seats shall comply with 610. A folding or non-folding seat shall be provided in transfer type shower compartments. A folding seat shall be provided in roll-in type showers required in transient lodging guest rooms with mobility features complying with 806.2. Seats shall comply with 610. EXCEPTION: In residential dwelling units, seats shall not be required in transfer type shower compartments provided that reinforcement has been installed in walls so as to permit the installation of seats complying with 608.4.	Shower missing seat	Provide the required folding or non-folding seat in the transfer shower.	2015 ABAAS Section: 608.4, 608.4 EXCEPTION  2012 TAS Section: 608.4, 608.4 Exception  2010 ADAS Section: 608.4, 608.4 Exception		
265	Little Oak Camping Area: Little Oak Camping Area Women's Restroom	[30.1787963 , -97.7239761]	Where a seat is provided in a standard roll-in shower compartment, it shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. Where a seat is provided in an alternate roll-in type shower compartment, it shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches (75 mm) of the compartment entry. In transfer-type showers, the seat shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. The top of the seat shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the bathroom finish floor. Seats shall comply with 610.3.1 or 610.3.2.	Shower missing seat	Provide the correct seat based on shower type.	2015 ABAAS Section: 610.3  2012 TAS Section: 610.3  2010 ADAS Section: 610.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
266	Little Oak Camping Area: Little Oak Campsites	[30.1784698 , -97.723699 2]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	No AR to site amenities	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
267	Little Oak Camping Area: Little Oak Campsites	[30.1784646 , -97.723679 1]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	Picnic table lacks toe clearance	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
268	Little Oak Camping Area: Little Oak Campsites	[30.1784769 , -97.723689 1]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	28" width around usable portion	Provide required 36" clear ground space around all usable portions of the table as a smart practice	2015 ABAAS Section: 1011.2.1		




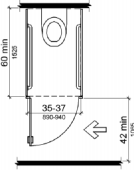

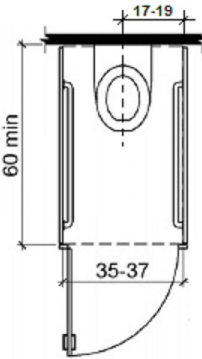
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
269	Little Oak Camping Area: Little Oak Campsites	[30.1784581 , -97.7236925]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Non compliant surface at grill	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		
270	Little Oak Camping Area: Little Oak Campsites	[30.1784575 , -97.7236898]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	Grill at ground level	Correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
271	Little Oak Camping Area: Little Oak Campsites	[30.1784417 , -97.723734]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground	Water spigot 22" AGL	Remount water spouts to 28" min or 36" max above the ground as a smart practice	2015 ABAAS Section: 1011.6		


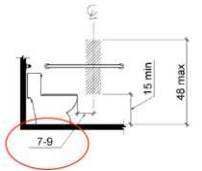

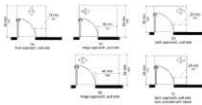
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
272	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801432 , -97.724608 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Lacks clearance due to brick wall	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
273	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801493 , -97.724657 6]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	13# push	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1  2010 ADAS Section: 404.2.9, 404.2.8.1		
274	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801421 , -97.724655 7]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign in non compliant location, no Braille or symbol of accessibility	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

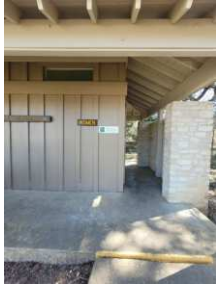
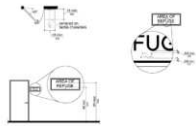


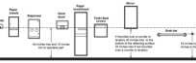
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
275	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801363 , -97.724661 5]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror mounted 41" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
276	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801438 , -97.724674 4]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 56" AFF, hook in stall 52" AFF	Lower hook to max 48" above the finished floor (AFF) to highest operable part. Lower dispenser to max 46" above the finished floor (AFF) for a side reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		

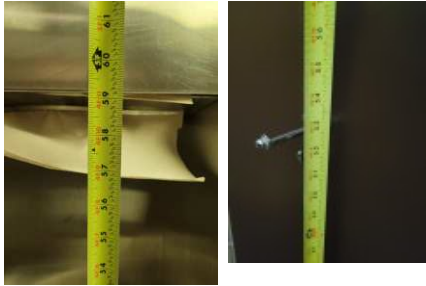
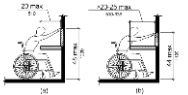




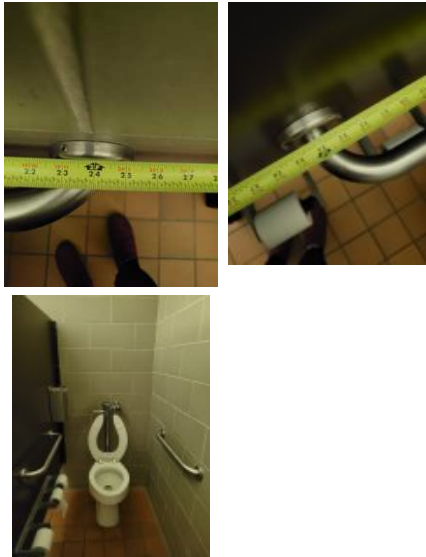
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
277	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801328 , -97.7246708]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	1 ambulatory stall, 1 urinal	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
278	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801328 , -97.7246679]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Ambulatory stall 40" wide	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1	 	
279	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801415 , -97.724669]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	23" from partition side to centerline of toilet	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
280	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801317 , -97.724668 4]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not self-closing	Adjust or replace stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
281	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801392 , -97.724674 9]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	Cement wall grab bar 24", partition side is missing grab bar	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
282	Big Oak Camping Area: Big Oak Camping Area Men's Restroom	[30.1801432 , -97.724678 4]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP dispenser too close to front of toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		
283	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.1801432 , -97.724662 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Lacks clearance due to brick	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4 2012 TAS Section: 404.2.4.4, 404.2.4.1 2010 ADAS Section: 404.2.4.4, 404.2.4.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
284	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.1801444 , -97.7246577]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign in non compliant location, no Braille or symbol of accessibility	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
285	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.1801487 , -97.7246661]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror 41" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3	 	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
286	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.180134, -97.724668 3]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 57" AFF, hook in stall 52" AFF	Lower hook to max 48" above the finished floor (AFF) to highest operable part. Lower dispenser to max 46" above the finished floor (AFF) for a side reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
287	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.1801432, -97.724673 7]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	1 ambulatory stall 1 standard stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
288	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.1801438, -97.7246621]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	30" wide door, not self-closing	Widen stall doors to 32" when opened to 90 degrees Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
289	Big Oak Camping Area: Big Oak Camping Area Women's Restroom	[30.180134, -97.7246666]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" grab bars on both sides	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
290	Big Oak Camping Area: Big Oak Campsites	[30.1804915 , -97.7243758]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	No AR to amenities	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
291	Big Oak Camping Area: Big Oak Campsites	[30.1804221 , -97.7243536]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	No knee clearance, non-accessible table	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
292	Big Oak Camping Area: Big Oak Campsites	[30.180432, -97.7243516]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	30" width, 27" width around table	Provide required 36" clear ground space around all usable portions of the table as a smart practice	2015 ABAAS Section: 1011.2.1		
293	Big Oak Camping Area: Big Oak Campsites	[30.1804258 , -97.7244026]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Grill lacks accessible surface	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

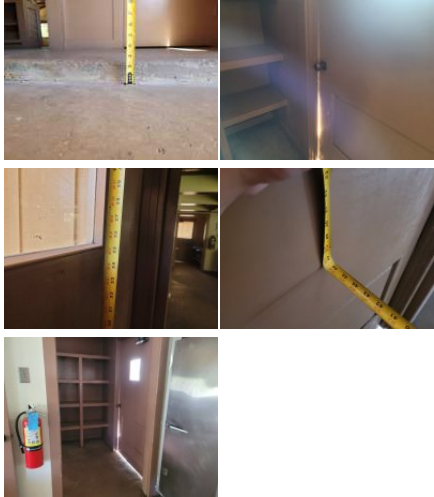
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
294	Big Oak Camping Area: Big Oak Campsites	[30.1804261 , -97.724401 2]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	Fire building surface at ground level	Correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
295	Big Oak Camping Area: Big Oak Campsites	[30.180576, -97.724370 4]	Water spouts at water hydrants and water utility hook-ups shall be 28 inches (710 mm) minimum and 36 inches (915 mm) maximum above the ground	Water spigot 25" AFF	Remount water spouts to 28" min or 36" max above the ground as a smart practice	2015 ABAAS Section: 1011.6		
296	Big Oak Camping Area: Big Oak Campsites	[30.1805465 , -97.724366 4]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum. EXCEPTION: Where two adjacent parking spaces are provided for recreational vehicles, one parking space shall be permitted to be 16 feet (4880 mm) wide minimum.	RV parking stall - 12' 8" width	Correct RV parking space to be 20' wide minimum; or 16' for two adjacent spaces as a smart practice.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION		


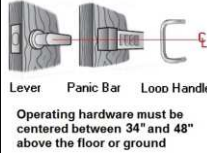






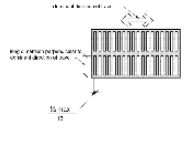

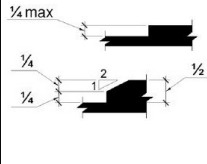

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
297	Group Dining Hall: Group Dining Hall Building	[30.1797942, -97.7288772]	The top rim of the sink is too high. All lavatories/sinks that are designated to be accessible shall be a minimum 17 inches in horizontal depth and mounted with the rim or counter edge no higher than 34 inches above the finished floor.	Sink rim 36.5" AFF	Lower sinks to max 34" above the finished floor (AFF) to front of rim.	2015 ABAAS Section: 606.3 2012 TAS Section: 606.3 2010 ADAS Section: 606.3		
298	Group Dining Hall: Group Dining Hall Building	[30.1797769, -97.7288665]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes lack insulation	Insulate exposed pipes under sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
299	Group Dining Hall: Group Dining Hall Building	[30.1798325, -97.7288665]	Knee and toe space has not been provided at the sink. Kitchen sinks must be provided with a clear floor space positioned for a forward approach including knee and toe clearance.	Deep basin, supports prevent knee and toe clearance	Remove base cabinet and lower sink height to max 34" AFF	2015 ABAAS Section: 606.2, 804.4 2012 TAS Section: 606.2, 804.4 2010 ADAS Section: 606.2, 804.4		
300	Group Dining Hall: Group Dining Hall Building	[30.179803, -97.7288825]	The controls are located such that operation require reaching across burners. Where knee and toe space is provided, the underside of the range or cooktop shall be insulated or otherwise configured to prevent burns, abrasions, or electrical shock. The location of controls shall not require reaching across burners	Oven controls on back	Replace oven with one having controls on the front panel	2015 ABAAS Section: 804.6.4 2012 TAS Section: 804.6.4 2010 ADAS Section: 804.6.4		


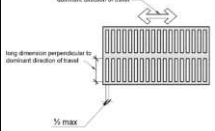

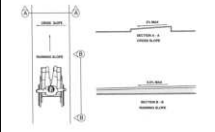


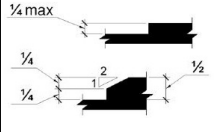
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
301	Group Dining Hall: Group Dining Hall Building	[30.1797879, -97.7288691]	The accessible path of travel contains cross slopes greater than 2%. Surface cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp.	4.9% slope at drain	Correct or repair cross slope of AR to max 2.08%	2015 ABAAS Section: F206.2.4, 403.3  2012 TAS Section: 206.2.4, 403.3  2010 ADAS Section: 206.2.4, 403.3		
302	Group Dining Hall: Group Dining Hall Building	[30.1798239, -97.7288638]	The light switch is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Light switch 55" AFF	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		
303	Group Dining Hall: Group Dining Hall Building	[30.179814, -97.7288477]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Up to 4.9% slope at drain	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		


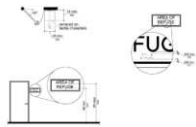

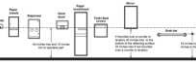
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
304	Group Dining Hall: Group Dining Hall Building	[30.1798219 , -97.728887 9]	The switches are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Light switch 55.5" AFF, fan switch 60" AFF	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		
305	Group Dining Hall: Group Dining Hall Building	[30.1797826 , -97.728842 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4 and floor and ground slope shall comply with 402.4.4. Maneuvering clearances and maximum floor slope shall extend the full width of the doorway and the required latch side or hinge side clearance. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.	Kitchen to patio-chairs push side, window 46.5" AFF, 15# push, 8.9% slope, fountain pull side	For all doors along the public circulation route, provide required maneuvering clearance and floor slope on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
306	Group Dining Hall: Group Dining Hall Building	[30.1798121 , -97.728858 3]	<p>Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.</p>	Kitchen exit- knob, 55" window, 2.5" CIL, wall back 47" push side, closes fast, 10#f	<p>For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25" For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp. For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF.</p>	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


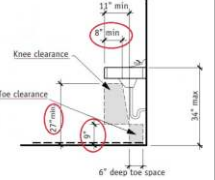


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
307	Group Dining Hall: Group Dining Hall Building	[30.1798186, -97.7288835]	The door operating hardware is not accessible. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Kitchen- knob hardware	Replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2015 ABAAS Section: 404.2.7 2012 TAS Section: 404.2.7 2010 ADAS Section: 404.2.7		
308	Group Dining Hall: Group Dining Hall Building	[30.1798272, -97.7288612]	Floor and ground surfaces shall comply with 404.2.4.4. Maneuvering clearances and floor and ground slope shall extend the full width of the doorway and the required latch side or hinge side clearance. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.	Front entry- 12.4% slope, window 46" AFF	For all doors along the public circulation route, provide required floor and ground slope on push and pull side of doors For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
309	Group Dining Hall: Group Dining Hall Building	[30.17985, -97.72888]	Floor and ground slopes at doors and gates shall comply with 404.2.4.4. Floor and ground slopes shall extend the full width of the doorway and the required latch side or hinge side clearance. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.	Side entry- 10.8% slope, window 46.25" AFF	For all doors along the public circulation route, provide required floor and ground slopes on push and pull side of doors For all doors along the public circulation route, replace doors with ones having sidelight viewing windows max 43" AFF	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


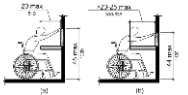

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
310	Group Dining Hall: Group Dining Hall Building	[30.1798281, -97.7288611]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	0 of 8 tables accessible	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
311	Group Dining Hall: Group Dining Hall Building	[30.179801, -97.7288745]	Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch (13 mm) diameter except as allowed in 407.4.3, 409.4.3, 410.4, 810.5.3 and 810.10. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel. Floor or ground surface within required maneuvering clearances shall comply with 302. Changes in level are not permitted.	Gaps and CILs where sections have shifted	Correct or fill gap in doorway to max .5"	2010 ADAS Section: 302.3, 404.2.4.4		
312	Group Dining Hall: Group Dining Hall Building	[30.1798108, -97.7288557]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Multiple CILs where sections shifted, largest is 1.75"	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		
313	Group Dining Hall: Group Dining Hall Building	[30.179814, -97.7288879]	Where picnic facilities contain two or fewer picnic units, each picnic unit shall provide mobility features complying with F245.2.	Table and CIL prevent access to grill	Repair, bevel or ramp CIL along AR Relocate table to provide access	2015 ABAAS Section: F245.2.1		


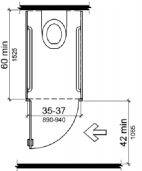

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
314	Group Dining Hall: Group Dining Hall Building	[30.1799859, -97.7286578]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Gaps at deterioration	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
315	Group Dining Hall: Group Dining Hall Building	[30.1799333, -97.7287207]	The accessible route of travel on the accessible route contains cross slopes greater than 2%. Cross slopes shall not exceed one unit vertical in 48 units horizontal (2-percent slope).	4.9% cross slope	Correct or repair cross slope along AR to max 2.08%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
316	Group Dining Hall: Group Dining Hall Building	[30.1799712, -97.7286685], [30.1798359, -97.7287812]	The running slope of walking surfaces shall not be steeper than 1:20.	10% slope to restrooms, 7.6% slope to parking	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
317	Group Dining Hall: Group Dining Hall Building	[30.1798498, -97.7287517]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	.75" CIL	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		



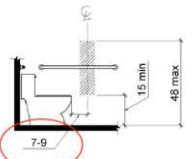
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
318	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1797862 , -97.7288557]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters, mounted above door	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
319	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798043 , -97.7288638]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror bottom 40.5" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		

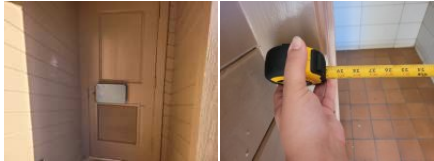




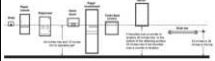

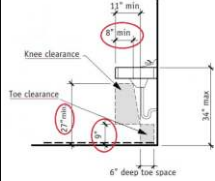


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
320	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798227 , -97.728845]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Sink bowl drops below 27" AFF	Replace sink with one providing 27" knee clearance that is a min 8" deep	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4 , 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		
321	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1797949 , -97.728857 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Sink lacks insulation	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5  2012 TAS Section: 606.5  2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
322	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798014 , -97.7288624]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59" AFF, hook 65.5" AFF	Lower operating mechanisms in RR to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
323	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798075 , -97.7288557]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
324	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798162 , -97.728846 3]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	55.75" deep stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
325	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798107 , -97.728858 4]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	30.5" opening, not self-closing, lacks exterior hardware	Widen stall doors to 32" when opened to 90 degrees Adjust or replace stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
326	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798043 , -97.728869 1]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" long grab bars	Replace side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
327	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1798194 , -97.728855 7]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too far from toilet, too close above grab bar	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		



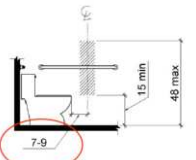
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
328	Group Dining Hall: Group Dining Hall Men's Restroom	[30.1797949 , -97.728871]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	29.5" wide opening, wall pull side, 10# push	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
329	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798153 , -97.7288611]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks Braille and raised characters mounted above door	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
330	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798237 , -97.728839 6]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror bottom 40.25" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
331	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798064 , -97.728871 8]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Low bowl, only 25.5" wide to access	Raise sink bowl to provide minimum 27" knee clearance	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4 , 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		
332	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798139 , -97.728861 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Pipes lack insulation	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5  2012 TAS Section: 606.5  2010 ADAS Section: 606.5		


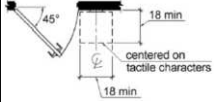
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
333	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798131 , -97.728871 8]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Paper towels 59" AFF, hook 65.5" AFF	Lower operating mechanisms in RR to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
334	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798131 , -97.728861 1]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory stall only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
335	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798016 , -97.728877 2]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	56" deep stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
336	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798117 , -97.728863 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	30.5" opening, lacks exterior hardware	Widen stall doors to 32" when opened to 90 degrees Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
337	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798053 , -97.7288584]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" long bars	Replace side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
338	Group Dining Hall: Group Dining Hall Women's Restroom	[30.1798107 , -97.7288624]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	TP too close to toilet, too close above side bar	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
339	Group Dining Hall: Group Dining Hall Women's Restroom	[30.17977, -97.7289]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm).	29.5" wide opening, wall pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
340	Park Sites: Horse Trainer's Cabin	[30.1816735 , -97.725334 3]	Clear floor space is not provide at the sign. Signs shall be located so that a clear floor space is provided at the sign.	CFS for signage is not stable, mud surface	Resurface CFS at sign to be firm and stable	2015 ABAAS Section: 703.4.2  2012 TAS Section: 703.4.2  2010 ADAS Section: 703.4.2		


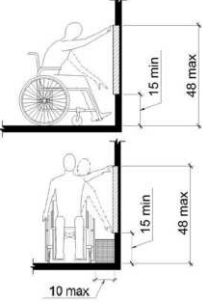

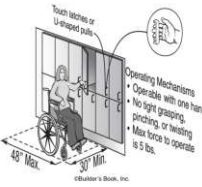

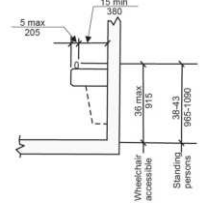
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
341	Park Sites: Playground	[30.1828326 , -97.7236425]	The required clear floor or ground space is not the correct size. The required accessible route is not provided Clear floor or ground space shall be 30 inches minimum by 48 inches minimum with slopes no greater than 2% (1:48) in any direction, Changes in level are not permitted. 1008.4.2 advisory - When designing play components with manipulative or interactive features, consider appropriate reach ranges for children seated in wheelchairs.	Lacks AR to playground and benches (2), surface is assumed to be woodchips, 4 of 4 swings lack entry height, designated entry (37" wide, cross slope of 8.2%, CIL of 1.75", 10 gaps of .75")	Create AR with crushed and compacted stone or similar outdoor material from building to building or parking to all site features Create 60" wide designated entry as a smart practice, correct CIL and slope Replace playground surface with an accessible surface meeting ASTM F 1951. Lower at least one swing to entry height of 11" - 24" agl	2012 TAS Section: 1008.4.2  2010 ADAS Section: 1008.4.2		




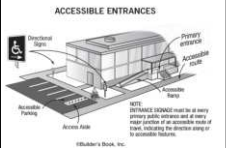
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**



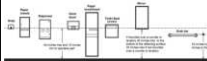
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
342	Park Sites: Amphitheater	[30.180066 , -97.729724 1]	At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site. For areas of sport activity, an accessible route is required to connect to the boundary of each area of sport activity. The size of an area of sport activity includes only the space needed to play. Where multiple sports fields or courts are provided, an accessible route is required to each field or area of sport activity.	Amphitheater lacks AR, grass only close to amenity, loose crushed stone path to access	Provide an accessible route to each element within the site.	2010 ADAS Section: 206.2.2, 206.2		
343	Park Sites: Amphitheater	[30.1812818 , -97.728950 5]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Surface to picnic area near amphitheater restrooms not accessible	Repair surface or ORAR to be firm and stable as a smart practice.	2015 ABAAS Section: 1016.2		
344	Park Sites: Amphitheater	[30.1818427 , -97.729297 3]	Where provided, at least one of each type of outdoor constructed feature shall comply with 1011. Where more than one of the same type of outdoor constructed feature is provided, at least two of the same type of outdoor constructed feature shall comply with 1011.	Tables and grills at each, lack AR, lacks AR to water spouts	Provide required clear ground space existing amenities	2015 ABAAS Section: F245.2.5.1		


**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


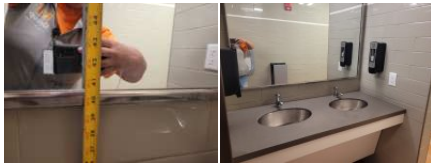
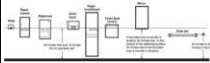
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
345	Park Sites: Park Elements	[30.1784894 , -97.723909 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Fire wood at Little Oak Campground RR - 58" AGL to swipe	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		
346	Park Sites: Park Elements	[30.1784924 , -97.723915 2]	Accessible lockers are not provided. 5% but not less than one of each type of locker must be accessible. Lockers of different size are considered different types. Although not specifically required, it is considered "best practices" that accessible elements be identified to prevent confusion for those needing accessible elements and to indicate to those that do not need accessible elements that they should only be used if others are unavailable.	0 of 47 firewood lockers marked ADA at Little Oak Campground RR building	Designate 5% or no less than 1 locker as accessible with accessible hardware. Mount signage with the access symbol as a (smart practice). Mount hooks and operating mechanisms max 48" AFF	2015 ABAAS Section: F225.2.1  2012 TAS Section: 225.2.1  2010 ADAS Section: 225.2.1		
347	Park Sites: Park Elements	[30.1793503 , -97.726634 9]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	2 low bowls 33" AFF	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2  2012 TAS Section: 211.2  2010 ADAS Section: 211.2		


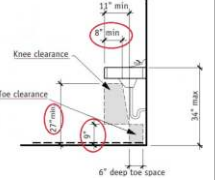

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
348	Park Sites: Park Elements	[30.1805175 , -97.725834 2]	Operable parts shall comply with 309.3 and 309.4. EXCEPTIONS: 1. Fire rings, grills, fireplaces, wood stoves, water hydrants, and water utility hookups shall comply with 309.4 to the extent practicable. 2. Trash and recycling receptacles with hinged lids and controls to keep out large animals shall comply with 309.4 to the extent practicable. 3. Dumpster type trash and recycling receptacles shall not be required to comply with 309.3 and 309.4. 4. Sewage hatches shall not be required to comply with 309.3 and 309.4.	Dump station at turn to big and little oak - water spigot 43" AFF	Replace operable parts with ones usable without a tight pinch or grasp, mounted within reach range of 15" to 48" above the ground as a smart practice	2015 ABAAS Section: 1011.3, 1011.3 EXCEPTIONS: 1, 1011.3 EXCEPTIONS: 2, 1011.3 EXCEPTIONS: 3, 1011.3 EXCEPTIONS: 4		
349	Park Sites: Park Elements	[30.1805315 , -97.725827 5]	The surface of the clear ground space shall be firm and stable The slope of the clear ground space surface shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage	Dump station at little and big oak camping - 3% slope in CFS	Correct surface at water spigot to firm, stable and having max slope of 2.08% or 5% if other than concrete asphalt or boards as a smart practice	2015 ABAAS Section: 1011.2.2, 1011.2.3, 1011.2 EXCEPTION		
350	Park Sites: Park Elements	[30.1842888 , -97.725702 8]	There is no accessible route to the site elements At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No AR to sign, safety equipment or recycling by Upper Falls look-out	Create an accessible route with crushed stone or other outdoor material from parking or walkway to site elements	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		

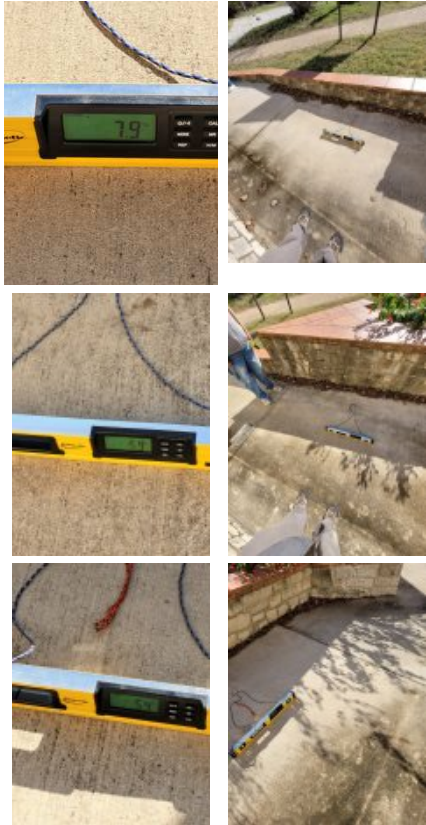





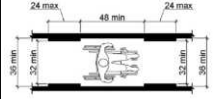
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
351	Smith Visitor Center: Smith Visitor Center Men's Restroom	[30.184048, -97.724914 4]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Men's- 14# push side	Inspect, adjust, and maintain 5lbf to open doors	2015 ABAAS Section: 404.2.9  2012 TAS Section: 404.2.9  2010 ADAS Section: 404.2.9		
352	Smith Visitor Center: Smith Visitor Center Men's Restroom	[30.1840389, -97.724926 3]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror bottom 40.75" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
353	Smith Visitor Center: Smith Visitor Center Men's Restroom	[30.1840334 , -97.724912 9]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby Changing Table will protrude in open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
354	Smith Visitor Center: Smith Visitor Center Women's Restroom	[30.1840278 , -97.7249196]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Women's RR- 13# push side	Inspect, adjust, and maintain 5 lbf to open doors	2015 ABAAS Section: 404.2.9  2012 TAS Section: 404.2.9  2010 ADAS Section: 404.2.9		
355	Smith Visitor Center: Smith Visitor Center Women's Restroom	[30.1839689 , -97.724929]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror bottom 40.5" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
356	Smith Visitor Center: Smith Visitor Center Women's Restroom	[30.1839782 , -97.724929]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Knee space only 7.5" deep at 27" AFF	Replace sink with one providing 27" knee clearance that is a min 8" deep	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4 , 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		
357	Smith Visitor Center: Smith Visitor Center Women's Restroom	[30.1840323 , -97.724910 2]	Toilet compartment doors, including door hardware, shall comply with 404 except that if the approach is to the latch side of the compartment door, clearance between the door side of the compartment and any obstruction shall be 42 inches (1065 mm) minimum. Doors shall be located in the front partition or in the side wall or partition farthest from the water closet. Where located in the front partition, the door opening shall be 4 inches (100 mm) maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches (100 mm) maximum from the front partition. The door shall be self-closing. A door pull complying with 404.2.7 shall be placed on both sides of the door near the latch. Toilet compartment doors shall not swing into the minimum required compartment area.	Partition in pull side clearance	Widen AR to stall to min 42" clear width	2015 ABAAS Section: 604.8.1.2  2012 TAS Section: 604.8.1.2  2010 ADAS Section: 604.8.1.2		


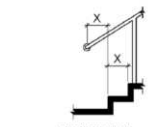

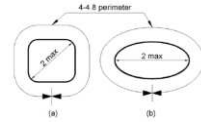
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
358	Smith Visitor Center: Smith Visitor Center Building	[30.1839166, -97.7248599], [30.1840543, -97.7247433]	The running slope of walking surfaces shall not be steeper than 1:20.	Slopes: 7.9%, 5.4%, and 5.9% along route near Visitors Center	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
359	Smith Visitor Center: Smith Visitor Center Building	[30.1839875, -97.7249504]	Element meets all standards and requirements	Break room/office and door comply	None	2010 ADAS Section: N/A		
360	Smith Visitor Center: Smith Visitor Center Building	[30.1840472, -97.7249199]	Element meets all standards and requirements	Desk employee area complies	None	2010 ADAS Section: N/A		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
361	Smith Visitor Center: Smith Visitor Center Building	[30.184039, -97.724923 6]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Storage room - 1.75" CIL, 20# push, closes fast	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9		
362	Smith Visitor Center: Smith Visitor Center Building	[30.1840445, -97.724907]	Required floor and ground slope at doors and gates shall comply with 404.2.4.4 Floor and ground slope shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Entry by counter- 10# push, 11# push, close fast, 2.3% slope	For all doors along the public circulation route, provide required floor and ground slope on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
363	Smith Visitor Center: Smith Visitor Center Building	[30.184006, -97.724950 4]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	24" width to enter	Widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
364	Smith Visitor Center: Smith Visitor Center Building	[30.1840083 , -97.7249129]	The exhibit extends down too close to the route of travel. Any obstruction that overhangs a route of travel must be a minimum of 80 inches above the walking surface as measured from the bottom of the obstruction.	73" AFF at entry	Raise exhibit to min 80", or pad object to prevent hazard in overhead clearance along AR Install guardrails to warn patrons of lowered overhead clearance	2015 ABAAS Section: 307.4 2012 TAS Section: 307.4 2010 ADAS Section: 307.4		
365	Smith Visitor Center: Smith Visitor Center Building	[30.1839689 , -97.7249397]	The exhibit projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Items displayed with timeliness protrude	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
366	Smith Visitor Center: Smith Visitor Center Building	[30.1840198 , -97.7250887]	Visual characters shall be 40 inches (1015 mm) minimum above the finish floor or ground. EXCEPTION: Visual characters indicating elevator car controls shall not be required to comply with 703.5.6.	Exhibit signs on deck low	Remount signage to min 40" AFF	2015 ABAAS Section: 703.5.6, 703.5.6 EXCEPTION  2012 TAS Section: 703.5.6, 703.5.6 Exception  2010 ADAS Section: 703.5.6, 703.5.6 Exception		
367	Smith Visitor Center: Smith Visitor Center Building	[30.1840899 , -97.7250577]	Each distinct viewing location shall provide a viewing space adjacent to the clear ground space required by 1015.2 through which the point of interest is viewable. The viewing space shall be 32 inches (815 mm) maximum and 51 inches (1295 mm) minimum high above the ground and shall extend the full width of the clear ground space.	Top of railing on deck at 42" AFF	Lower a 36" wide portion of railing to provide an unobstructed view between 32" and 51"	2015 ABAAS Section: 1015.3		
368	Smith Visitor Center: Smith Visitor Center Building	[30.1840212 , -97.7249238]	The door exceeds the maximum pressure to open the door. Interior doors shall have a maximum opening force of 5 pounds. These forces do not apply to the force required to retract latch bolts or disengage other devices that hold the door or gate in a closed position. Door closers and gate closers shall be adjusted so that from an open position of 90 degrees, the time required to move the door to a position of 12 degrees from the latch is 5 seconds minimum. Door and gate spring hinges shall be adjusted so that from the open position of 70 degrees, the door or gate shall move to the closed position in 1.5 seconds minimum.	Classroom - 8# push	Inspect, adjust, and maintain 5 lbf to open doors	2015 ABAAS Section: 404.2.9  2012 TAS Section: 404.2.9  2010 ADAS Section: 404.2.9		



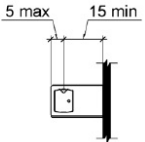



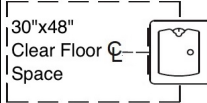

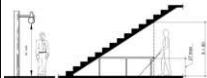
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
369	Smith Visitor Center: Smith Visitor Center Building	[30.1840559 , -97.7250038]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Door to deck- 18# push and 12# push, both close fast	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1  2010 ADAS Section: 404.2.9, 404.2.8.1		
370	Smith Visitor Center: Smith Visitor Center Building	[30.1840471 , -97.7249182]	The handrail does not have a compliant extension at the bottom of the stair flight. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight.	Rail only horizontal at bottom	Install handrails on both sides of stairway, mounted 34" to 38" AFF with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4" - 6.25" max with a min gap of 1.5" between handrail and wall	2015 ABAAS Section: 505.10.3  2012 TAS Section: 505.10.3  2010 ADAS Section: 505.10.3		 Note: X = tread depth Figure 505.10.3 Bottom Handrail Extension at Stairs
371	Smith Visitor Center: Smith Visitor Center Building	[30.184006, -97.7249612]	The handrail gripping diameter is noncompliant. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1 1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4 inches minimum and 6 1/4 inches maximum, and a cross-section dimension of 2 1/4 inches maximum.	Handrail too large	Install handrails on both sides of stairway, mounted 34" to 38" AFF with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4" - 6.25" max with a min gap of 1.5" between handrail and wall	2015 ABAAS Section: 505.7  2012 TAS Section: 505.7  2010 ADAS Section: 505.7		
372	Smith Visitor Center: Smith Visitor Center Building	[30.1840311 , -97.7248992]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Accessible entry- 14# and 13# push, one closes fast	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1  2010 ADAS Section: 404.2.9, 404.2.8.1		


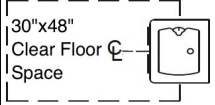

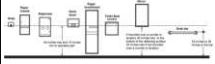
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
373	Smith Visitor Center: Smith Visitor Center Building	[30.1840333 , -97.7249105]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. All interior doors must be maintained so that the operating pressure does not exceed 5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or	Main entry- 12# and 13# push, one closes fast, 3" CIL, CIL to get to door	For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25" For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


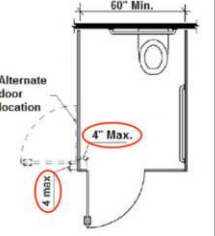

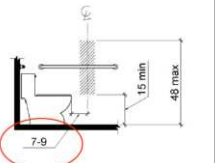


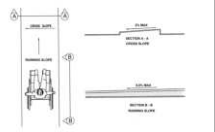
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			ground. The bottom 10 inches on the push side must be smooth and free of obstructions (hold open devices). Opening hardware must be mounted between 30 and 44 inches above the floor or ground. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches (1090 mm) maximum above the finish floor. EXCEPTION: Vision lights with the lowest part more than 66 inches (1675 mm) from the finish floor or ground shall not be required to comply with 404.2.11.					
374	Smith Visitor Center: Smith Visitor Center Building	[30.1839596 , -97.724918 2]	There is no ISA at this entrance. In existing buildings and facilities where not all entrances are accessible, entrances to buildings and facilities that are accessible to and usable by persons with disabilities shall be identified with an International Symbol of Accessibility (ISA). Typically this is 6 inches by 6 inches in size.	Accessible entries lack ISA symbol	Mount signage at entrance designating it as accessible	2015 ABAAS Section: F216.6  2012 TAS Section: 216.6  2010 ADAS Section: 216.6		
375	Smith Visitor Center: Smith Visitor Center Building	[30.1839875 , -97.724907 5]	The entrance is not accessible and is missing signage. An identification sign identifying that this entrance is not accessible and directional signage pointing in the direction to the accessible entrance is required. When a directional sign is required, it should be located to minimize backtracking. In some cases, this could mean locating a sign at the beginning of a route, not just at the inaccessible entrances to a building.	Front entry has step, lacks directional signage	Mount signage at inaccessible entrances directing patrons in wheelchairs to accessible entrance. CIL cost included in separate finding	2015 ABAAS Section: F216.6  2012 TAS Section: 216.6  2010 ADAS Section: 216.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
376	Smith Visitor Center: Smith Visitor Center Building	[30.1839689 , -97.7249397]	The tactile EXIT sign is missing at the door. Wall signs identifying exits shall have characters raised 1/32 inch minimum and shall be uppercase characters a minimum of 5/8 inch and a maximum of 2 inches high. Braille shall be placed directly below the tactile characters; flush left or centered. Signs shall be located a minimum of 48 inches above the floor, measured from the baseline of the lowest tactile characters and 60 inches maximum above the finish floor or ground surface, measured from the baseline of the highest tactile characters. Where a tactile sign is provided at a door, the sign shall be located on the latch side. Where a tactile sign is provided at double doors the sign shall be located to the right of the right-hand door. Where there is no wall space at the latch side of a single door or at the right side of double doors, signs shall be located on the nearest adjacent wall.	Exit signs overhead illuminated only	Mount compliant signage at all doors along the egress route	2015 ABAAS Section: F216.4.1  2012 TAS Section: 216.4.1  2010 ADAS Section: 216.4.1		
377	Smith Visitor Center: Smith Visitor Center Building	[30.1838766 , -97.7247667]	Changes in level greater than 1/2 inch (13 mm) high shall be ramped, and shall comply with 405 or 406.	Lacks curb ramp at drop off area, only transition located at head of parking access aisle	Create a curb ramp to be max running slope 8.33%, max cross slope 2.08%, having a top landing as wide as the ramp and 36" deep and side flares with a max slope 10% along the AR where curbs are present.	2015 ABAAS Section: 303.4  2012 TAS Section: 303.4  2010 ADAS Section: 303.4		


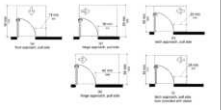


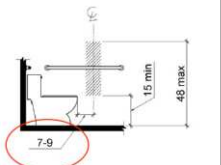
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
378	Smith Visitor Center: Smith Visitor Center Building	[30.1838559 , -97.7247687]	The passenger drop-off and loading area is not accessible. Drop-off and loading zone shall provide an access aisle at least 60 inches wide and 20 feet long adjacent and parallel to the vehicle pull-up space. The vehicular pull-up space must be 96 inches wide minimum and 20 feet long minimum. Access aisles shall adjoin an accessible route and shall not overlap the vehicular way. Vehicle standing spaces and access aisles shall be level with surface slopes not exceeding one unit vertical in 48 units' horizontal (2-percent slope) in all directions. If there are curbs between the access aisle and the vehicle pull-up space, a curb ramp shall be provided. Each passenger drop-off and loading zone designed for persons with disabilities shall be identified by a reflectorized sign permanently posted immediately adjacent to and visible from the passenger drop-off or loading zone stating "Passenger Loading Zone Only" and including the International Symbol of Accessibility, in white on dark blue background.	Drop off area lacks aisle	Designate an access aisle for the passenger drop off area by painting an aisle that is 60" wide and 20' long	2015 ABAAS Section: 503.1, 503.2, 503.4  2012 TAS Section: 503.1, 503.2, 503.4  2010 ADAS Section: 503.1, 503.2, 503.4		
379	Smith Visitor Center: Smith Visitor Center Building	[30.1839596 , -97.7249612]	The spout is not positioned correctly from the vertical support. The spout shall be located 15 inches minimum from the vertical support and 5 inches maximum from the front edge of the unit, including bumpers.	15.5" to edge to post, 21" from post to wall	Remount or replace fountain to provide 15" from vertical support to the spout	2015 ABAAS Section: 602.5  2012 TAS Section: 602.5  2010 ADAS Section: 602.5		


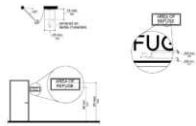

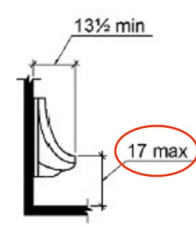

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
380	Smith Visitor Center: Smith Visitor Center Building	[30.1839875 , -97.724886 1]	The clear floor space required at accessible drinking fountains is not centered on the low fountain. At "hi-low" type drinking fountains, the 30 inch by 48 inch clear floor space must be centered on the "low" fountain.	13" from centerline to face of post	Remount fountain to provide centered clear floor space. Cost include in previous finding	2015 ABAAS Section: 602.2 2012 TAS Section: 602.2 2010 ADAS Section: 602.2		
381	Smith Visitor Center: Smith Visitor Center Building	[30.1839318 , -97.724896 8]	The drinking fountain projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hi and low bowls both project 18 inches	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		


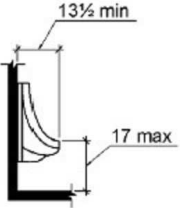

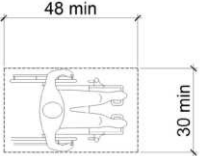
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
382	Upper Falls: Upper Falls Men's Restroom	[30.1835335 , -97.727334 9]	The clear floor space required at accessible drinking fountains is not centered on the low fountain. At "hi-low" type drinking fountains, the 30 inch by 48 inch clear floor space must be centered on the "low" fountain.	Bowl centerline about 12.5" from support	Remount fountain to provide centered clear floor space.	2015 ABAAS Section: 602.2  2012 TAS Section: 602.2  2010 ADAS Section: 602.2		 30"x48" Clear Floor Space
383	Upper Falls: Upper Falls Men's Restroom	[30.1835359 , -97.727340 3]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	71.5" AFF to top of mirror	Raise mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
384	Upper Falls: Upper Falls Men's Restroom	[30.1835365 , -97.727336 3]	The self closing faucet controls do not stay open for a minimum of 10 seconds. Faucet controls and operating mechanisms shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist. The force required to activate controls shall be no greater than 5 lb. Lever-operated, push-type and electronically controlled mechanisms are examples of acceptable designs. Self-closing valves are allowed if the faucet remains open for at least 10 seconds.	Stays on for 1 second	Adjust timing of sink faucets to remain on for min 10 seconds	2015 ABAAS Section: 606.4  2012 TAS Section: 606.4  2010 ADAS Section: 606.4		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
385	Upper Falls: Upper Falls Men's Restroom	[30.1835418 , -97.727330 9]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	4.5" panel	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet	2015 ABAAS Section: 604.8.1.2  2012 TAS Section: 604.8.1.2  2010 ADAS Section: 604.8.1.2		
386	Upper Falls: Upper Falls Men's Restroom	[30.183539, -97.727330 9]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	5" to centerline of dispenser	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
387	Upper Falls: Upper Falls Men's Restroom	[30.1835381 , -97.727332 2]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.6% slope	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3	 	

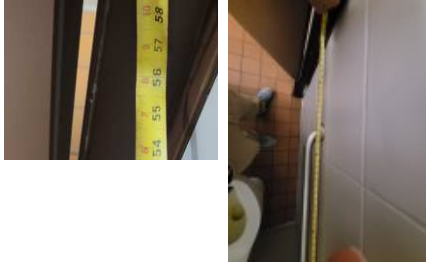
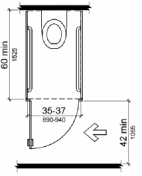





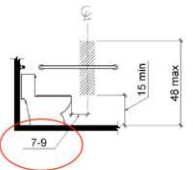

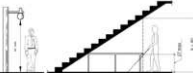
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
388	Upper Falls: Upper Falls Women's Restroom	[30.1835343 , -97.727327 6]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Women's RR- 53" back pull side	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
389	Upper Falls: Upper Falls Women's Restroom	[30.1835401 , -97.727331 6]	The stall door fails to comply with some of the door requirements. The stall door must be self-closing.	Stall door does not fully self-close	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
390	Upper Falls: Upper Falls Women's Restroom	[30.183541, -97.727329 5]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Dispenser too close	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		


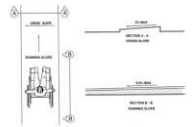

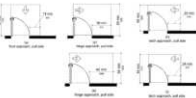

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
391	Picnic Area: Picnic Area Men's Restroom	[30.1829766 , -97.7233518]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks tactile characters and Braille	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character. Cost included in separate finding	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
392	Picnic Area: Picnic Area Men's Restroom	[30.1829708 , -97.7233518]	The rim of the urinal is too high. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	Rim at 18.5" above finish floor	Lower urinal so that rim height is max 17" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
393	Picnic Area: Picnic Area Men's Restroom	[30.1829625 , -97.7233478]	The urinal is located in an area that does not provide the required clear floor space for a front approach. The surrounding elements of a urinal must provide a minimum of 30 by 48 inches of clear floor space for a front approach.	27" wide at urinal (lacks 30" clear)	Relocate privacy wall at urinal to provide 30" CFS	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		


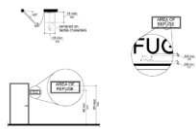
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
394	Picnic Area: Picnic Area Men's Restroom	[30.1829689 , -97.723353 2]	The bowl of the urinal does not extend out from the wall far enough. Urinals must project a minimum of 13-1/2 inches measured from the outer face of the urinal rim to the back of the fixture and be a maximum of 17 inches above the floor.	11.5" dimension to edge of bowl	Replace urinal with one having a 13.5" min depth mounted at max 17" to rim with flush controls max 48" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
395	Picnic Area: Picnic Area Men's Restroom	[30.1829526 , -97.723357 2]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Trash can blocks dryer clear floor space	Remove, or relocate storage in CFS at fixtures and operable parts along the AR	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
396	Picnic Area: Picnic Area Men's Restroom	[30.1829657 , -97.723351 8]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19" into dryer clear floor space	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
397	Picnic Area: Picnic Area Men's Restroom	[30.1829741 , -97.723355 2]	There are not enough accessible toilet compartments. The room contains 4 toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lacks accessible toilet compartment (1 ambulatory stall, 1 standard stall, 2 fixtures)	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
398	Picnic Area: Picnic Area Men's Restroom	[30.1829723 , -97.723353 2]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	56.5" deep (lacks minimum stall depth)	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
399	Picnic Area: Picnic Area Men's Restroom	[30.1829664 , -97.723351 8]	The stall door fails to comply with some of the door requirements. The stall door must be self-closing.	Stall lacks self-closing door	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


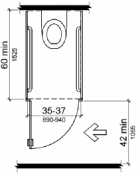

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
400	Picnic Area: Picnic Area Men's Restroom	[30.1829684 , -97.7233505]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" long bars (lacks required grab bar length )	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
401	Picnic Area: Picnic Area Men's Restroom	[30.182979, -97.7233552]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	2" from edge of bowl to centerline of toilet paper dispenser	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
402	Picnic Area: Picnic Area Men's Restroom	[30.1829723 , -97.7233532]	The dryer projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer protrudes 8"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		



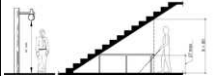

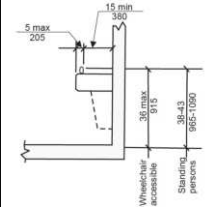
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
403	Picnic Area: Picnic Area Men's Restroom	[30.1829736 , -97.723356 5]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.3% slope at drain	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
404	Picnic Area: Picnic Area Men's Restroom	[30.1829782 , -97.723357 9]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Clearance at door restricted by stone wall	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		
405	Picnic Area: Picnic Area Women's Restroom	[30.1829727 , -97.723349 2]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%.	2.5% slope in door maneuvering clearance	For all doors along the public circulation route, correct slope in door clearance to max 2.08%.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

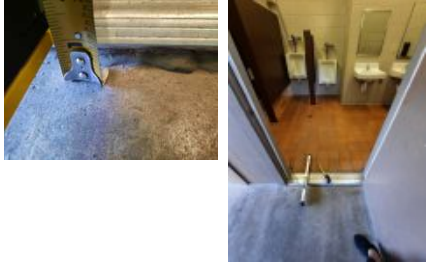
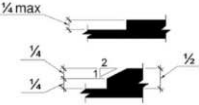

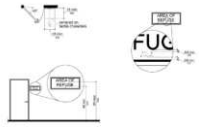
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
406	Picnic Area: Picnic Area Women's Restroom	[30.1829668 , -97.723363 9]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	10# push	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1  2010 ADAS Section: 404.2.9, 404.2.8.1		
407	Picnic Area: Picnic Area Women's Restroom	[30.1829668 , -97.723363 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


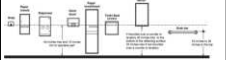

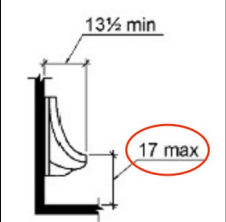




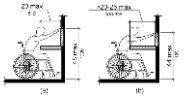

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
408	Picnic Area: Picnic Area Women's Restroom	[30.1829746 , -97.723347 8]	The baby changing table is not compliant. Baby changing tables are work surfaces. If fixed or built-in baby changing tables are provided, at least 5%, but not less than one, must comply with TAS 902 based TAS 226.1. Baby changing tables cannot violate the protruding object requirements in either an open or closed position since either position is a potential hazard for persons with visual impairments. Baby changing tables are not prohibited from being located in wheelchair accessible toilet compartments; however, the minimum space required for the compartment cannot be obstructed by the baby changing table in either an open or closed position. The clear floor space required for a baby changing table may overlap the water closet clearance since baby changing tables are considered convenience "fixtures" based on Advisory 604.8.1.1. The overlap is applicable only to the clear floor space and not to actual table itself. Baby changing tables must be dispersed throughout a space, however, an additional baby changing table is not required in a common use area of a toilet or bathing room when the only baby changing table is located in a toilet compartment.	Baby changing table protrudes 19" in open position	Relocate baby changing table to eliminate protrusion when in the open position.	2012 TAS Section: 226.1, 902.3, 604.3.2, 204.1, 226.1 Advisory, 226.2, 307.1, 604.8.1.1 Advisory, 902.1, 902.1 Advisory, 902.2		
409	Picnic Area: Picnic Area Women's Restroom	[30.1829701 , -97.723363 9]	There are not enough accessible toilet compartments. The room contains 4 toilet compartments. A minimum of 1 must be wheelchair accessible .	Ambulatory only, lacks accessible toilet compartment (1 ambulatory stall, 3 standard stalls)	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		


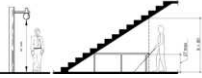

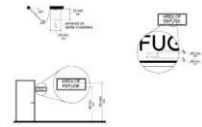
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
410	Picnic Area: Picnic Area Women's Restroom	[30.1829729 , -97.723354 5]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	57" deep stall	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
411	Picnic Area: Picnic Area Women's Restroom	[30.1829625 , -97.723367 9]	The stall door fails to comply with some of the door requirements. The stall door must be self-closing.	Lacks self-closing door	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		


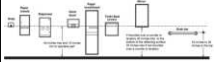

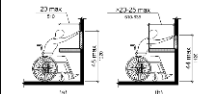
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
412	Picnic Area: Picnic Area Women's Restroom	[30.1829766 , -97.723362 6]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	Side grab bars 24"	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
413	Picnic Area: Picnic Area Women's Restroom	[30.1829715 , -97.723357 2]	The dryer projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer protrudes 8"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
414	Picnic Area: Picnic Area Women's Restroom	[30.1829636 , -97.723359 5]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	Non-compliant drinking fountain	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2  2012 TAS Section: 211.2  2010 ADAS Section: 211.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
415	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851662 , -97.7222226]	The threshold is greater than 1/2 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise.	CIL of 1" at beveled threshold	For all doors along the public circulation route, replace thresholds at exterior doors with ADA thresholds	2015 ABAAS Section: 404.2.5  2012 TAS Section: 404.2.5  2010 ADAS Section: 404.2.5		
416	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.185153, -97.7222186]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	12.5# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
417	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851486 , -97.722232]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Lacks accessible signage	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


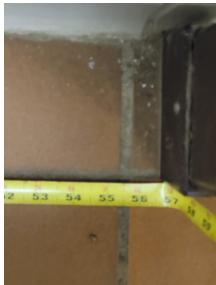

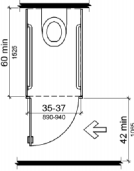

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
418	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851532 , -97.722221 3]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Bottom edge of reflecting surface is 40.25" AFF and top edge reflecting surface is 69.5" AFF	Replace mirror so reflective surface is max 40" and top is 74" AFF min.	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
419	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851612 , -97.722226 6]	The rim of the urinal is too high. Wall-hung urinals must be provided with an elongated rim projecting a minimum of 13 1/2 inches from the wall and a maximum of 17 inches above the floor.	Lower of 2 urinals is mounted 18" AFF	Lower urinal so that rim height is max 17" AFF	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		
420	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851571 , -97.722217 3]	The urinal is located in an area that does not provide the required clear floor space for a front approach. The surrounding elements of a urinal must provide a minimum of 30 by 48 inches of clear floor space for a front approach.	Urinals lack 30" wide CFS	Relocate privacy wall at urinal to provide 30" CFS	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
421	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851603 , -97.722225 3]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	2 of 2 coat hooks exceed reach range	Lower operating mechanisms in RR to max 48" AFF to highest operable part.	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		
422	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851551 , -97.722226 6]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Toilet compartment lacks required dimensions for a wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		


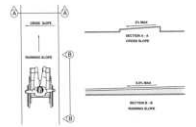
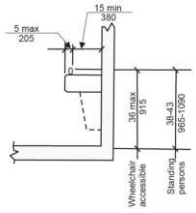

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
423	Homestead Trail Trailhead : Lower Falls Men's Restroom	[30.1851677 , -97.722219 9]	The dryer projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Hand dryer protrudes 9"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		
424	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851582 , -97.722214 6]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	14# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
425	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851506 , -97.722219 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign. Cost included in separate finding	Sign lacks Braille and tactile characters	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character.	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
426	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851554 , -97.722219 9]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	69.5" AFF to mirror top	Raise mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
427	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851594 , -97.722218 6]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	63" AFF to hook	Lower operating mechanisms in toilet compartment to max 48" AFF to highest operable part	2015 ABAAS Section: 308.2.1, 308.3.2  2012 TAS Section: 308.2.1, 308.3.2  2010 ADAS Section: 308.2.1, 308.3.2		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
428	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851623 , -97.7222173]	There are not enough accessible toilet compartments. The room contains multiple toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks accessible stall, ambulatory stall provided	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
429	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.185155, -97.7222253]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Stall 57" deep	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1	 	
430	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851601 , -97.7222226]	The stall door fails to comply with some of the door requirements. The stall door must have compliant hardware on both sides. The stall door must be self-closing.	Stall lacks self-closing door, outside hardware requires tight pinch	Adjust or replace stall door to be self-closing Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		



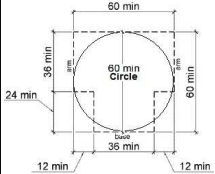

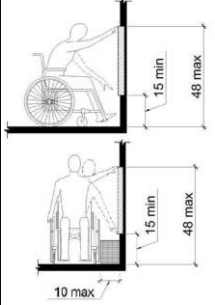
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
431	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851584 , -97.722213 2]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	Missing bar on one side, 24" long bar provided	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" AFF	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
432	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851588 , -97.722225 3]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Dispenser 5" to centerline	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
433	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851546 , -97.722225 3]	The dryer projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Dryer protrudes 8"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
434	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.185159, -97.722226 6]	The accessible route contains running slopes greater than 5 percent and cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk exceeds 1 unit vertical in 20 units horizontal (5-percent slope), it must be constructed as ramp. Surface cross slopes must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	2.7% slope at drain	Correct or repair slope to max 5% running and 2.08% cross	2015 ABAAS Section: 403.3  2012 TAS Section: 403.3  2010 ADAS Section: 403.3		
435	Homestead Trail Trailhead : Lower Falls Women's Restroom	[30.1851606, -97.722216 6]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	Non-compliant drinking fountain, lacks knee space	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2  2012 TAS Section: 211.2  2010 ADAS Section: 211.2		
436	Homestead Trail Trailhead : Homestead Trail Trailhead	[30.1888308, -97.720417 3]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Trail lacks firm and stable surface	Replace surface of trail with one that is firm and stable as a smart practice.	2015 ABAAS Section: 1017.2		

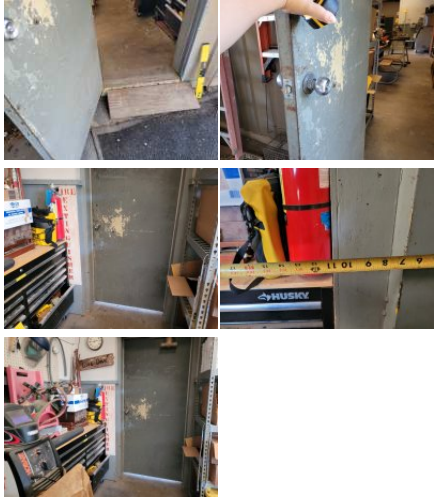
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
437	Homestead Trail Trailhead : Homestead Trail Trailhead	[30.186242, -97.721329]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Homestead Trail Trailhead lacks firm and stable surface, lacks AR to trailhead signs	Repair surface or ORAR to be firm and stable as a smart practice.	2015 ABAAS Section: 1016.2		
438	Homestead Trail Trailhead : Gristmill Spur Trail	[30.1887477, -97.7194968]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Trail surface inaccessible	Replace surface of trail with one that is firm and stable as a smart practice.	2015 ABAAS Section: 1017.2		

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
439	Picnic Trail Trailhead: Picnic Trail Trailhead	[30.1838189 , -97.7226928]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	Lacks AR to Picnic Trail Trailhead sign	Repair surface or ORAR to be firm and stable as a smart practice.	2015 ABAAS Section: 1016.2		
440	Picnic Trail Trailhead: Picnic Trail Trailhead	[30.1838648 , -97.7228316], [30.1837967 , -97.7226854]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Picnic Trail and Trailhead lack firm and stable surface	Replace surface of trail with one that is firm and stable as a smart practice.	2015 ABAAS Section: 1017.2		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
441	Employee Spaces: Maintenance	[30.1848602 , -97.7200178]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	Maintenance door- 5% slope, knob, closes fast	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space. For all doors along the circulation route, replace hardware with lever hardware where indicated For all doors along the circulation route, correct or repair slope at doorway landing to max 2.08% in any direction for level CFS For all doors along the circulation route, inspect, adjust, and maintain closing speed on door closers so that doors do not close to 3" faster than 3 seconds when started at 70 degrees	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		
442	Employee Spaces: Maintenance	[30.1848648 , -97.7200138]	There is insufficient turning space within this room or space. The space required for a wheelchair to make a 180-degree turn is a clear space of 60 inches in diameter or a T-shaped space.	Employee breakroom lacks turning with furniture	Relocate obstacles to create turning space in breakroom	2015 ABAAS Section: 304.3.1, 304.3.2  2012 TAS Section: 304.3.1, 304.3.2  2010 ADAS Section: 304.3.1, 304.3.2		
443	Employee Spaces: Maintenance	[30.1848547 , -97.7200152]	The microwave and coffee maker are positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Microwave and coffee maker are on top of fridge	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1  2012 TAS Section: 308.1  2010 ADAS Section: 308.1		



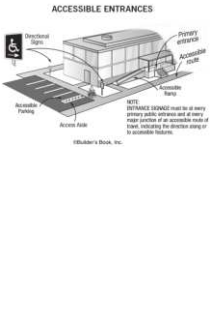


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
444	Employee Spaces: Maintenance	[30.18482, -97.72002]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm).	Break room/office interior- 29.5" wide, desk chair in clearance	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
445	Employee Spaces: Maintenance	[30.184861, -97.71997]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Floor and ground slope shall comply with 404.2.4.4. Maneuvering clearances and required floor and ground slope shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door.	Break room entry- 2.8% slope, closes fast, storage push side	For all doors along the public circulation route, provide required maneuvering clearance and floor or ground slope on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
446	Employee Spaces: Maintenance	[30.184852, -97.7200109]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Shop side exit- large CIL, knob, toolbox push side, 15# push, closes fast, recessed 11" push side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25" For all doors along the public circulation route, repair, provide beveled threshold For all doors along the circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice For all doors along the circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
447	Employee Spaces: Maintenance	[30.1848525 , -97.720001 7]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Staff restroom- sink pull side, 29" wide, knob	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
448	Employee Spaces: Maintenance	[30.1848314 , -97.719983]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	No other restrooms at maintenance, restrooms with improved accessibility elsewhere in park	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1  2012 TAS Section: 603.1  2010 ADAS Section: 603.1		




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
449	Employee Spaces: Maintenance	[30.1848568 , -97.720021 2]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	59" x 80" clearance at toilet	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom	2015 ABAAS Section: F216.8  2012 TAS Section: 216.8  2010 ADAS Section: 216.8		
450	Employee Spaces: Maintenance	[30.1848535 , -97.720014 5]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters, mounted above door	Acquire and mount signage, including Braille and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
451	Employee Spaces: Maintenance	[30.1848494 , -97.720008 5]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	29.5" wide door to work area	For all doors along the circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2015 ABAAS Section: F203.9  2012 TAS Section: 203.9  2010 ADAS Section: 203.9		
452	Employee Spaces: Maintenance	[30.1849419 , -97.720380 6]	There is no accessible route between the buildings. At least one accessible route shall connect accessible buildings, facilities, elements and spaces that are on the same site.	Outbuildings lack AR	Create AR with crushed and compacted stone or similar outdoor material from building to building within the site	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		
453	Employee Spaces: Maintenance	[30.1850564 , -97.720133 9]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 9 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	0 of 9 stalls accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2  2012 TAS Section: 208.2  2010 ADAS Section: 208.2		



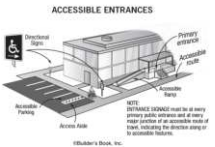
**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**


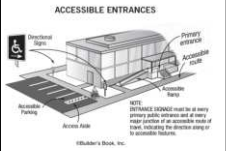

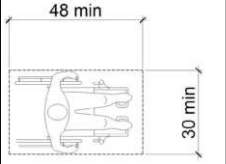
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
454	Employee Spaces: Residences	[30.185712, -97.720599 4]	Element meets all standards and requirements	Asphalt drive, sidewalk connects to entry	None	2010 ADAS Section: N/A		

**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
455	Trails: Trailhead	[30.1836132 , -97.728252 2]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Onion Creek Falls - surface material deteriorated on trail near woods towards picnic area	Resurface trail where deteriorated as a smart practice.	2015 ABAAS Section: 1017.2		
456	Trails: Trailhead	[30.1826242 , -97.728748 4]	36 inches (915 mm) by 48 inches (1220 mm) positioned near the bench with one side of the space adjoining an outdoor recreation access route or trail, as applicable The clear ground space shall not overlap the outdoor recreation access route or trail, or another clear ground space	Onion Creek Trail - No access to bench, dirt	Construct firm, stable, and slip resistant pads at least 36" by 48" adjacent to 20% of benches, and locate along an AR as a smart practice	2015 ABAAS Section: 1011.2, 1011.2.1		
457	Trails: Trailhead	[30.1835042 , -97.72860 09], [30.1841216 , -97.727597 8]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Onion Creek Trail - 10.9% and 6.5% cross slope approaching woods	Correct or repair pathway cross slope to max 2.08% or 5% depending on surface as a smart practice.	2015 ABAAS Section: 1017.2		


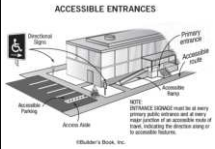
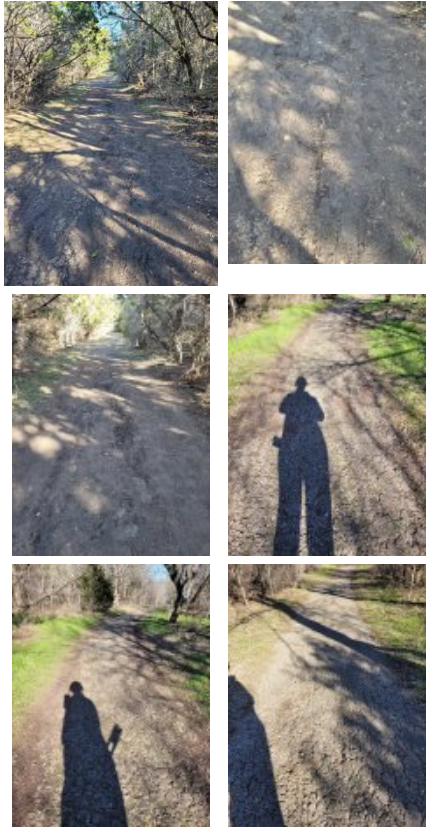
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
458	Trails: Trailhead	[30.177188, -97.725124 8]	Not more than 30 percent of the total length of a trail shall have a running slope steeper than 1:12 (8.33%). The running slope of any segment of a trail shall not be steeper than 1:8 (12%). Where the running slope of a segment of a trail is steeper than 1:20 (5%), the maximum length of the segment shall be in accordance with Table 1017.7.1, and a resting interval complying with 1017.8 shall be provided at the top and bottom of each segment.	Onion Creek Trail - over 20% run slope for 50'	Correct trail running slope to not exceed 8.33% slope for 200' max, 10% for 30' max or 12.5% for 10' with resting spaces on the trail as a smart practice	2015 ABAAS Section: 1017.7.1		
459	Trails: Trailhead	[30.1835725, -97.726149 4]	There is no accessible route to the benches. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Onion Creek Trail - No accessible route to 2 benches on trail	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the benches	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		 <p><b>ACCESSIBLE ENTRANCES</b></p> <p>NOTE: DISTANCE INDICED must be at every entry point and entrance and at every major portion of an accessible route of travel, including the accessible areas of accessible facilities.</p> <p>Illustration © 2004, ADA</p>



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
460	Trails: Trailhead	[30.1837271 , -97.727946 5]	There is no accessible route to the picnic tables At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No accessible route to picnic tables and grills - 0 of 60 picnic tables accessible	Create an accessible route with crushed stone or other outdoor material from parking or walkway to picnic tables	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		
461	Trails: Trail Elements	[30.1752702 , -97.725656 6]	The element is not accessible because there is not adequate clear floor space for an approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	At fork on onion creek trail - no CFS, left of fork bench same issue	Create AR with crushed and compacted stone or similar outdoor material from trail to the element	2015 ABAAS Section: 305.3  2012 TAS Section: 305.3  2010 ADAS Section: 305.3		

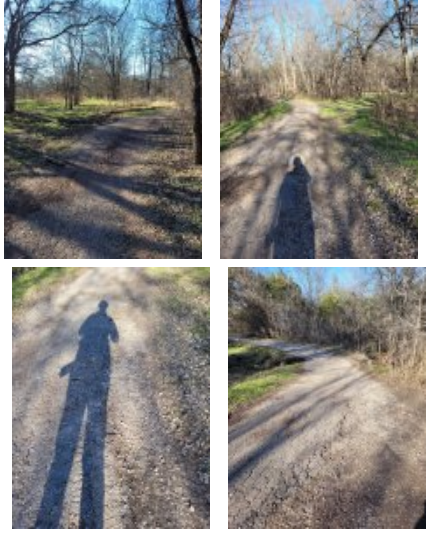



**McKinney Falls State Park - 5808 McKinney Falls Pkwy Austin, TX 78744**



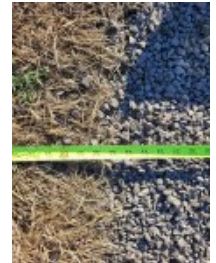




Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
462	Trails: Trail Elements	[30.1819022 , -97.725314 5]	There is no accessible route to the horse stables At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	No AR to stables	Create an accessible route with crushed stone or other outdoor material from parking or walkway to stables	2015 ABAAS Section: F206.2.2  2012 TAS Section: 206.2.2  2010 ADAS Section: 206.2.2		
463	Trails: Trail Surface	[30.1754405 , -97.725527 1]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Onion creek, left at fork from head at site 84 - turns to Mud for est. 50 ft. directly after fork, deteriorated for most, very broken asphalt at curb, at curve parallel to site 25. 29" pothole, deterioration throughout. mud past second bench. cement creek pass before road - 5" gap before. deteriorating path after cement slab	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice Frequently maintain trail surface in identified washout areas to assure CIL's remain 2" or less and gaps are filled as a smart practice	2015 ABAAS Section: 1017.2		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								
464	Trails: Trail Surface	[30.1803649 , -97.722439 9]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Onion creek, parallel to park entry - deterioration surface, deteriorated past dog bags by HQ, Mud by site 35, past stables, at electrical stuff there is deterioration, at fork - deterioration	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice Frequently maintain trail surface in identified washout areas to assure CIL's remain 2" or less and gaps are filled as a smart practice	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								
465	Trails: Trail Surface	[30.182699 , -97.72547 35], [30.1832127 , -97.725618 3]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	After stable, past fork - 5.5% consistent until road	Correct or repair pathway cross slope to max 2.08% or 5% depending on surface as a smart practice.	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
466	Trails: Trail Surface	[30.1816698 , -97.725454]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Trail by stables - path on main road, consistent cross slope, by stable, 3%, only openings for path are at parallel trails, 51" width for entire trail. loose gravel surface. by upper falls, same path 3.5% slope	Correct trail cross slopes to max 2.08% as a smart practice. Widen trail to 60" min or provide 60" wide resting intervals every 1000' as a smart practice. Resurface trail to with surface that is firm and stable as a smart practice.	2015 ABAAS Section: 1017.2		



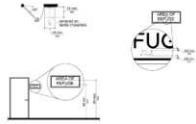
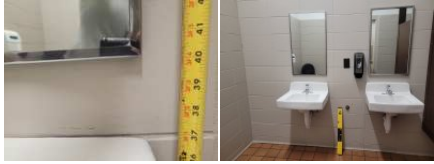
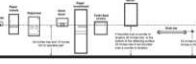
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
467	Trails: Trail Surface	[30.1826316 , -97.725483 1]	Trails with a clear tread width less than 60 inches (1525 mm) shall provide passing spaces complying with 1017.4 at intervals of 1000 feet (300 m) maximum. Where the full length of a trail does not fully comply with 1017, a passing space shall be located at the end of the trail segment that fully complies with 1017. Passing spaces and resting intervals shall be permitted to overlap	Road side trail is 51" consistently for entire path. 45" width on same path on road along upper falls	Create 60" level turning space every 1000' along the trail	2015 ABAAS Section: 1017.4	  	
468	Trails: Trail Surface	[30.1771152 , -97.725134 8]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	3.7% slope at entry to Onion Creek trailhead by site 84, 5.1% six yards from trailhead by 84, 22% on the path where it turns to deterioration after entry at 84. left at fork, after mud - 4.1% slope. consistent, 3% before turn in path after mud, 6.8% parallel to site 25 on map, 4.7% by dog bags near HQ, 6.3% continuously on path by yellow lid septic all the way to the road. after stable ruins - 15.5%	Correct or repair pathway cross slope to max 2.08% or 5% depending on surface as a smart practice.	2015 ABAAS Section: 1017.2	   	


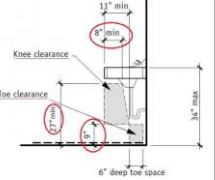

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								


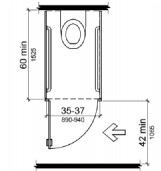

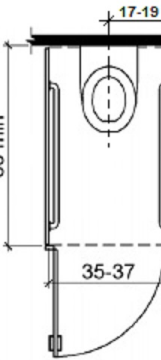

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								

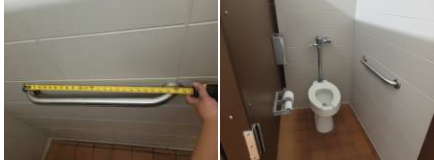

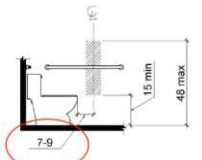

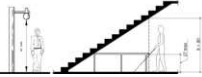



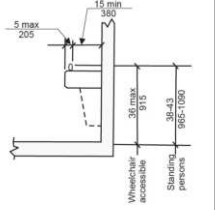

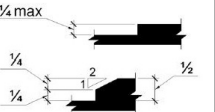

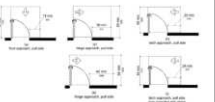
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
469	Trails: Trail Surface	[30.1840807, -97.7254674], [30.1843151, -97.7256961]	Not more than 30 percent of the total length of a trail shall have a running slope steeper than 1:12 (8.33%). The running slope of any segment of a trail shall not be steeper than 1:8 (12%). Where the running slope of a segment of a trail is steeper than 1:20 (5%), the maximum length of the segment shall be in accordance with Table 1017.7.1, and a resting interval complying with 1017.8 shall be provided at the top and bottom of each segment.	Slope to upper falls by Smith building, est. 50 feet - middle 13%, 15.5% at top, 16.1% at bottom.	Correct trail running slope to not exceed 8.33% slope for 200' max, 10% for 30' max or 12.5% for 10' with resting spaces on the trail as a smart practice	2015 ABAAS Section: 1017.7.1		

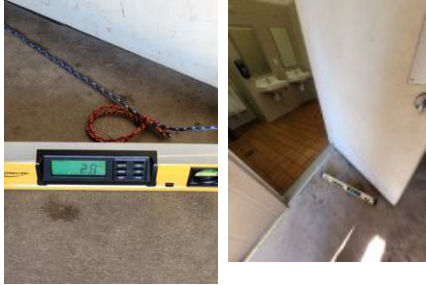
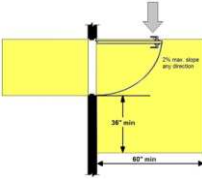

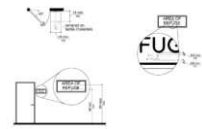
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
470	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811638 , -97.7288209]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 3 inches from the latch, measured to the leading edge of the door. Exterior doors are recommended to be maintained at 8.5 #f as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater.	Women's RR- 11#, closes fast, 47" back pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers For all doors along the public circulation route, inspect, adjust, and maintain 8.5 #f to open exterior doors as a smart practice	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
471	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.181146, -97.7288343]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Sign lacks Braille and raised characters, mounted above door	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
472	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811642 , -97.7288262]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Mirror mounted 40.25" AFF	Lower mirror so reflective surface is max 40" AFF	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		

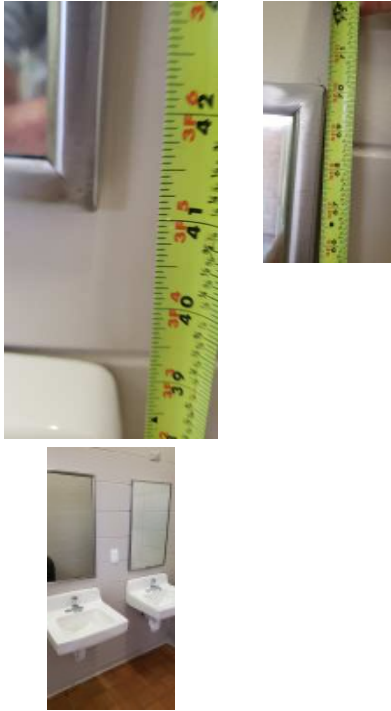
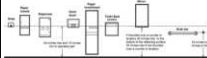

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
473	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811703 , -97.728826 2]	Knee clearance at 27 inches off the floor is not 8 inches minimum deep. The knee clearance, measured from the bottom of the apron or the outside bottom edge of the lavatory, must be 27 inches at a point located 8 inches back from the front edge and continuing to 11 inches minimum in depth at 9 inches above the floor. The top of the lavatory rim may be no higher than 34 inches.	Low bowl, lacks knee clearance	Raise sink to provide 27" knee clearance that is a min 8" deep	2015 ABAAS Section: 306.3.1, 306.3.2, 306.3.3, 306.3.4 , 306.3.5  2012 TAS Section: 306.3.2, 306.3.3, 306.3.4, 306.3.5, 306.3.1  2010 ADAS Section: 306.3.3, 306.3.2, 306.3.4, 306.3.5, 306.3.1		
474	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811699 , -97.728822 9]	There are not enough accessible toilet compartments. A minimum of 1 must be wheelchair accessible .	ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
475	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811682 , -97.728819 5]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	37.5" width, 57" depth	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1		
476	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811626 , -97.728828 9]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	19.25" from partition side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		
477	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811691 , -97.728816 8]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Stall door not fully self-closing	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2  2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2  2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		




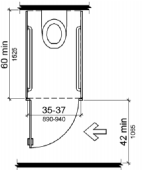
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
478	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811568 , -97.728822 2]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	24" bar, one side only	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" aff	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		
479	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.181164, -97.728830 2]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	toilet paper mounted too close to the front of the toilet	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7  2012 TAS Section: 604.7  2010 ADAS Section: 604.7		
480	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811699 , -97.728822 2]	The hand dryer projects more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	hand dryer protrudes 6.5"	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2		


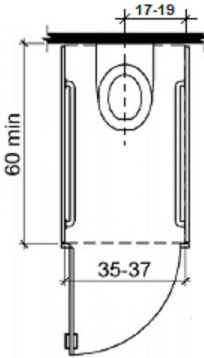

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
481	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.1811667 , -97.728840 8]	There are not enough drinking fountains. When drinking fountains are provided, a minimum of one must be designed for wheelchair users and one must be designed for standing persons unless a single fountain meets the requirements for both.	drinking fountain inaccessible, lacks knee clearance	Replace drinking fountain with hi-lo bowl	2015 ABAAS Section: F211.2  2012 TAS Section: 211.2  2010 ADAS Section: 211.2		
482	Amphitheater Restrooms: Amphitheater Women's Restroom	[30.181162, -97.728820 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	.5" CIL and 1" CIL at women's restroom	Repair or reset pavers to eliminate CIL	2012 TAS Section: 303.2, 303.3  2010 ADAS Section: 303.2, 303.3		
483	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811654 , -97.728820 9]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Stone wall blocks clearance at door	Relocate storage, furniture and other obstacles to create 60" maneuvering clearance around door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4  2012 TAS Section: 404.2.4.4, 404.2.4.1  2010 ADAS Section: 404.2.4.4, 404.2.4.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
484	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811599 , -97.728823 5]	The landing at the door does not have a compliant landing. Doors with an approach from the hinge side must have a landing on the pull side that is a minimum of 60 inches in depth perpendicular to the door in a close position by a minimum width dimension of 36 inches plus the door width. The additional 36 inches must extend past the door on the latch side. The entire landing must be free of obstructions and must be flat (2% max. slope is considered flat in any direction).	2.8% slope	For all doors along the public circulation route, correct or repair slope at doorway landing to max 2.08% in any direction for level CFS	2015 ABAAS Section: 404.2.4.1  2012 TAS Section: 404.2.4.1  2010 ADAS Section: 404.2.4.1		
485	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811606 , -97.728814 2]	Exterior doors exceed 8.5 lbs of force to open; fire doors shall have a minimum opening force allowable by the appropriate administrative authority	9# push	Inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice.	2010 ADAS Section: 404.2.9		
486	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811547 , -97.728824 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	signage above door, lacks Braille	Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6  2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6  2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
487	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811561 , -97.7288168]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	bottom of mirror mounted 49.5" AFF, top of mirror 69.5" AFF	Replace mirror mount to max 40" AFF to the bottom reflective surface and 74" to the top.	2015 ABAAS Section: 603.3  2012 TAS Section: 603.3  2010 ADAS Section: 603.3		
488	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811586 , -97.7288289]	The urinal is located in an area that does not provide the required clear floor space for a front approach. The surrounding elements of a urinal must provide a minimum of 30 by 48 inches of clear floor space for a front approach.	27" width	Relocate or add a urinal in a location that provides 30" X 48" CFS for a forward approach	2015 ABAAS Section: 605.2  2012 TAS Section: 605.2  2010 ADAS Section: 605.2		



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
489	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811679 , -97.728822 2]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	lacks wheelchair accessible stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1  2012 TAS Section: 213.3.1  2010 ADAS Section: 213.3.1		
490	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811546 , -97.728831 6]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	57" depth	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1  2012 TAS Section: 604.8.2.1  2010 ADAS Section: 604.8.2.1	 	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
491	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811584 , -97.728830 2]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	20" from side wall to centerline	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1  2012 TAS Section: 604.9.1  2010 ADAS Section: 604.9.1		
492	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811624 , -97.728819 5]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	grab bar 24" in length	Replace or add side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" aff	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4  2012 TAS Section: 609.4, 609.3, 604.8.2.3  2010 ADAS Section: 609.3, 609.4, 604.8.2.3		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
493	Amphitheater Restrooms: Amphitheater Men's Restroom	[30.1811617 , -97.728823 5]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	hand dryer protrudes 9" from wall	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2  2012 TAS Section: 307.2  2010 ADAS Section: 307.2	