

Access Audit Site Report



Meridian State Park

173 Park Road #7

Meridian, TX 76665

Accessibility Evaluation

Inspection Date: 01/19/2022

Inspectors: Tanya Scheibe

Prepared By

WT Group

Engineering with Precision, Pace & Passion.

(224) 293 - 6451

www.wtengineering.com

Table of Contents

Cover Letter	3
MERIDIAN STATE PARK PROGRAM REPORT 202301	5
Findings	13
Exterior	13
Headquarters Building	22
Park Site	33
Cedar Ridge Campground	35
Cottonwood Cove Campground	36
Crosstimbers Campground	39
Juniper Ridge Campground	54
Lakeside Campground	74
Shinnery Ridge West Campground	90
Trails	91
Maintenance	95

July 28, 2023

Jessica Burke, ADA Coordinator
Support Resources
Texas Parks and Wildlife Department
4200 Smith School Road
Austin, TX 78744

Dear Jessica,

Thank you for the opportunity to be of service to you by performing an accessibility evaluation for the Meridian State Park located at 173 Park Road #7, Meridian, TX 76665. The facility was inspected on 01/19/2022.

We recommended that all barriers that are identified in this evaluation recommended in one of the phases below, be removed as soon as possible. A transition plan should be developed to assist in planning the removal of all barriers. To help with this, we have identified all barriers on a finding by finding basis with a phase identifier as follows:

1 (Phase 1): Should be completed immediately. This category includes findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat.

2 (Phase 2): Should be completed as soon as possible. Includes findings that would remove barriers to the greatest number of people to your goods and services and findings new to the technical standards such as recreation elements

3 (Phase 3): Should be completed as soon as possible, but there may be other items that will provide greater access to persons with disabilities. This category includes findings that have a high financial impact on the entity, are subject to standards not yet final, or involve a partner entity.

4 (Option): Not necessary to complete, because other sites exist that meet Title II requirements for program access, or retrofit is technically infeasible, or variance is a construction tolerance.

5 (Smart Practice): Should be completed but not necessarily required. This category includes findings and or elements that were in compliance with previous editions of the codes and standards but have since changed. This category also includes techniques or elements that are not a part of the federal or state requirements, but are suggested in advisory language, or have been successfully implemented by other entities. Generally, these items are easily modified to provide the greatest degree of access as well as compliance with the most current codes and standards.

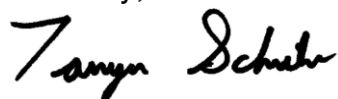
Periodic maintenance to ensure continued accessibility is essential in providing a safe and usable environment. Parking lot markings, signage, door opening pressures, and maintaining clear floor space at doors and other elements and fixtures, available to the public, must be part of an ongoing maintenance schedule.

If you have any questions regarding this report or would like to schedule a meeting with myself and your architect, attorney, or contractor, please feel free to contact me.

Legend of Abbreviations:

AFF... Above the finished floor
AGL... Above Ground Level
AR... Accessible Route
CIL... Change in Level
CFS... Clear Floor Space
EPC... Elevated Play Component
GLPC... Ground Level Play Component

Sincerely,



Tanya Scheibe, RAS #1369

**TEXAS PARKS AND WILDLIFE DEPARTMENT
MERIDIAN STATE PARK**

**AMERICANS WITH DISABILITIES ACT COMPLIANCE INITIATIVE
PROGRAM AND POLICY REPORT**

JULY 28, 2023

INTRODUCTION

The Texas Parks and Wildlife Department (TPWD) is subject to the many requirements of the Americans with Disabilities Act (ADA). To assist it in meeting those requirements, TPWD retained The WT Group, LLC (WTG) Accessibility Practice in 2021.

Title II of the ADA applies to TPWD sites, along with 89,000 other units of state and local government. WTG has a broad scope of work that matches the ADA requirements found in title II. It includes:

- Schedule and conduct project management meetings;
- Conduct access audits of 89 sites, including Meridian State Park;
- Prepare a site report that describes deficits at Meridian State Park, and suggests solutions to those deficits;
- Provide guidance regarding the programs or opportunities Texans can enjoy at Meridian State Park;
- Conduct community engagement events to determine the access preferences and priorities of Texans who visit Meridian State Park;
- Provide a Meridian State Park Transition Plan that identifies deficits, notes solutions, identifies the officer responsible for barrier removal, and notes the phase or timing of barrier removal;
- Provide a GIS shapefile regarding the accessibility of Meridian State Park;
- Provide a method of tracking barrier removal at Meridian State Park; and
- Report to TPWD leadership and stakeholders.

THIS REPORT

This report addresses program and policy advice, and then the WTG observations of deficits at Meridian State Park. Other deliverables are provided under separate cover.



What is a Program?

A unit of state or local government is required to make the “programs” it offers accessible to people with and without disabilities. The term “program” is broadly defined as an opportunity made available by the state to the public, and the term public includes both people with and without disabilities. As an example, if a state park offers camping it must make certain that some campsites are of an accessible design.

The number to be made accessible is called scoping and it is usually a percentage or ratio of the similar sites. For example, if a state park has outdoor constructed features such as grills, fire pits, and benches, it must make 20% of an accessible design. Those 20% accessible must be dispersed throughout the park.

In an ADA context, “programs” at a state park or state natural area include but are not limited to:

Hiking	Fishing
Camping	Bird Watching
Swimming	Playgrounds
Lodging	Beaches
Boating	Interpretive activities
Parking	Visitor Centers
Trams	Picnicking
Sports fields	Viewing areas
Restrooms	Grilling

The Federal and Texas Accessibility Standards

The current Texas Accessibility Standards (TAS 2012) became effective in 2012 after an amendment process. Those Standards are almost identical to the federal 2010 Standards for Accessible Design, and both effectively address parking, entries, restrooms, and other typical building elements. They also address playgrounds, boating and fishing areas, and sports fields and courts. They do not however address some of the assets at Meridian State Park. Trails, campsites, and picnic areas are not yet a final and enforceable state or federal standard.

That will change at the end of 2023 or early 2024. The Texas Department of Licensing and Regulation (TDLR) has signaled its intent to adopt the pending federal guidance for key outdoor assets integral to TPWD sites like Meridian State Park. This includes trails, beaches, campsites, picnic areas, viewing areas, and constructed park assets like grills, fire pits, and benches.

In discussing the Standards, it is important to use the correct definition of park assets. Most definitions are found in TAS 2012 at section 106. As noted above, TDLR plans to add the pending federal guidance regarding some outdoor areas to TAS. It is important to remember that the Standards set the floor, not the ceiling. Making a slope more gentle, or a route wider, is always a smart practice with universal design benefits.

Some selected definitions of park assets common to TPWD are noted below.

- **Trail:** A pedestrian route developed primarily for outdoor recreational purposes. A pedestrian route developed primarily to connect elements, spaces, or facilities within a site is not a trail.
- **Trailhead:** An outdoor space that is designed by an entity responsible for administering or maintaining a trail to serve as an access point to the trail. The junction of two or more trails or the undeveloped junction of a trail and a road is not a trailhead.
- **Picnic Facility:** A site or portion of a site developed for outdoor recreational purposes that contains picnic units.
- **Picnic Unit:** An outdoor space in a picnic facility used for picnicking that contains outdoor constructed features.
- **Outdoor Constructed Features:** Picnic tables, fire rings, grills, fireplaces, wood stoves, trash and recycling receptacles, water hydrants, utility and sewage hookups, outdoor rinsing showers, benches, and viewing scopes provided at outdoor recreation facilities.
- **Camp Shelter:** A partially enclosed structure that provides campers and hikers cover from weather and that does not contain plumbing fixtures or kitchen appliances. Camp shelters are not transient lodging facilities or residential dwelling units.
- **Camping Facility:** A site or portion of a site developed for outdoor recreational purposes that contains camping units.
- **Camping Unit:** An outdoor space in a camping facility used for camping that contains outdoor constructed features, parking spaces for recreational vehicles, tent pads or tent platforms, or camp shelters.
- **Viewing Area:** An outdoor space developed for viewing landscapes, wildlife, or other points of interest.
- **Boarding Pier:** A portion of a pier where a boat is temporarily secured for the purpose of embarking or disembarking.
- **Boat Launch Ramp:** A sloped surface designed for launching and retrieving trailered boats and other watercraft to and from a body of water.
- **Gangway:** A variable-sloped pedestrian walkway that links a fixed structure or land with a floating structure. Gangways that connect to vessels are not addressed by these Standards.
- **Transition Plate:** A sloping pedestrian walking surface located at the end(s) of a gangway.
- **Play Area:** A portion of a site containing play components designed and constructed for children.
- **Play Component:** An element intended to generate specific opportunities for play, socialization, or learning. Play components are manufactured or natural; and are stand-alone or part of a composite play structure.



Two other key outdoor assets are not included in the definitions. Both are defined below.

- **Beach access routes:** A beach access route (BAR) connects an entry point to the beach to the water, as defined below:
 - At a tidal beach, to the high tide level
 - At a river beach, to the mean high water level
 - At a lake, pond, or reservoir beach, to the normal recreation water level

A BAR can be temporarily placed at a beach for all hours the beach is open, and need not be a permanent fixture.

- **Outdoor Recreation Access Routes (ORAR):** A route that connects outdoor recreation assets at an outdoor recreation site. An ORAR is not a trail.

Conditions for Exceptions at Certain Outdoor Recreation Assets

In developing the scoping and technical requirements for accessibility at beaches, trails, and other outdoor developed areas, a wide net was cast to assure a variety of perspectives. The process involved:

- Officials from states with beaches and trails
- Officials from local entities with beaches and trails
- People with disabilities
- Landscape architects and civil engineers
- Parks and recreation officials

Throughout the process, all agreed that there are times that an existing beach, a new beach, an existing trail, or a new trail cannot meet the technical requirements for accessibility. The belief of regulatory bodies however is that these conditions should arise infrequently. The four conditions for exception are defined and discussed below.

- Section 1019.1.1: ***Compliance is not practicable due to terrain.***

This is best clarified as naturally occurring terrain. It is applicable to both existing trails, and new trails. When locating and designing new trails, making the trail accessible should be a very high priority.

- Section 1019.1.2: ***Compliance cannot be accomplished with the prevailing construction practices.***

This is best clarified as a reference to prohibitions on the use of foreign soil or motorized equipment. As an example, if a trail bed is being carved by TPWD staff and volunteers on their hands and knees, with pick axes, shovels, and hoes, all because of a prohibition on motorized equipment in the park, this exception may apply

- Section 1019.1.3: ***Compliance would fundamentally alter the function or purpose of the facility or the setting.***

This is best clarified as having a clear understanding of the purpose of the asset. A sharply ascending trail in a mountainous West Texas state park may have the intended

use of endurance training. To “flatten” the trail is possible from a design perspective, but the trail then loses its function or purpose.

- Section 1019.1.4: ***Compliance is limited or precluded by any of the following laws, or by decisions or opinions issued or agreements executed pursuant to any of the following laws:***

Endangered Species Act (16 USC 1531 et seq.);

National Environmental Policy Act (42 USC 4321 et seq.);

National Historic Preservation Act (16 USC 470 et seq.);

Wilderness Act (16 USC 1131 et seq.); or

Other federal, State of Texas, or local laws the purpose of which is to preserve threatened or endangered species; the environment; or archeological, cultural, historical, or other significant natural features.

There are other mitigating factors regarding accessibility. Four are discussed below.

- Construction Tolerance (see 104.1.1 Construction and Manufacturing Tolerances): All dimensions are subject to conventional industry tolerances except where the requirement is stated as a range with specific minimum and maximum end points. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Equivalent Facilitation (see 103 Equivalent Facilitation): Nothing in these requirements prevents the use of designs, products, or technologies as alternatives to those prescribed, provided they result in substantially equivalent or greater accessibility and usability. This is likely most applicable in new construction, but may also apply to making transition plan retrofits.
- Technical Infeasibility (see 106 Definitions): With respect to an alteration of a building or a facility, a condition wherein compliance with a requirement of this Standard has little likelihood of accomplishment because existing structural conditions would require removing or altering a load-bearing member that is an essential part of the structural frame; or because other existing physical or site constraints prohibit modification or addition of elements, spaces, or features that are in full and strict compliance with the minimum requirements. This is likely most applicable to making transition plan retrofits.
- Safe Harbor (see US DOJ title II section 35.151(c)): If a public entity has constructed or altered required elements of a path of travel in accordance with the specifications in either the 1991 Standards or the Uniform Federal Accessibility Standards, or TAS 1994, before March 15, 2012, the public entity is not required to retrofit such elements to reflect incremental changes in the 2010 Standards solely because of an alteration to a primary function area served by that path of travel. ***It is important to note that the 1991 Standards and TAS 1994 did not address technical requirements for recreation assets, such as boating areas, fishing areas, beaches, campsites, trails, picnic areas, playgrounds, sports fields, sports courts, and more. The Safe Harbor approach cannot be applied to such assets.***



Campsites

We have sorted campsites into several categories. These include tent only campsites, recreational vehicle campsites, shelter sites, and sites that combine features in a hybrid approach, such as an RV site with utilities.

In evaluating Meridian State Park, WTG used TAS 2012, the pending outdoor developed areas guidance, and smart practices that make public spaces and outdoor recreation assets more accessible to people with disabilities. We also applied the concepts of construction tolerance, technical infeasibility, safe harbor, equivalent facilitation, and other imitations on when a site must be made accessible.

What is Inclusion?

The title II regulation requires Meridian State Park programs to be available in the most integrated setting. This is defined as the setting in which people with and without disabilities interact together. Using the camping example above, inclusive camping would locate accessible campsites amidst inaccessible campsites to facilitate interaction between campers with and without disabilities.

While all programs must be inclusive, that does not mean that everyone with every type of disability or health condition must be allowed to participate in every program. The concept of essential eligibility allows Meridian State Park to apply neutral conditions to determine who uses programs.

Again, using camping, if there are 20 campsites and a person with a disability is the 21st person to register, the neutral concept of “capacity” applies and that camper has no place to camp. If that camper is the 20th person to seek camping but does not pay the campsite fee, the neutral concept of paying the same fees can apply and that camper will not camp at Meridian.

How Can Programs in General Be Made Accessible?

The title II regulation at section 35.150(b) lists a number of ways to make Meridian State Park programs accessible. These include but are not limited to:

- Removing architectural barriers;
- Removing communication barriers;
- Changing rules and policies;
- Providing additional staff training;
- Providing different staff ratios;
- Providing adaptive equipment;
- Providing auxiliary aids and services such as a sign language interpreter;
- Providing accessible transportation when transportation is part of the opportunity;



- Reassignment of services to accessible locations;
- Conducting duplicate opportunities, one in accessible location and the other in an inaccessible location;
- Designing and constructing new facilities that are therefore fully compliant;
- Home visits; and
- Other methods that make programs accessible.

Meridian State Park staff should be aware of, and ready to, provide such modifications.

Are the Meridian State Park Programs Accessible and Inclusive?

In our review of the opportunities available at Meridian, we saw:

- One fishing area at Lakeside;
- One boating area at Lakeside;
- One swimming area at Lakeside;
- 15 shelter campsites at Cross Timbers, Juniper Ridge, and Lakeside;
- Eight tent campsites at Shinnery Ridge West;
- 14 hybrid tent/RV campsites at Cross Timbers;
- Two group campsites at Cedar Ridge and Cottonwood Grove;
- Three cabins at Cross Timbers;
- Four trails throughout the Park; and
- Two picnic areas at Lakeside.

Of these, the accessibility status and our recommendation is:

- Maintain the accessibility of the fishing area at Lakeside and implement the site report retrofits;
- Maintain the accessibility of the boating area at Lakeside and implement the site report retrofits;
- Make the swimming area accessible at Lakeside;
- Make two of the 15 shelters at Cross Timbers, Juniper Ridge, or Lakeside accessible, leaving the remaining 13 shelters as is and inaccessible until later altered for another purpose;

- Make two of the eight tent campsites at Shinnery Ridge West accessible, leaving the remaining six tent campsites as is and inaccessible until later altered for another purpose;
- Make two of the 14 hybrid tent/RV campsites at Cross Timbers accessible, leaving the remaining 12 campsites as is and inaccessible until later altered for another purpose;
- Make both of the group campsites at Cedar Ridge and Cottonwood Grove accessible;
- Make one of the three cabins at Cross Timbers accessible, leaving the other two cabins as is and inaccessible until later altered for another purpose;
- Maintain the one accessible trail and implement the site report retrofits;
- Leave the remaining three trails as is and inaccessible until later altered for another purpose; and
- Make one of the two picnic areas accessible, leaving the other as is and inaccessible until later altered for another purpose.

Camping Clarification

A number of campsites of each type provided within the park (see the Outdoor Developed Area Guidelines at 244.2, which will eventually be a part of the revisions to TAS 2012) must be retrofit to make the program of camping accessible, and to meet the soon-to-be-adopted State of Texas standard.

We have sorted campsites into several types: tent only, hybrid (usable by tent or RV), shelter, and group. TPWD or Meridian staff can also distinguish these sites by amenities provided (covered tables, water only, electric, scenic views, etc.).

If concessionaires are to provide camping experiences at the Park, those sites too must include accessible campsites.


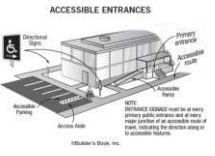


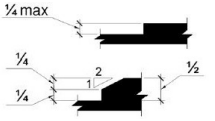
Conclusion

The staff at Meridian State Park and State Natural Area offer experiences and assets desired by park visitors. Those same experiences and assets must be accessible to and usable by people with disabilities. See the following site report to identify barriers and recommendations for barrier removal.

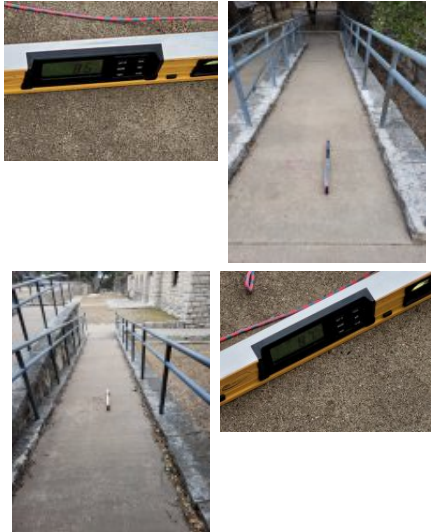


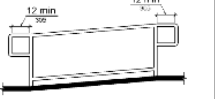
Meridian State Park - 173 Park Road #7 Meridian, TX 76665


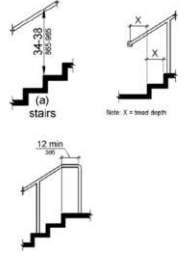
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
1	Exterior: Exterior Accessible Route	[31.8900582 , -97.698582 5]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	4" hole on rear side of cross timber restroom building, 9" gap on back side of cross timber restroom building	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
2	Exterior: Exterior Accessible Route	[31.8900707 , -97.698599 9]	The running slope of walking surfaces shall not be steeper than 1:20.	9.9% slope at rear of cross timber restroom at path to campsites	Correct running slope along the AR to max 5%	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
3	Exterior: Exterior Accessible Route	[31.8900628 , -97.698597 3]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	1" change in elevation on rear side of cross timber restroom building where campsite path connects to building	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


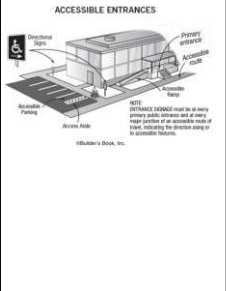

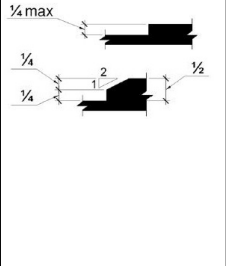


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
4	Exterior: Exterior Accessible Route	[31.8912766 , -97.701503 4]	There is no accessible route to the restroom or dining hall. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks accessible route to restroom or dining hall due to non accessible surface at curb ramp	Create an accessible route with crushed stone or other outdoor material from parking or walkway to restroom or dining hall.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
5	Exterior: Exterior Accessible Route	[31.8923629 , -97.702726 5]	The surface of outdoor recreation access routes, passing spaces, and resting intervals shall be firm and stable	No accessible route to overlook due to surface	Replace existing surface with an accessible surface such as EWF, boardwalk, crushed stone, or asphalt with compliant slopes and CILs as a smart practice	2015 ABAAS Section: 1016.2		
6	Exterior: Exterior Accessible Route	[31.8908166 , -97.697576 7]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	2" change in elevation on accessible route to Headquarters	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665







Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
7	Exterior: Exterior Accessible Route	[31.8889036 , -97.699765 4]	The ramps slope exceeds the maximum running slope (direction of travel) allowable of 8.33%. Ramps should have the least possible slope but in no case more than 8.3% (1:12).	Ramp - 8.6% at top and second run middle 8.7%	Correct slope of ramp to max 8.33%	2015 ABAAS Section: 405.2 2012 TAS Section: 405.2 2010 ADAS Section: 405.2		
8	Exterior: Exterior Accessible Route	[31.8889525 , -97.699788 2]	The handrail is not continuous the entire length of the ramp. The handrail must be continuous. Handrails shall be placed on each side of each ramp, shall be continuous the full length of the ramp. The inside handrail on switch back or dogleg ramps shall always be continuous.	break in hand rails at steps in level mid-section landing	Replace handrail with one that is continuous along the full length of the ramp	2015 ABAAS Section: 505.3, 505.10.1 2012 TAS Section: 505.3, 505.10.1 2010 ADAS Section: 505.3, 505.10.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
9	Exterior: Exterior Accessible Route	[31.8888694 , -97.6998297]	Stairways must have handrails on both sides. Handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground. The top handrails shall extend a minimum of 12 inches beyond the top nosing and shall be parallel with the floor or ground surface. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The orientation of at least one handrail, including the extension, shall be in the direction of the run of the stair and perpendicular to the direction of the stair nosing. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4 inches minimum and 6 1/4 inches maximum, and a cross-section dimension of 2-1/4 inches maximum. The hand grip portion of handrails shall have a smooth surface with no sharp corners. Gripping surfaces (top or sides) shall be uninterrupted by newel posts, other construction elements or obstructions. Any wall or other surface adjacent to the handrail shall be free of sharp or abrasive elements. Handrails projecting from a wall shall have a space of 1-1/2 inches minimum between the wall and the handrail.	stairs at lakeside day use by ramp and building, lack handrails. 3 sets of stairs total, around building lack handrails	Install handrails on both sides of stairway, mounted 34" to 38" aff with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall	2015 ABAAS Section: 505.2 2012 TAS Section: 505.2 2010 ADAS Section: 505.2		





Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
10	Exterior: Exterior Accessible Route	[31.8886713 , -97.7003125]	There is no accessible route to the dock. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	no accessible route to single dock	Create an accessible route with crushed stone or other outdoor material from parking or walkway to dock.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
11	Exterior: Exterior Accessible Route	[31.8887578 , -97.6997949]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	2" change in elevation at access aisle to steps at lakeside building	Repair, bevel or ramp CIL along AR	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		
12	Exterior: Parking	[31.8900468 , -97.6984497]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 6 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	6 stalls 0 accessible at crosstimmer Campground restroom building. 1st restroom past Headquarters building	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
13	Exterior: Parking	[31.8847622 , -97.699710 5]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of 3 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of 1 accessible stalls with a minimum of 1 being designed as van accessible.	Parking area at southern most end - 3 standard parking stalls, 0 accessible parking stalls	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
14	Exterior: Parking	[31.8871522 , -97.706605]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (4) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	parking lot by site 24 - 0 of 4 stalls are accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
15	Exterior: Parking	[31.8905695 , -97.705073 5]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (25) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Estimated 25 unmarked parking stalls at shinnery ridge trail, 0 accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		







Meridian State Park - 173 Park Road #7 Meridian, TX 76665

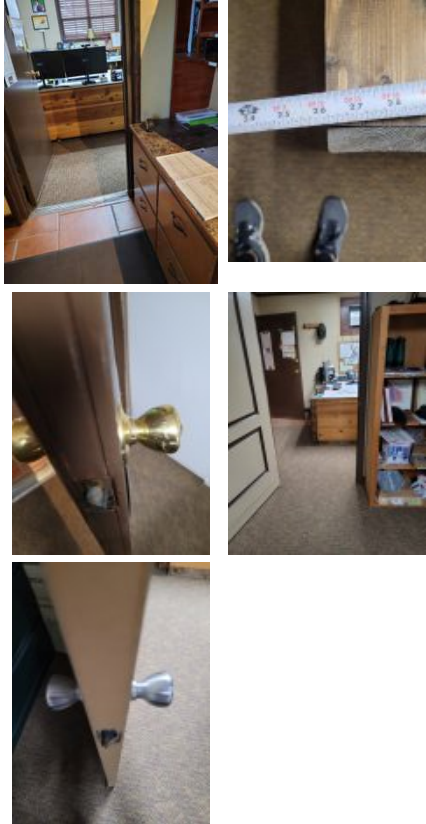

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
16	Exterior: Parking	[31.8888307 , -97.6994864]	There are no or not enough accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (XX) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (XX) accessible stalls with a minimum of (XX) being designed as van accessible.	28 standard parking spaces, 1 accessible parking space	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls.	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
17	Exterior: Parking	[31.8889969 , -97.699709]	There are no van accessible parking stalls. 1 in every 6, minimum of one, required accessible stalls must be a van accessible stall. There are a total of 30 parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (2) accessible stalls with a minimum of (1) being designed as van accessible.	Lacks van accessible parking stall, approximately 30 stalls, 1 accessible	Add van parking sign to 1 accessible stall and repaint stall and access aisle to 11' and 5' or 8' and 8' per the table	2015 ABAAS Section: F208.2, F208.2.4 2012 TAS Section: 208.2, 208.2.4 2010 ADAS Section: 208.2, 208.2.4		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
18	Exterior: Parking	[31.8890106 , -97.699714 4]	The cross slopes (narrow dimension) and/or running slopes (long dimension) of the access aisle exceeds 2%. The running slope and the cross slope in an accessible parking stall and the access aisle must not exceed 2%.	Lakeside restroom building - 7.7% in stall, 14.5% in access aisle	Repair or correct slope of parking space and access aisle to max 2.08% in any direction	2015 ABAAS Section: 502.4 2012 TAS Section: 502.4 2010 ADAS Section: 502.4		
19	Exterior: Parking	[31.8913039 , -97.701491 4]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (16) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Juniper ridge bath house - 16 parking spaces, no accessible parking spaces	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		

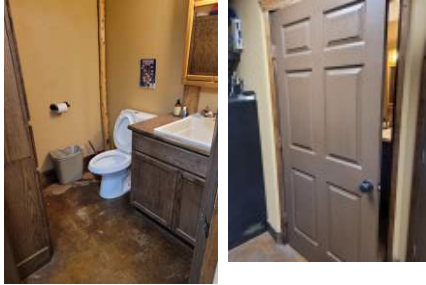



Meridian State Park - 173 Park Road #7 Meridian, TX 76665


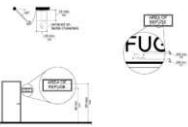
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
20	Exterior: Parking	[31.8929561 , -97.702337 6]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (6) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Juniper by bird blind - 6 parking spaces, lacks accessible parking	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
21	Exterior: Parking	[31.8956011 , -97.702284]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (12) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Northern most parking area - estimated 12 parking spaces in gravel loop lot, 0 accessible.	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		
22	Exterior: Parking	[31.8908302 , -97.697625]	There are no accessible parking stalls. Each lot where parking is provided for the public as clients, guests or employees, shall provide accessible parking and shall be located on the shortest accessible route of travel from adjacent parking to an accessible entrance. There are a total of (4) parking stalls in the parking lot that could be reasonably associated with this facility. There should be a minimum of (1) accessible stalls with a minimum of (1) being designed as van accessible.	Headquarters - 0 of 4 parking stalls are accessible	Create one or more 8' accessible parking stalls, with one 5' adjacent access aisle, with proper signage and striping based on the total number of stalls	2015 ABAAS Section: F208.2 2012 TAS Section: 208.2 2010 ADAS Section: 208.2		

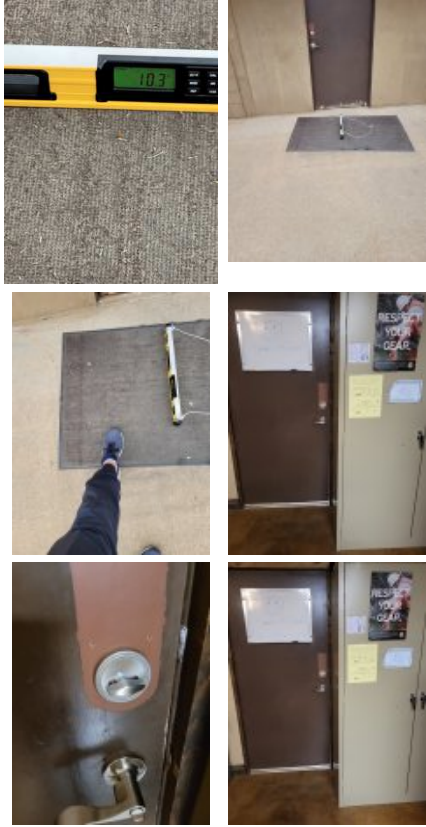

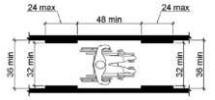
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
23	Headquarters Building: HQ - Employee Spaces	[31.8907673, -97.6975476]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	1st door into office - push side maneuvering clearance reduced by work counter, circulation path reduced to 26" by furniture, knob hardware 2 of 2 doors. Superintendent office pull side maneuvering clearance reduced by book shelf	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
24	Headquarters Building: HQ - Employee Spaces	[31.89083, -97.69749]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is	Rear employee entrance - push side maneuvering clearance reduced by rock, 1" change in elevation at threshold, 0.75" at push side entry, pinch required for lock hardware, 12.2% slope on push side landing, decorative column in maneuvering clearance on pull side	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, provide beveled threshold. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
			<p>easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.</p>					


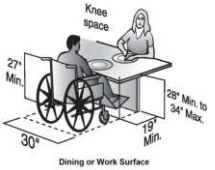

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
25	Headquarters Building: HQ - Employee Spaces	[31.8907958 , -97.697546 9]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm).	First office at reception - 24" depth to desk, door width 30" sliding barn door, circulation path reduced by desk to 25.25"	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
26	Headquarters Building: HQ - Employee Spaces	[31.8907892 , -97.6975606]	The restroom is not compliant. The restroom does not have the required minimum clear floor space or maneuvering clearances for the toilet. The restroom does not have the required minimum clear floor space or maneuvering clearances for the lavatory. The entry door does not contain the required minimum maneuvering spaces on the pull/push sides. The entry door encroach into the required clear floor space for fixtures. Grab bars are missing and/or incorrectly installed. Accessories, such as toilet seat covers, paper towel holders, garbage cans, hand dryers, and mirrors are either too high or without clear floor space or both.	restroom lacks accessible features	Create a compliant wheelchair accessible restroom and correct all features to be accessible if feasible.	2015 ABAAS Section: 603.1 2012 TAS Section: 603.1 2010 ADAS Section: 603.1		
27	Headquarters Building: HQ - Employee Spaces	[31.8907665 , -97.6975445]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	lacks directional signage, toilet compartment - 66" d x 77" w	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
28	Headquarters Building: HQ - Employee Spaces	[31.8907801 , -97.697549 9]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Restroom lacks signage	Acquire and mount signage, including Braille and raised lettering mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character Remount signage on wall, latch side of the door, 48" to baseline of lowest character and 60" to baseline of highest character Replace sign with one of contrasting colors that includes Braille, raised characters, and the symbol of accessibility and mount on the wall, latch side of the door, 48" to the baseline of the lowest character and 60" to the baseline of the highest character Remount signage to the proper location based on the type of door provided	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		


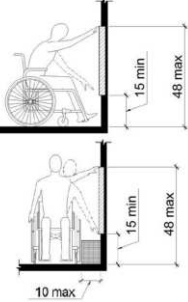
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
29	Headquarters Building: HQ - Employee Spaces	[31.8907915, -97.6975204]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.\	Exit door from break room - 10.3% slope push side approach, carpet not secured on push side, pull side lock hardware requires pinch, pull side maneuvering clearance reduced by storage	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, secure rug in door clearance to prevent trip hazard. For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
30	Headquarters Building: HQ - Employee Spaces	[31.890771, -97.6975552]	The route of travel at this location does not provide a minimum width of 36 inches. The clear width shall be permitted to be reduced to 32 inches minimum for a length of 24 inches maximum provided that reduced width segments are separated by segments that are 48 inches long minimum and 36 inches wide minimum.	Break room - minimum width reduced to 25" behind table	Widen AR to compliant 36" clear width	2015 ABAAS Section: 403.5.1 2012 TAS Section: 403.5.1 2010 ADAS Section: 403.5.1		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


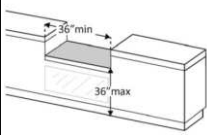

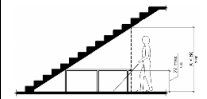
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
31	Headquarters Building: HQ - Employee Spaces	[31.8907847 , -97.697549 9]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	Table does not provide knee clearance - bottom 25.5" above finished floor	Provide tables and work surfaces at 28" to 34" aff with required knee and toe clearances	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		
32	Headquarters Building: HQ - Public Spaces	[31.8907414 , -97.697682 6]	There is no accessible route to the wood bundles or dog waste bags. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lacks accessible route to wood bundles, no accessible route to dog waste bags	Create an accessible route with crushed stone or other outdoor material from parking or walkway to the wood bundles or dog waste bags.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		


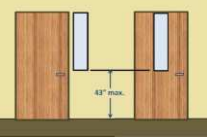
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
33	Headquarters Building: HQ - Public Spaces	[31.8908712 , -97.6975204]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Elements mounted or installed out of reach range - 59" to after hour reservation clips, 53" to pay drop, 53" to dog bags, 53" to wood bundle pay drop	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		


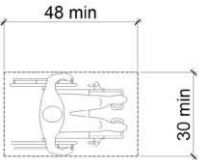

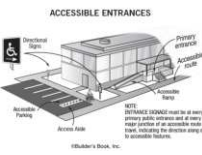

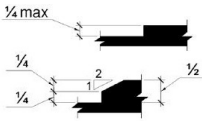
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
34	Headquarters Building: HQ - Public Spaces	[31.890771, -97.697571 3]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Elements out of reach range - measurements above finished floor - 55" to the keurig, 77" to park brochures, 55" to park and trail maps, 57" to merchandise	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
35	Headquarters Building: HQ - Public Spaces	[31.8907824 , -97.697555 2]	The transaction counter is too high. A portion of the counter surface that is 36 inches long minimum and 36 inches high maximum above the finish floor shall be provided. Knee and toe space must be provided for a forward approach. A 30 inch by 48 inch clear floor space on an accessible route must be provided for either a forward or parallel approach.	Service counter 49" above finished floor	Lower 36" wide segment of service counter to max 36" aff	2015 ABAAS Section: 904.4.2, 904.4.1 2012 TAS Section: 904.4.1, 904.4.2 2010 ADAS Section: 904.4.2, 904.4.1		
36	Headquarters Building: HQ - Public Spaces	[31.8907756 , -97.697566]	Vertical clearance shall be 80 inches (2030 mm) high minimum. Guardrails or other barriers shall be provided where the vertical clearance is less than 80 inches (2030 mm) high. The leading edge of such guardrail or barrier shall be located 27 inches (685 mm) maximum above the finish floor or ground. EXCEPTION: Door closers and door stops shall be permitted to be 78 inches (1980 mm) minimum above the finish floor or ground.	closer 77.5" above finished floor	Replace closer with one mounted min of 78" aff	2015 ABAAS Section: 307.4, 307.4 EXCEPTION 2012 TAS Section: 307.4, 307.4 Exception 2010 ADAS Section: 307.4, 307.4 Exception		
37	Headquarters Building: HQ - Public Spaces	[31.8908131 , -97.697583 4]	It is recommended that exterior doors be maintained so that the operating pressure does not exceed 8.5 lb. force to open. The sweep period for doors with closers shall be adjusted so that from an open position of 70 degrees, the door will take at least 3 seconds to move to a point 7 inches from the latch, measured to the leading edge of the door.	Entry- 11#, fast closing	For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, inspect, adjust, and maintain closing speed on door closers	2012 TAS Section: 404.2.9, 404.2.9 Advisory, 404.2.8.1 2010 ADAS Section: 404.2.9, 404.2.8.1		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
38	Headquarters Building: HQ - Public Spaces	[31.8907938 , -97.697549 9]	The vision light panels (glazing/window) are mounted too high. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches maximum above the finish floor.	Entry - door window 49" above finished floor	Replace doors with ones having sidelight viewing windows max 43" aff	2015 ABAAS Section: 404.2.11 2012 TAS Section: 404.2.11 2010 ADAS Section: 404.2.11		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
39	Park Site: Park Elements	[31.8900559 , -97.698577 1]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	Cross timber restroom building - no CFS for display board	Provide required 30" by 48" CFS at sign board	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		
40	Park Site: Park Elements	[31.8930483 , -97.701701 9]	There is no accessible route to the bird blind. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Juniper Ridge - lacks accessible route to bird blind	Create an accessible route with crushed stone or other outdoor material from parking or walkway to bird blind.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
41	Park Site: Residence	[31.8897371 , -97.696954 4]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	lacks accessible route to residence due to steps	Repair, bevel or ramp change in level along accessible route.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		



Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
42	Park Site: Residence	[31.8911149 , -97.696975 9]	Element meets all standards and requirements	residence complies	None	2010 ADAS Section: N/A		







Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
43	Cedar Ridge Campground: Cedar Ridge Group Site	[31.8972931 , -97.693472 9]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	Youth group campground lacks accessible features	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
44	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8911172 , -97.699338 9]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Group camp - lacks accessible route to fire pit and hanging pole	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
45	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8911195 , -97.699360 4]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Group camp - 2.7% at entry, 2.6% on path, 3.2% on path behind table facing creek	Correct or repair ORAR cross slope to max 2.08% or 5% for surfaces other than concrete, asphalt or board as a smart practices	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION		


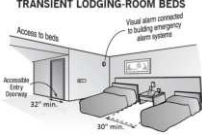

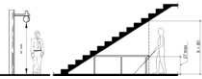
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
46	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8910955 , -97.6993657]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Group camp - non compliant surface around fire ring	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		
47	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8911195 , -97.6993577]	Fire building surfaces shall be 9 inches (230 mm) minimum above the ground	Group camp - ground level fire building surface	Correct fire building surface to be 9" min above the ground as a smart practice.	2015 ABAAS Section: 1011.5.1		
48	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8911115 , -97.6993577]	Where provided, cooking surfaces shall be 15 inches (380 mm) minimum and 34 inches (865 mm) maximum above the ground	Group camp - smoker height 38" above the ground	Raise or lower cooking surface to be 15" min to 34" max above the ground; in the alternative, replace with a compliant surface as a smart practice	2015 ABAAS Section: 1011.5.2	 	
49	Cottonwood Cove Campground: Cottonwood Cove Campground (Primitive)	[31.8911012 , -97.699359]	The surface of parking spaces and pull-up spaces shall be firm and stable. The slope of the surface of parking spaces and pull-up spaces shall not be steeper than 1:48 in any direction. EXCEPTION: Where the surface is other than asphalt, concrete, or boards, slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Group camp - non compliant parking surface	Correct surface of parking spaces to be firm and stable with slopes max of 2.08% or 5% for surfaces other than concrete, asphalt or boards as a smart practice.	2015 ABAAS Section: 1012.4, 1012.5, 1012.5 EXCEPTION	 	

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure





Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
50	Crosstimbers Campground: RV Campsites	[31.8903656 , -97.698716 6]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 15 RV campsites accessible	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		
51	Crosstimbers Campground: Accessible Cabin 9	[31.8897075 , -97.699041 2]	The required clear space between the beds has not been provided. Accessible sleeping rooms shall have a 30 inch minimum by 48 inch minimum clear space located between the beds to provide a parallel approach.	Cabin 9 - 24" in between beds	Provide minimum 30" by 48" CFS between beds	2015 ABAAS Section: 806.2.3, 806.2.3 EXCEPTION 2012 TAS Section: 806.2.3, 806.2.3 Exception 2010 ADAS Section: 806.2.3 Exception		
52	Crosstimbers Campground: Accessible Cabin 9	[31.8897041 , -97.699038 5]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Cabin 9 - fire extinguisher projects 5" into circulation path	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		





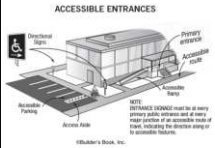
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

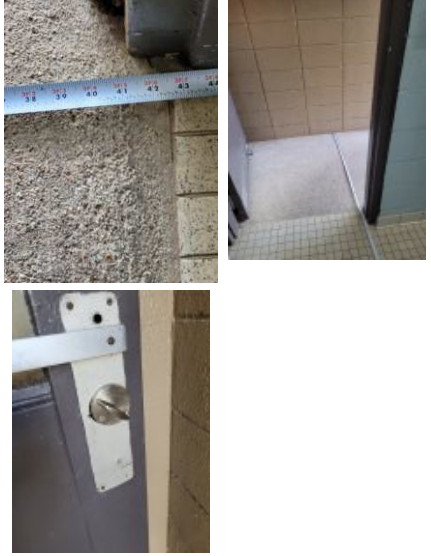
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
53	Crosstimbers Campground: Accessible Cabin 9	[31.8897143 , -97.699038 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Cabin 9 - AC unit controls 67" above finished floor	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
54	Crosstimbers Campground: Accessible Cabin 9	[31.8897052 , -97.699030 4]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	Cabin 9 - table lacks knee and toe clearance	Provide tables and work surfaces at 28" to 34" aff with required knee and toe clearances	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		
55	Crosstimbers Campground: Accessible Cabin 9	[31.8896938 , -97.699030 4]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise.	Cabin 9 - 5.5" maneuvering clearance on pull side, 0.75" threshold	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, provide beveled threshold.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		



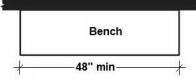
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
56	Crosstimbers Campground: Accessible Cabin 9	[31.8896938 , -97.699025 1]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	Cabin 9 - lacks accessible route to site elements	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		
57	Crosstimbers Campground: Accessible Cabin 9	[31.8896847 , -97.699049 2]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	11" toe clearance	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
58	Crosstimbers Campground: Accessible Cabin 9	[31.889695, -97.699035 8]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	28.5" clearance between table and fire pit	Provide required 36" clear ground space around all usable portions of the table as a smart practice	2015 ABAAS Section: 1011.2.1		
59	Crosstimbers Campground: Accessible Cabin 9	[31.8897098 , -97.699043 9]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	non compliant surface at fire ring CGS	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		


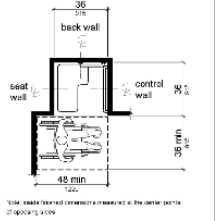

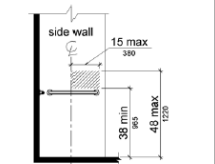
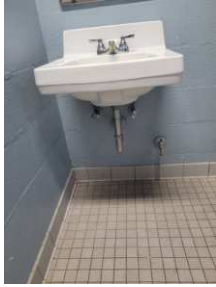


Meridian State Park - 173 Park Road #7 Meridian, TX 76665

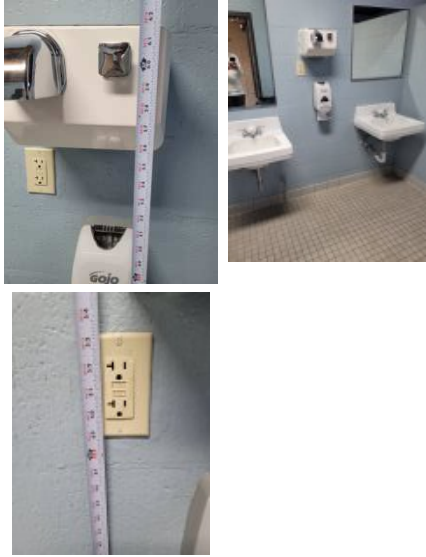
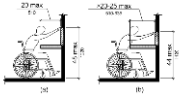
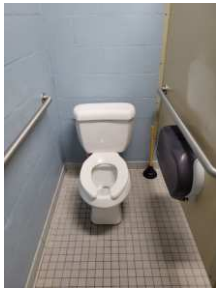
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
60	Crosstimbers Campground: Accessible Cabin 9	[31.8896893 , -97.6990412]	Where provided, cooking surfaces shall be 15 inches (380 mm) minimum and 34 inches (865 mm) maximum above the ground	35" to bottom level cooking surface	Raise or lower cooking surface to be 15" min to 34" max above the ground; in the alternative, replace with a compliant surface as a smart practice	2015 ABAAS Section: 1011.5.2		
61	Crosstimbers Campground: Accessible Cabin 9	[31.8897075 , -97.6990734]	Parking spaces and pull-up spaces for recreational vehicles shall be 20 feet (6100 mm) wide minimum. EXCEPTION: Where two adjacent parking spaces are provided for recreational vehicles, one parking space shall be permitted to be 16 feet (4880 mm) wide minimum.	Cabin 9 - parking space 12' wide	Correct RV parking space to be 20' wide minimum; or 16' for two adjacent spaces as a smart practice.	2015 ABAAS Section: 1012.2, 1012.2 EXCEPTION		
62	Crosstimbers Campground: Accessible Cabin 9	[31.8897166 , -97.6990734]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	Cabin 9 - lacks clear ground space at utility hookups	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice	2015 ABAAS Section: 1011.2		
63	Crosstimbers Campground: Accessible Cabin 9	[31.8896938 , -97.699076]	There is no accessible route to the cabin entry. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Cabin 9 - lacks accessible route to entry due to unstable surface	Create an accessible route with crushed stone or other outdoor material from parking or walkway to cabin entry	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
64	Crosstimbers Campground: Accessible Cabin 9	[31.8897325 , -97.699143 1]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 5 cabins campsites accessible	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		
65	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900582 , -97.698514 1]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Men's restroom - maneuvering clearance depth reduced by rear wall to 40", hardware	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		




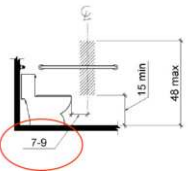
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
66	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900537 , -97.6985128]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Men's restroom - shelf 67.5", hook 65.25"	Remount at least one hook to max 48" aff and shelves to 40" - 48" aff	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
67	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900377 , -97.6985208]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Men's restroom - bench 12" seat depth, seat height 16"	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


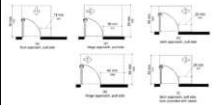


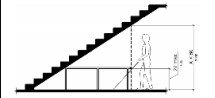


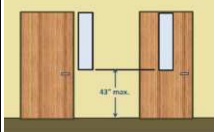
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
68	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900559 , -97.698526 2]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	Men's restroom - shower stall 33" width	Enlarge transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		
69	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900514 , -97.698526 2]	Shower controls are in the incorrect location. In transfer type shower compartments, the controls, faucets, and shower spray unit shall be installed on the side wall opposite the seat 38 inches (965 mm) minimum and 48 inches (1220 mm) maximum above the shower floor and shall be located on the control wall 15 inches (380 mm) maximum from the centerline of the seat toward the shower opening.	Men's restroom - controls in wrong location	Remount shower controls to the correct location in the transfer shower	2015 ABAAS Section: 608.5.1 2012 TAS Section: 608.5.1 2010 ADAS Section: 608.5.1		
70	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900468 , -97.698518 1]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Men's restroom - sink lacks insulation	Insulate exposed pipes under one sink.	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
71	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.89004 , -97.698531 5]	The urinals flush handle is mounted too high. Flush controls shall be operable with one hand and shall not require tight grasping, pinching or twisting of the wrist and shall be mounted no more than 48 inches above the floor. The force required to activate controls shall be no greater than 5 lb. Electronic automatic flushing controls are acceptable and preferable.	Men's restroom - urinal flush control 51.5" above finished floor	Lower flush handle at urinal to max 48" aff	2015 ABAAS Section: 605.4 2012 TAS Section: 605.4 2010 ADAS Section: 605.4		



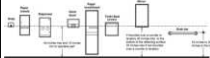

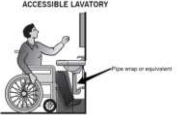

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
72	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900423 , -97.698523 5]	Where a high forward reach is over an obstruction, the clear floor space shall extend beneath the element for a distance not less than the required reach depth over the obstruction. The high forward reach shall be 48 inches (1220 mm) maximum where the reach depth is 20 inches (510 mm) maximum. Where the reach depth exceeds 20 inches (510 mm), the high forward reach shall be 44 inches (1120 mm) maximum and the reach depth shall be 25 inches (635 mm) maximum. Where a clear floor or ground space allows a parallel approach to an element and the high side reach is over an obstruction, the height of the obstruction shall be 34 inches (865 mm) maximum and the depth of the obstruction shall be 24 inches (610 mm) maximum. The high side reach shall be 48 inches (1220 mm) maximum for a reach depth of 10 inches (255 mm) maximum. Where the reach depth exceeds 10 inches (255 mm), the high side reach shall be 46 inches (1170 mm) maximum for a reach depth of 24 inches (610 mm) maximum.	Men's restroom - hand dryer 60" and outlet 50.5" above finished floor	Lower operable parts to max 44" above the finished floor (AFF) for a forward reach over counter.	2015 ABAAS Section: 308.2.1, 308.3.2 2012 TAS Section: 308.2.1, 308.3.2 2010 ADAS Section: 308.2.1, 308.3.2		
73	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900468 , -97.698531 5]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Lacks wheelchair sized stall, ambulatory only	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		




Meridian State Park - 173 Park Road #7 Meridian, TX 76665


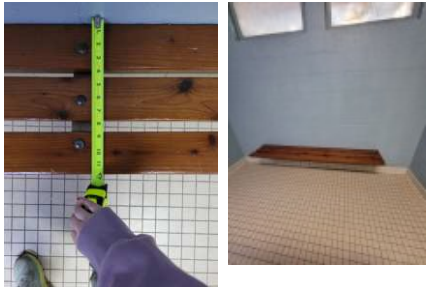
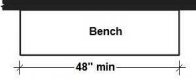
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
74	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900514 , -97.6985315]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	stall door not self closing	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
75	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900468 , -97.6985262]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Men's restroom - side grab bar installed 47.75" from back wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff.	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
76	Crosstimbers Campground: Crosstimbers - Men's Restroom	[31.8900468 , -97.6985315]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Men's restroom - toilet paper dispenser too close	Remount toilet paper dispenser 7" to 9" from front of toilet, 15" to 48" AFF and min 12" above or 1.5" below grab bar.	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


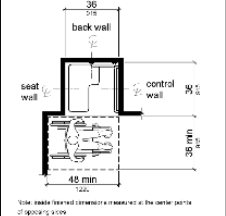

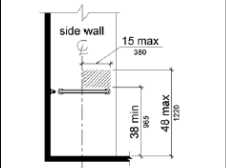

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
77	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900741 , -97.6985208]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Women's restroom - lacks pull side clearance, wall back pull side	Provide required maneuvering clearance around pull side of door	2015 ABAAS Section: 404.2.4.1 , 404.2.4.4 2012 TAS Section: 404.2.4.4, 404.2.4.1 2010 ADAS Section: 404.2.4.4, 404.2.4.1		
78	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900491 , -97.6985369]	Vertical clearance shall be 80 inches (2030 mm) high minimum. Guardrails or other barriers shall be provided where the vertical clearance is less than 80 inches (2030 mm) high. The leading edge of such guardrail or barrier shall be located 27 inches (685 mm) maximum above the finish floor or ground. EXCEPTION: Door closers and door stops shall be permitted to be 78 inches (1980 mm) minimum above the finish floor or ground.	Women's restroom - 74" overhead clearance at closer	Replace closer with one mounted min of 78" aff	2015 ABAAS Section: 307.4, 307.4 EXCEPTION 2012 TAS Section: 307.4, 307.4 Exception 2010 ADAS Section: 307.4, 307.4 Exception	 	
79	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.890048, -97.6985342]	The vision light panels (glazing/window) are mounted too high. Doors, gates, and side lights adjacent to doors or gates, containing one or more glazing panels that permit viewing through the panels shall have the bottom of at least one glazed panel located 43 inches maximum above the finish floor.	Women's restroom - window on door 45.5" above finished floor	Replace doors with ones having sidelight viewing windows max 43" aff	2015 ABAAS Section: 404.2.11 2012 TAS Section: 404.2.11 2010 ADAS Section: 404.2.11	 	

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
80	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900764 , -97.698534 2]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Women's restroom - mirrors mounted 40.5" and 45.5" above finished floor	Lower mirror so reflective surface is max 40" aff	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	 	
81	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900719 , -97.698531 5]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Women's restroom - sinks lack insulation on drain pipes	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
82	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900696 , -97.698528 9]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Women's restroom - 1 standard stall, 1 ambulatory stall	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		


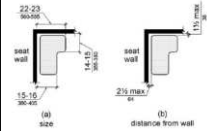

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
83	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900741 , -97.698528 9]	The stall door fails to comply with all of the door requirements. The stall door must be self-closing.	Women's restroom - stall door is not self closing	Adjust stall door to be self-closing	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		
84	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900741 , -97.698526 2]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Women's restroom partition side grab bar - mounted 5.5" from rear wall, extends to 47.5" from rear wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
85	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900696 , -97.698528 9]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Women's restroom - partition side grab bar is 36.5" above finished floor	Remount grab bars in accessible stall to 33" to 36" aff	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4		





Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
86	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900741 , -97.698526 2]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Women's restroom - hooks 62" and shelf 67"	Remount at least one hook to max 48" aff and shelves to 40" - 48" aff	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		
87	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900764 , -97.698530 2]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Women's restroom -12" seat depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665






Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
88	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900753, -97.6985356]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	Women's restroom - shower stall 40" depth x 34" width	Correct transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		
89	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900741, -97.6985289]	Shower controls are in the incorrect location. In transfer type shower compartments, the controls, faucets, and shower spray unit shall be installed on the side wall opposite the seat 38 inches (965 mm) minimum and 48 inches (1220 mm) maximum above the shower floor and shall be located on the control wall 15 inches (380 mm) maximum from the centerline of the seat toward the shower opening.	Women's restroom - shower controls installed on wrong wall	Remount shower controls to the correct location in the transfer shower	2015 ABAAS Section: 608.5.1 2012 TAS Section: 608.5.1 2010 ADAS Section: 608.5.1		
90	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.890073, -97.6985302]	Where a seat is provided in a standard roll-in shower compartment, it shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. Where a seat is provided in an alternate roll-in type shower compartment, it shall be a folding type, shall be installed on the front wall opposite the back wall, and shall extend from the adjacent side wall to a point within 3 inches (75 mm) of the compartment entry. In transfer-type showers, the seat shall extend from the back wall to a point within 3 inches (75 mm) of the compartment entry. The top of the seat shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the bathroom finish floor. Seats shall comply with 610.3.1 or 610.3.2.	Women's restroom - seat mounted 3.5" from compartment entry	Remount shower seat to within 3" of the opening	2015 ABAAS Section: 610.3 2012 TAS Section: 610.3 2010 ADAS Section: 610.3		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


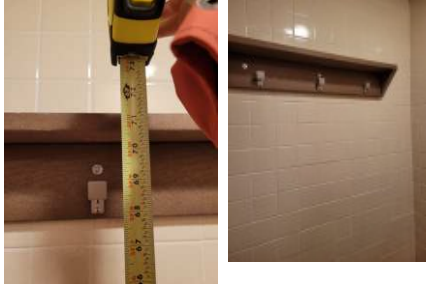
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
91	Crosstimbers Campground: Crosstimbers - Women's Restroom	[31.8900764 , -97.698530 2]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Women's restroom - shower seat installed 3.25" from back wall	Remount shower seat to the correct location and height in the shower	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2		
92	Crosstimbers Campground: Crosstimbers - Dump Station	[31.8898305 , -97.698641 5]	30 inches (760 mm) by 60 inches (1525 mm) with the long side of the space adjoining or overlapping an accessible parking space or pull-up space for recreational vehicles. Locate the space so that the hook-ups are at the rear center of the space. Bollards or other barriers shall not obstruct the clear ground space in front of the hook-ups	lacks clear ground space at utility hookup	Provide required 30" by 60" clear ground space with hook ups at the rear of the space as a smart practice	2015 ABAAS Section: 1011.2		

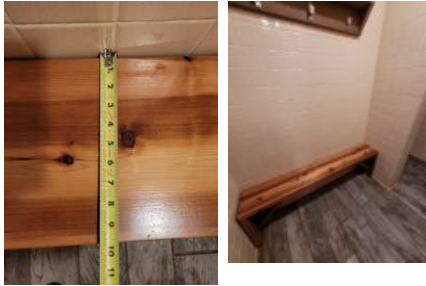
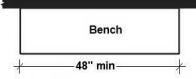

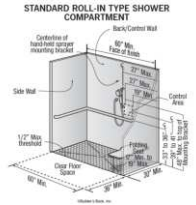
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
93	Juniper Ridge Campground: Accessible Shelter 18	[31.8912686 , -97.700933 5]	Element meets all standards and requirements	Shelter 18 complies	None	2010 ADAS Section: N/A		
94	Juniper Ridge Campground: Accessible Shelter 18	[31.8912629 , -97.700917 4]	Thresholds, if provided at doorways, shall be 1/2 inch (13 mm) high maximum. Raised thresholds and changes in level at doorways shall comply with 302 and 303. Changes in level of 1/4 inch (6.4 mm) high maximum shall be permitted to be vertical. Changes in level between 1/4 inch (6.4 mm) high minimum and 1/2 inch (13 mm) high maximum shall be beveled with a slope not steeper than 1:2. Changes in level greater than 1/2 inch (13 mm) high shall be ramped, and shall comply with 405 or 406.	2.75" change in elevation at entry	Repair, bevel or ramp CIL at doorway	2015 ABAAS Section: 303.3, 404.2.5, 303.2, 303.4 2012 TAS Section: 303.3, 404.2.5, 303.2, 303.4 2010 ADAS Section: 303.3, 404.2.5, 303.2, 303.4		
95	Juniper Ridge Campground: Accessible Shelter 18	[31.8912629 , -97.700945 5]	An accessible access route is not provided between elements, spaces and the facilities provided within the accessible camping unit. At least one outdoor recreation access route shall connect accessible elements, spaces and facilities provided within camping units with mobility features.	lacks accessible route to grill and picnic table	Create AR with crushed and compacted stone or similar outdoor material to camp sites and one of each type of amenity.	2015 ABAAS Section: F244.5.1		


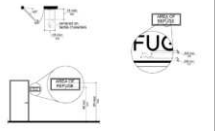


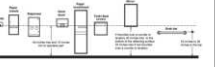

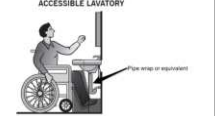
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
96	Juniper Ridge Campground: Accessible Shelter 18	[31.8913085 , -97.700902 6]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	18% at entry	Correct or repair ORAR cross slope to max 2.08% or 5% for surfaces other than concrete, asphalt or board as a smart practices	2015 ABAAS Section: 1016.7.2, 1016.7.2 EXCEPTION	 	
97	Juniper Ridge Campground: Accessible Shelter 18	[31.8912675 , -97.700916]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	Picnic table is not of accessible design	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		
98	Juniper Ridge Campground: Accessible Shelter 18	[31.8912743 , -97.700944 2]	36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches	Picnic table lacks 36" clear ground space around perimeter	Provide required 36" clear ground space around all usable portions of the table as a smart practice	2015 ABAAS Section: 1011.2.1		
99	Juniper Ridge Campground: Accessible Shelter 18	[31.8912675 , -97.700940 2]	48 inches (1220 mm) by 48 inches (1220 mm) on all usable sides of the fire ring, grill, fireplace, and woodstove Center the space on each usable side of the grill, fireplace, and woodstove	Lacks accessible surface at grill	Provide required 48" clear ground space centered along usable side of fire ring, grill, fireplace, or woodstove as a smart practice	2015 ABAAS Section: 1011.2		


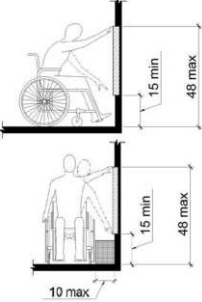


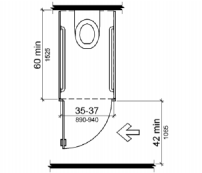
Meridian State Park - 173 Park Road #7 Meridian, TX 76665


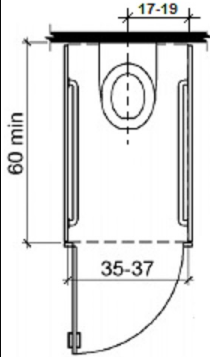

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
100	Juniper Ridge Campground: Accessible Shelter 18	[31.8912561, -97.7009214]	Where provided, cooking surfaces shall be 15 inches (380 mm) minimum and 34 inches (865 mm) maximum above the ground	35" to lowest level cooking surface	Raise or lower cooking surface to be 15" min to 34" max above the ground; in the alternative, replace with a compliant surface as a smart practice	2015 ABAAS Section: 1011.5.2		
101	Juniper Ridge Campground: Accessible Shelter 18	[31.89027, -97.69976]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 15 shelters at park comply (2 at Crosstimbers, 7 at Juniper Ridge, 6 at Lakeside)	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		
102	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912265, -97.7015383]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Men's restroom - 68" to hooks, 71.5" to shelf above finished floor	Remount at least one hook to max 48" aff and shelves to 40" - 48" aff	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		

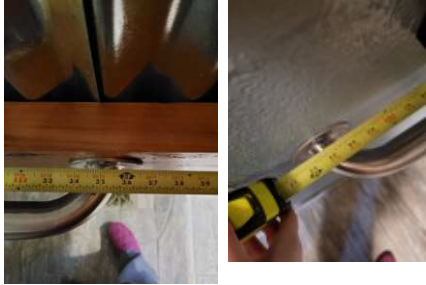



Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
103	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912356 , -97.701541]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Men's restroom - bench 9.5" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
104	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912402 , -97.7015517]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Men's restroom - lacks accessible shower stall	Create an accessible shower in locker/bathing room	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
105	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912402 , -97.701541]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Men's restroom - lacks compliant sign with symbol of accessibility	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
106	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912128 , -97.7015249]	The mirror is mounted too high. Mirrors must have the bottom edge of the reflecting surface a maximum of 40 inches above the floor if above a sink or counter. Mirrors not located above lavatories or countertops shall be installed with the bottom edge of the reflecting surface 35 inches maximum above the finish floor or ground.	Men's restroom - mirror is mounted 52" above finished floor	Lower mirror so reflective surface is max 40" aff	2015 ABAAS Section: 603.3 2012 TAS Section: 603.3 2010 ADAS Section: 603.3	 	
107	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912356 , -97.7015303]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Men's restroom - sink drain pipe is not insulated	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

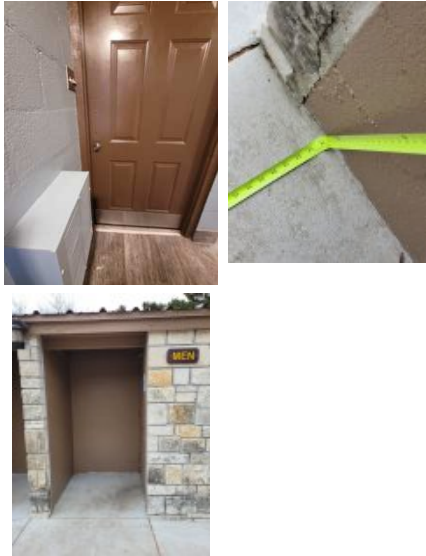

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


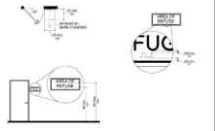
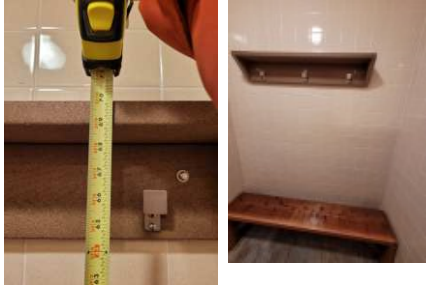
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
108	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.891231, -97.701530 3]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Men's restroom - paper towels 60" above finished floor	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
109	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.891231, -97.701530 3]	There are not enough accessible toilet compartments. The room contains toilet compartments. A minimum of 1 must be wheelchair accessible .	Men's restroom - lacks accessible toilet compartment. 1 ambulatory stall and 1 urinal	Create a wheelchair accessible stall with grab bars and fixtures mounted in correct locations and at correct heights.	2015 ABAAS Section: F213.3.1 2012 TAS Section: 213.3.1 2010 ADAS Section: 213.3.1		
110	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912447, -97.701535 6]	The ambulatory stall is not between 35" to 37" wide and 60" deep.	Men's restroom - ambulatory stall 40" width by 60" depth	Correct ambulatory stall to be 35" to 37" wide and minimum 60" deep	2015 ABAAS Section: 604.8.2.1 2012 TAS Section: 604.8.2.1 2010 ADAS Section: 604.8.2.1		

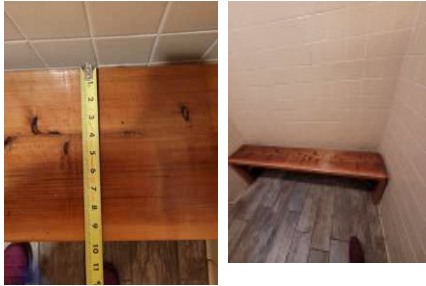
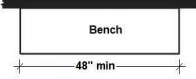

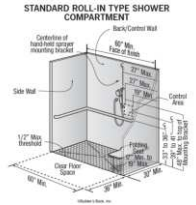
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
111	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.891247, -97.701530 3]	The toilet is not located within the range to the side wall or partition. The centerline of the toilet shall be 17 inches minimum and 19 inches maximum side wall or partition in the ambulatory accessible toilet compartment.	Men's restroom - toilet centerline 22" from partition side	Remount toilet to 17" to 19" from the side wall to center line in ambulatory stalls	2015 ABAAS Section: 604.9.1 2012 TAS Section: 604.9.1 2010 ADAS Section: 604.9.1		
112	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912219, -97.701541]	The stall door fails to comply with all of the door requirements. The stall door must be a minimum of 32" wide and have compliant hardware on both sides. The stall door must be self-closing.	Men's restroom - stall door locking hardware requires pinch	Replace stall hardware with hardware operable without a tight pinch or grasp on both sides of the stall door	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		



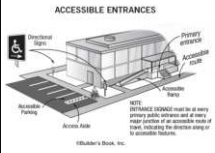
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
113	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912356 , -97.701530 3]	Grab bars shall comply with 609. A side-wall grab bar complying with 604.5.1 shall be provided on both sides of the compartment. The space between the wall and the grab bar shall be 1½ inches (38 mm). The space between the grab bar and projecting objects below and at the ends shall be 1½ inches (38 mm) minimum. The space between the grab bar and projecting objects above shall be 12 inches (305 mm) minimum. Grab bars shall be installed in a horizontal position, 33 inches (840 mm) minimum and 36 inches (915 mm) maximum above the finish floor measured to the top of the gripping surface, except that at water closets for children's use complying with 604.9, grab bars shall be installed in a horizontal position 18 inches (455 mm) minimum and 27 inches (685 mm) max	Men's restroom - side grab bars 35" on both sides	Replace side grab bars with a 42" long grab bar, mounted max 12" from the rear wall at the close end and min 54" on the far end and 33" to 36" aff	2015 ABAAS Section: 604.8.2.3, 609.3, 609.4 2012 TAS Section: 609.4, 609.3, 604.8.2.3 2010 ADAS Section: 609.3, 609.4, 604.8.2.3	 	
114	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.8912493 , -97.701538 3]	The grab bar height and/or spacing fails. Grab bars must be mounted between 33" and 36" to the top of the gripping surface. There must be 1.5" of clearance between the grab bar and the wall. There must be a minimum of 1.5" of clearance below and minimum 12" above the grab bar to any dispenser or other obstruction.	Men's restroom - toilet paper dispenser too close above grab bar	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 609.3, 609.4 2012 TAS Section: 609.4, 609.3 2010 ADAS Section: 609.3, 609.4	 	


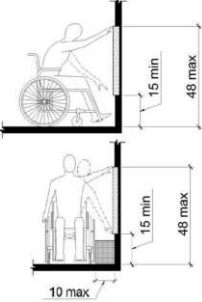

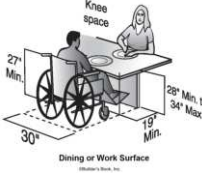


Meridian State Park - 173 Park Road #7 Meridian, TX 76665


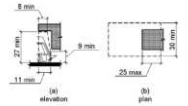

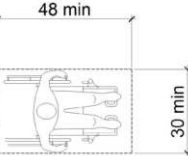

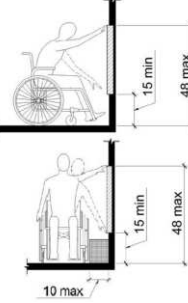
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
115	Juniper Ridge Campground: Juniper Ridge - Men's Restroom	[31.891231, -97.701524 9]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	Men's restroom - maneuvering clearance reduced by heater on push side, 44" clearance at entry path	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
116	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.8912356, -97.701546 4]	This restroom is not accessible. Where existing toilet rooms or bathing rooms do not comply, directional signs indicating the location of the nearest accessible toilet room or bathing room within the facility shall be provided. Signs shall include the International Symbol of Accessibility. Where existing toilet rooms or bathing rooms do comply), the accessible toilet rooms or bathing rooms shall be identified by the International Symbol of Where clustered single user toilet rooms or bathing facilities are permitted, accessible toilet rooms or bathing facilities shall be identified by the International Symbol of Accessibility unless all toilet rooms and bathing facilities are accessible.	Women's restroom - not accessible, lacks directional signage	Restroom not accessible, acquire and mount signage directing patrons to accessible restroom	2015 ABAAS Section: F216.8 2012 TAS Section: 216.8 2010 ADAS Section: 216.8		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
117	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.8912402 , -97.7015303]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	non compliant	Acquire and mount signage, including Braille and raised lettering mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
118	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.8912265 , -97.7015195]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Women's restroom - 66" to hook and 70" to shelf above finished floor	Remount at least one hook to max 48" aff and shelves to 40" - 48" aff	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		


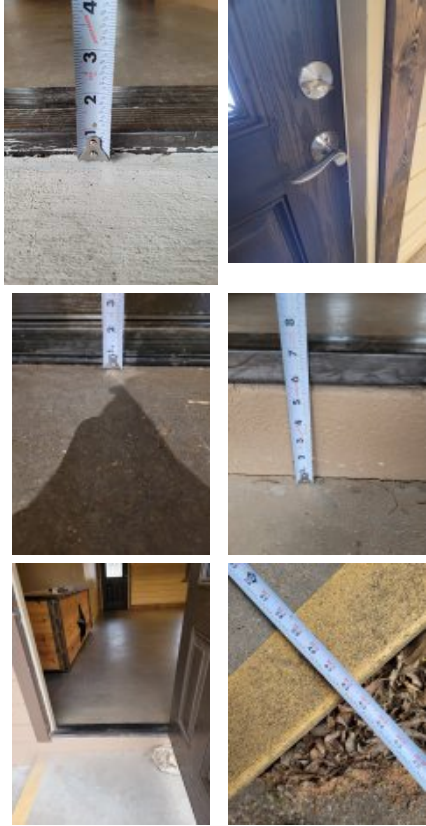
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
119	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.8912675 , -97.701578 5]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Women's restroom - bench 9.5" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
120	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.891272, -97.701541]	There are no accessible bathing or shower facilities. Where facilities for bathing are provided for the public, clients or employees, including showers or bathtubs, at least one shower or bathtub and support facilities such as lockers, and not less than 1 percent of all facilities, shall be accessible.	Women's restroom - lacks accessible shower stall	Create an accessible shower in locker/bathing room	2015 ABAAS Section: F213.3.6 2012 TAS Section: 213.3.6 2010 ADAS Section: 213.3.6		

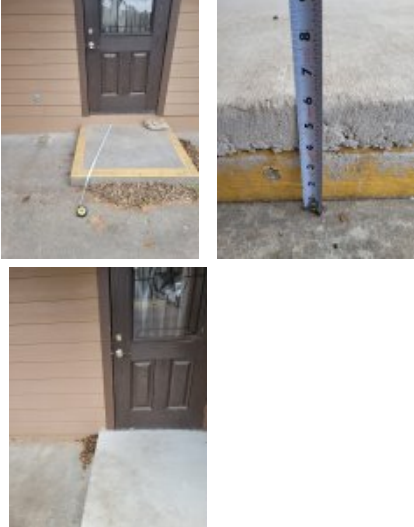

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
121	Juniper Ridge Campground: Juniper Ridge - Women's Restroom	[31.8912447 , -97.7015115]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	women's- 2.5" clearance on push, 44" width at entry	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
122	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912265 , -97.7015195]	There is no accessible route to the fire ring. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Dining Hall - no accessible route to fire ring	Create an accessible route with crushed stone or other outdoor material from parking or walkway to fire ring	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
123	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912219 , -97.701519 5]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	hvac controls 65", light switch 56" aff	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
124	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912379 , -97.701524 9]	The top of the work surface is not within a compliant height range. The tops of tables and counters shall be 28 inches to 34 inches from the floor or ground.	work surface 35" above finished floor	Provide tables and work surfaces at 28" to 34" aff with required knee and toe clearances	2015 ABAAS Section: 902.3 2012 TAS Section: 902.3 2010 ADAS Section: 902.3		
125	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.891231 , -97.701524 9]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	sink drain pipes are not insulated	Insulate exposed pipes under sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
126	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912356 , -97.701508 8]	Knee and toe space has not been provided at the sink. Kitchen sinks must be provided with a clear floor space positioned for a forward approach including knee and toe clearance.	Sink lacks knee clearance 20.75" above finished floor	Remove base cabinet and lower sink height to max 34" aff	2015 ABAAS Section: 606.2, 804.4 2012 TAS Section: 606.2, 804.4 2010 ADAS Section: 606.2, 804.4		
127	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912356 , -97.701530 3]	The operable part is not accessible because there is not adequate clear floor space for either a forward or side approach. The clear floor or ground space shall be 30 inches minimum by 48 inches minimum.	hvac controls and light switch lack clear floor space due to refrigerator and garbage	Remove, or relocate storage in CFS at fixtures and operable parts along the AR	2015 ABAAS Section: 305.3 2012 TAS Section: 305.3 2010 ADAS Section: 305.3		
128	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912356 , -97.701532 9]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	hvac controls installed 63.5" above finished floor	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		

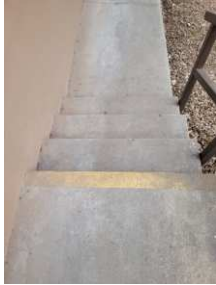
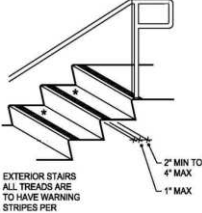
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

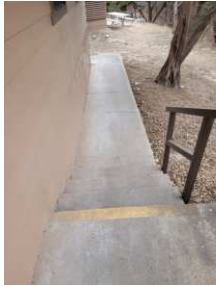
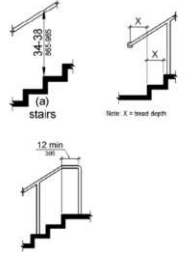
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
129	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.89127, -97.7016]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance.	kitchen- lacks push side clearance due to garbage	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		
130	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.89123, -97.70149]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. The threshold has a vertical change greater than 1/4 inch high. The threshold at a doorway shall be no higher than 1/2 inch. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. 1/4 inch is the maximum vertical rise. Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	front door - 1" CIL on pull side, maneuvering clearance reduced by elevated 6" landing area, and .75" CIL on push, lock hardware requires pinch, 18#; backdoor to patio - pull side 7" CIL, landing has 42" depth, maneuvering clearance reduced by elevated stoop, lock hardware requires pinch, 18#	For all doors along the public circulation route, provide required maneuvering clearance on push and pull side of doors For all doors along the public circulation route, repair, bevel, or ramp CILs at door entries to max .25" For all doors along the public circulation route, repair, provide beveled threshold For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		


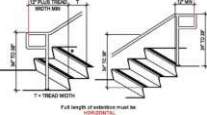
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								
131	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912265 , -97.701532 9]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	2 of 2 picnic tables are not accessible	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		


Meridian State Park - 173 Park Road #7 Meridian, TX 76665


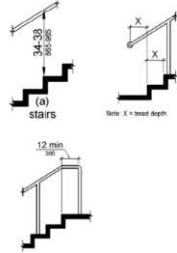
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
132	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912037 , -97.701570 5]	The walkway contains abrupt vertical edges and/or variations over a 1/4 inch. 1/4 inch is the maximum vertical rise. Changes in level between 1/4 inch and 1/2 inch must be beveled at 1:2 or less. Changes in level greater than 1/2 inch must be by way of a ramp.	Exiting Dining Hall to patio area - right side, 11" CIL and 10" gap on approach to patio.	For changes in level 6" or greater, provide a ramp for access.	2012 TAS Section: 303.2, 303.3 2010 ADAS Section: 303.2, 303.3		
133	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8911946 , -97.701567 8]	The stair risers are not uniform in height. Stair riser heights shall be 7 inches maximum and 4 inches minimum. On any given flight of stairs, all steps shall have uniform riser height and uniform tread widths.	stair rise range 5.5" - 6.25"	Correct riser heights on stairs to consistent height between 4" to 7", leave as is if technically infeasible	2015 ABAAS Section: 504.2 2012 TAS Section: 504.2 2010 ADAS Section: 504.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
134	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8911992 , -97.701567 8]	The stripe on the stair tread does not contrast adequately with the stair tread. Exterior and interior stairs are recommended to have the upper approach and lower treads marked by a stripe providing clear visual contrast.	only top stair has visual contrast striping	SMART PRACTICE Install contrasting strip along front 2" of each tread The stripe shall be a minimum of 2 inches wide to a maximum of 4 inches wide placed parallel to, and not more than 1 inch from, the nose of the step or upper approach. The stripe shall extend the full width of the step or upper approach and shall be of material that is at least as slip resistant as the other treads of the stair. A painted stripe shall be acceptable. Grooves shall not be used to satisfy this requirement.	2015 ABAAS Section: Advisory 504.4 2012 TAS Section: 504.4 Advisory 2010 ADAS Section: 504.4		

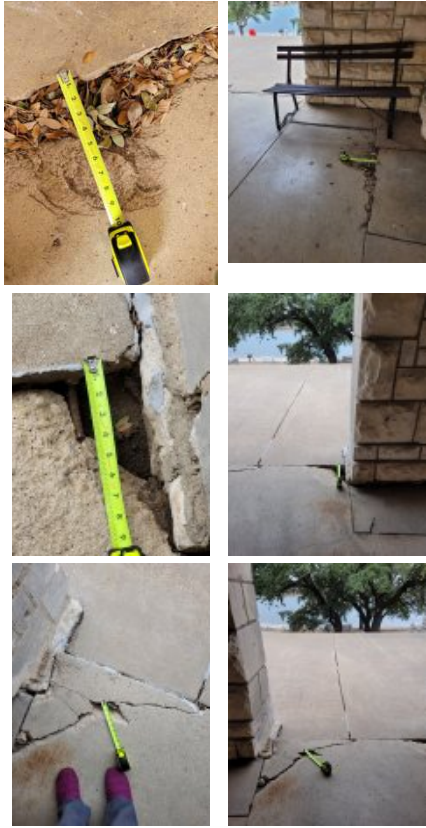
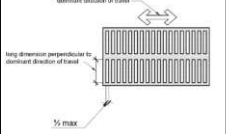

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
135	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8911946 , -97.701567 8]	Stairways must have handrails on both sides. Handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground. The top handrails shall extend a minimum of 12 inches beyond the top nosing and shall be parallel with the floor or ground surface. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The orientation of at least one handrail, including the extension, shall be in the direction of the run of the stair and perpendicular to the direction of the stair nosing. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4 inches minimum and 6 1/4 inches maximum, and a cross-section dimension of 2-1/4 inches maximum. The hand grip portion of handrails shall have a smooth surface with no sharp corners. Gripping surfaces (top or sides) shall be uninterrupted by newel posts, other construction elements or obstructions. Any wall or other surface adjacent to the handrail shall be free of sharp or abrasive elements. Handrails projecting from a wall shall have a space of 1-1/2 inches minimum between the wall and the handrail.	lacks handrail on wall side, handrail lacks extension	Install handrails on both sides of stairway, mounted 34" to 38" aff with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall	2015 ABAAS Section: 505.2 2012 TAS Section: 505.2 2010 ADAS Section: 505.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
136	Juniper Ridge Campground: Juniper Ridge - Dining Hall	[31.8912014 , -97.701565 1]	The stairway is not compliant for multiple reasons: - Handrails are missing - Handrails are missing on one side - Hand grips are not a compliant shape - Top handrail extension is missing - Bottom handrail extension is missing - Top extension is not long enough - Bottom extension is not long enough - Striping is missing on the nose of the treads - One handrail must be perpendicular to the treads - Risers are not uniform in height - Treads are not uniform in length	handrail is not continuous	Install handrails on both sides of stairway, mounted 34" to 38" aff with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall Correct riser heights on stairs to consistent height between 4" to 7", leave as is if technically infeasible Correct tread depth on stairs to 11" minimum and consistent, leave as is if technically infeasible Install kick plates on all stairs or replace with ones having closed risers Repair nosings to be curved or beveled and extend max 1.5" over the tread Provide a contrasting strip on the front 2" of each stair tread			








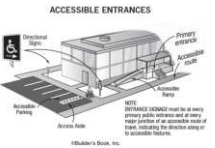
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
137	Lakeside Campground: Lakeside - Swimming	[31.8885164 , -97.700194 5]	Beach access routes shall connect an entry point to the beach to the: 1. High tide level at tidal beaches; 2. Mean high water level at river beaches; or 3. Normal recreation water level at lake, pond, and reservoir beaches	Lacks accessible route to beach access	Create a beach access route to normal recreational water level of a firm and stable material as a smart practice	2015 ABAAS Section: 1018.2		


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
138	Lakeside Campground: Lakeside - Swimming	[31.8887442 , -97.699851 2]	Stairways must have handrails on both sides. Handrails and their extensions must be between 34 inches and 38 inches above the stair nosing or ground. The top handrails shall extend a minimum of 12 inches beyond the top nosing and shall be parallel with the floor or ground surface. At the bottom of a stair flight, handrails shall extend at the slope of the stair flight for a horizontal distance at least equal to one tread depth beyond the last riser nosing. Extension shall return to a wall, guard, or the landing surface, or shall be continuous to the handrail of an adjacent stair flight. The orientation of at least one handrail, including the extension, shall be in the direction of the run of the stair and perpendicular to the direction of the stair nosing. Handrail gripping surfaces with a circular cross section shall have an outside diameter of 1-1/4 inches minimum and 2 inches maximum. Handrail gripping surfaces with a non-circular cross section shall have a perimeter dimension of 4 inches minimum and 6 1/4 inches maximum, and a cross-section dimension of 2-1/4 inches maximum. The hand grip portion of handrails shall have a smooth surface with no sharp corners. Gripping surfaces (top or sides) shall be uninterrupted by newel posts, other construction elements or obstructions. Any wall or other surface adjacent to the handrail shall be free of sharp or abrasive elements. Handrails projecting from a wall shall have a space of 1-1/2 inches minimum between the wall and the handrail.	Stairway lacks handrails on both sides	Install handrails on both sides of stairway, mounted 34" to 38" aff with top and bottom extensions and having a 1.25" – 2" in diameter, or a non-circular grip that has a perimeter dimension of 4"- 6.25" max with a min gap of 1.5" between handrail and wall	2015 ABAAS Section: 505.2 2012 TAS Section: 505.2 2010 ADAS Section: 505.2		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
139	Lakeside Campground: Lakeside - Picnic Area	[31.8887601 , -97.699835 1]	There is a gap spaced greater than a 1/2 inch. Openings in floor or ground surfaces shall not allow passage of a sphere more than 1/2 inch diameter. Elongated openings shall be placed so that the long dimension is perpendicular to the dominant direction of travel.	Gaps - 9" on right side facing water, 7" center, 5" center	Correct or fill gaps to be max .5"	2015 ABAAS Section: 302.3 2012 TAS Section: 302.3 2010 ADAS Section: 302.3		
140	Lakeside Campground: Lakeside - Picnic Area	[31.8887601 , -97.699802 9]	Picnic tables shall provide at least one wheelchair space for each 24 linear feet (7320 mm) of usable table surface perimeter. Wheelchair spaces shall be 30 inches (760 mm) minimum by 48 inches (1220 mm) minimum. Wheelchair spaces shall be positioned for a forward approach to the table and provide knee and toe clearance complying with 306 under the table	0 of 3 picnic tables accessible	Replace picnic table with one of an accessible design as a smart practice	2015 ABAAS Section: 1011.4.2		

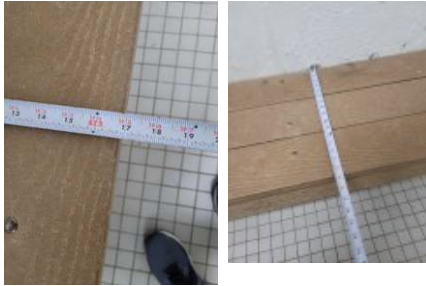
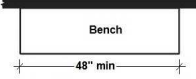

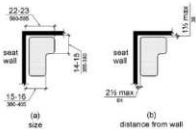
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
141	Lakeside Campground: Lakeside - Picnic Area	[31.8887548 , -97.699818 2]	Picnic tables are required to have clear ground space 36 inches (915 mm) on all usable sides of the table measured from the back edge of the benches.	Picnic table - width reduced to 26" around table	Provide required 36" clear ground space around all usable portions of the table as a smart practice.	2015 ABAAS Section: 1011.2.1	  	
142	Lakeside Campground: Lakeside - Picnic Area	[31.8884117 , -97.699701]	There is no accessible route to the picnic areas. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Lakeside day use - 15 picnic tables, 9 grills, water spigot; cobblestone walkway 11" CIL, slopes, gaps	Create an accessible route with crushed stone or other outdoor material from parking or walkway to picnic area amenities. Replace 20% of picnic tables with ones that are accessible with knee and toe clearance and a 36" wide route around table as a smart practice.	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2	   	


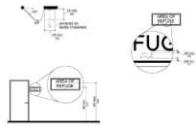



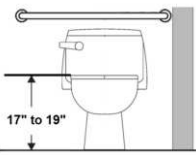
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								





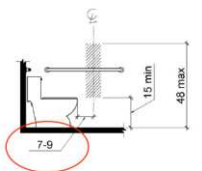

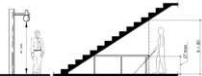
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
143	Lakeside Campground: Lakeside - Men's Restroom	[31.8888216 , -97.699773 4]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Men's restroom - hook installed 64.5", shelf 68" AFF	Remount at least one hook to max 48" aff and shelves to 40" - 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		


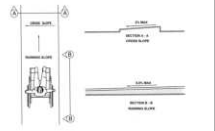
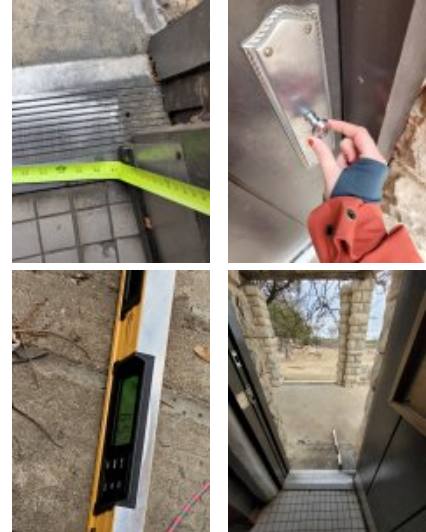
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
144	Lakeside Campground: Lakeside - Men's Restroom	[31.8888284 , -97.6997815]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Men's restroom - bench seat depth 17"	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
145	Lakeside Campground: Lakeside - Men's Restroom	[31.8888148 , -97.699768]	The shower seat does not have a compliant space between it and the wall. The folding seat must be mounted 17-19 inches above the floor, and have a maximum space of 1-1/2 inches between the edge of the seat and the side wall and 2-1/2 inches maximum to the seat wall.	Men's restroom - shower seat installed 2.5" from side wall	Remount shower seat to the correct location and height in the shower	2015 ABAAS Section: 610.3.2 2012 TAS Section: 610.3.2 2010 ADAS Section: 610.3.2		


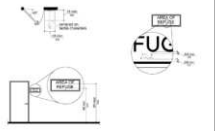

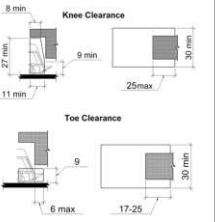

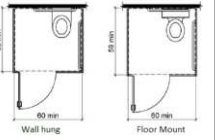
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
146	Lakeside Campground: Lakeside - Men's Restroom	[31.8888079 , -97.69976]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Men's restroom - lacks compliant signage	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
147	Lakeside Campground: Lakeside - Men's Restroom	[31.8887897 , -97.6997815]	The water and drain pipes under the lavatory are not adequately insulated. Water supply and drain pipes under lavatories and sinks shall be insulated or otherwise configured to protect against contact. There shall be no sharp or abrasive surfaces under lavatories and sinks.	Men's restroom - sink drain pipes lack insulation	Insulate exposed pipes under one sink	2015 ABAAS Section: 606.5 2012 TAS Section: 606.5 2010 ADAS Section: 606.5		
148	Lakeside Campground: Lakeside - Men's Restroom	[31.8887851 , -97.6997976]	The toilet seat is not located within the range allowed off the floor. The height of accessible water closets shall be a minimum of 17 inches and a maximum of 19 inches measured to the top of a maximum 2-inch high toilet seat.	Men's restroom - toilet seat installed 16.25" above finished floor	Replace toilet seat, or re-set or replace toilet to 17" to 19" aff	2015 ABAAS Section: 604.4 2012 TAS Section: 604.4 2010 ADAS Section: 604.4		


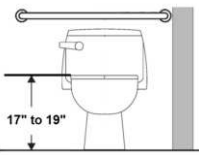

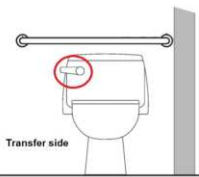

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
149	Lakeside Campground: Lakeside - Men's Restroom	[31.8888056 , -97.6997707]	The side grab bars are not in the correct location. Grab bars on the side wall must be installed so that the end closest to the rear wall is maximum 12" from the rear wall. The end furthest from the rear wall must be mounted minimum 54" from the rear wall.	Men's restroom - side grab bar installed 53" from back wall	Remount side grab bar to max 12" from the rear wall at the close end and min 54" on the far end, and 33" to 36" aff	2015 ABAAS Section: 604.5.1 2012 TAS Section: 604.5.1 2010 ADAS Section: 604.5.1		
150	Lakeside Campground: Lakeside - Men's Restroom	[31.8888079 , -97.6997707]	The toilet paper is not installed within the compliant range in front of the toilet. Toilet paper dispensers shall be 7 inches minimum and 9 inches maximum in front of the water closet measured to the centerline of the dispenser. The outlet of the dispenser shall be 15 inches minimum and 48 inches maximum above the finish floor and shall not be located behind grab bars. Dispensers shall not be of a type that controls delivery or that does not allow continuous paper flow. There shall be a clearance of 1 1/2 inches minimum below the grab bar.	Men's restroom - toilet paper dispenser not mounted within compliant range	Remount toilet paper dispenser max 7" to 9" from front of toilet, 15" to 48" aff and min 12" above or 1.5" below grab bar	2015 ABAAS Section: 604.7 2012 TAS Section: 604.7 2010 ADAS Section: 604.7		
151	Lakeside Campground: Lakeside - Men's Restroom	[31.8888056 , -97.6997788]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Men's restroom - hand dryer projects 9" into circulation path	Relocate protruding objects or place cane detectable warning or bollard at foot of item	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
152	Lakeside Campground: Lakeside - Men's Restroom	[31.8888011 , -97.6997815]	The accessible route contains cross slopes greater than 2 percent across the width of the walk and has not been constructed as a ramp (i.e. handrails, wheel guides, etc.). When the slope in the direction of travel of any walk surface must not exceed one unit vertical in 48 units. Horizontal (2-percent slope).	Men's restroom - 3.2% near urinal and drain	Correct or repair slope to max 2.08% cross.	2015 ABAAS Section: 403.3 2012 TAS Section: 403.3 2010 ADAS Section: 403.3		
153	Lakeside Campground: Lakeside - Men's Restroom	[31.8887715 , -97.6997922]	Minimum maneuvering clearances at doors and gates shall comply with 404.2.4. Maneuvering clearances shall extend the full width of the doorway and the required latch side or hinge side clearance. Maneuvering clearances shall have a max slope of 2.08%. Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Men's restroom - 27" width, 11# to open, hardware requires pinch to operate, 6.5%	For all doors along the public circulation route, correct slope in door clearance to max 2.08%. For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width. For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice. For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp.	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
154	Lakeside Campground: Lakeside - Women's Restroom	[31.8888034 , -97.699786 8]	The restroom sign does not comply with one or more applicable requirements for the location, height, and properties of the sign.	Women's restroom - signage is non compliant, lacks symbol of accessibility	Acquire and mount signage, including Braille, raised lettering and access symbol mounted on wall, latch side of door, 48" to baseline of lowest character and 60" to baseline of highest character	2015 ABAAS Section: F216.2, 703.1, 703.2, 703.5, 703.6 2012 TAS Section: 216.2, 703.1, 703.2, 703.5, 703.6 2010 ADAS Section: 216.2, 703.1, 703.2, 703.5, 703.6		
155	Lakeside Campground: Lakeside - Women's Restroom	[31.8887851 , -97.699770 7]	Knee and toe clearance has not been provided at the sink. The knee clearance shall be 11 inches deep minimum at 9 inches above the finish floor or ground, and 8 inches deep minimum at 27 inches above the finish floor or ground. The toe clearance is the space under the sink between the finish floor or ground and 9 inches above the finish floor 30 inches wide minimum.	Women's restroom - sink lacks knee and toe clearance	Remove under sink barrier to provide knee and toe clearances under sinks and insulate exposed pipes	2012 TAS Section: 606.2 2010 ADAS Section: 606.2		
156	Lakeside Campground: Lakeside - Women's Restroom	[31.8887943 , -97.699786 8]	The dimensions of the toilet stall do not comply. Wheelchair accessible compartments shall be 60 inches wide and 59 inches deep minimum for floor mounted water closets measured perpendicular to the rear wall. Door shall not swing into the minimum clear floor space required for the toilet.	Women's restroom - 56" depth x 61" width	Widen accessible stalls to min. 60" clear width, 59" depth	2015 ABAAS Section: 604.8.1.1 2012 TAS Section: 604.3.2 2010 ADAS Section: 604.3.2		


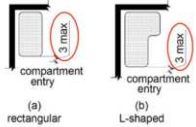
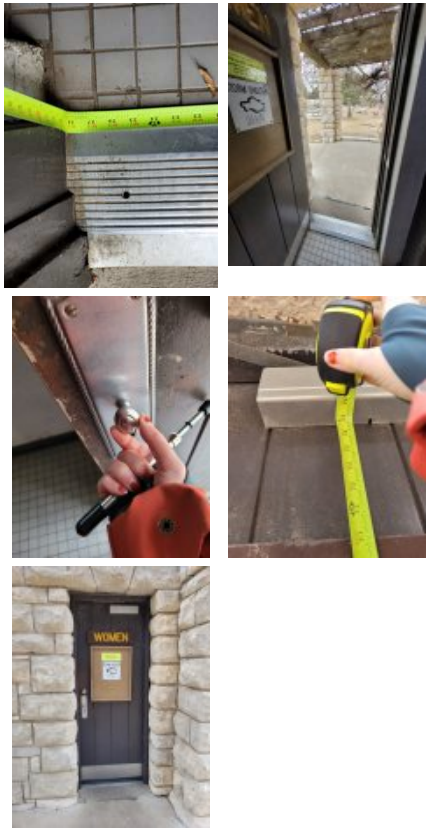
Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
157	Lakeside Campground: Lakeside - Women's Restroom	[31.8888079 , -97.699781 5]	The toilet seat is not located within the range allowed off the floor. The height of accessible water closets shall be a minimum of 17 inches and a maximum of 19 inches measured to the top of a maximum 2-inch high toilet seat.	Women's restroom - seat mounted 16.5" above finished floor	Replace toilet seat, or re-set or replace toilet to 17" to 19" aff	2015 ABAAS Section: 604.4 2012 TAS Section: 604.4 2010 ADAS Section: 604.4		
158	Lakeside Campground: Lakeside - Women's Restroom	[31.8888102 , -97.699768]	The flush handle is located on the wrong side of the toilet. Controls shall be operable with one hand and shall not require tight grasping, pinching or twisting. Controls for the flush valves shall be mounted on the wide side of toilet areas, no more than 44 inches above the floor.	Women's restroom - flush handle installed on the closed side of toilet	Replace toilet tank with one having flush mechanism on the open side, in the alternative, install an auto flush unit	2015 ABAAS Section: 604.6 2012 TAS Section: 604.6 2010 ADAS Section: 604.6		
159	Lakeside Campground: Lakeside - Women's Restroom	[31.8887988 , -97.699770 7]	The stall door fails to comply with all of the door requirements. The stall door must be self-closing.	Women's restroom - stall door is not self closing	Adjust stall door to be self-closing.	2015 ABAAS Section: 404.2.3, 404.2.7, 604.8.2.2 2012 TAS Section: 404.2.3, 404.2.7, 604.8.2.2 2010 ADAS Section: 404.2.3, 404.2.7, 604.8.2.2		

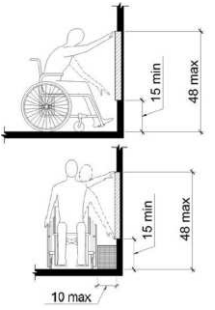

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
160	Lakeside Campground: Lakeside - Women's Restroom	[31.8887851 , -97.699786 8]	The compartment door is located too far from the partition or wall. The door shall be located in front of the clear space and diagonal to the water closet. Where located in the front partition, the door opening shall be 4 inches maximum from the side wall or partition farthest from the water closet. Where located in the side wall or partition, the door opening shall be 4 inches maximum from the front partition. Toilet compartment doors shall not swing into the minimum required compartment area.	Women's restroom - stall door is installed 5.5" from partition	Rehang stall door to be max 4" from adjacent stall partition and on the stall wall farthest from the toilet	2015 ABAAS Section: 604.8.1.2 2012 TAS Section: 604.8.1.2 2010 ADAS Section: 604.8.1.2		
161	Lakeside Campground: Lakeside - Women's Restroom	[31.8887874 , -97.699768]	An item or items project more than 4 inches into the circulation path. Wall-mounted objects that have leading edges between 27 inches and 80 inches from the floor must not project more than 4 inches into the circulation path. Protruding objects that extend to the floor or within 27 inches of the floor are cane detectable and are therefore not hazardous. Where it is necessary or desirable to have objects protrude from the wall, a manner of cane detection must be provided.	Women's restroom - hand dryer projects 8.5" into circulation path	Relocate protruding objects or place cane detectable warning or bollard at foot of item.	2015 ABAAS Section: 307.2 2012 TAS Section: 307.2 2010 ADAS Section: 307.2		
162	Lakeside Campground: Lakeside - Women's Restroom	[31.888776, -97.699770 7]	Coat hooks provided within the room shall be located within one of the reach ranges specified in 308. Shelves shall be 40 inches (1015 mm) minimum and 48 inches (1220 mm) maximum above the finish floor or ground. Where coat hooks or shelves are provided in dressing, fitting or locker rooms without individual compartments, at least one of each type shall comply with 803.5. Where coat hooks or shelves are provided in individual compartments at least one of each type complying with 803.5 shall be provided in individual compartments in dressing, fitting, or locker rooms required to comply with 222.1.	Women's restroom - hook mounted 65", shelf 67" AFF	Remount at least one hook to max 48" AFF and shelves to 40" - 48" AFF.	2015 ABAAS Section: 308.2.1, 308.1, F222.2, 803.5 2012 TAS Section: 308.2.1, 308.1, 222.2, 803.5 2010 ADAS Section: 308.2.1, 308.1, 222.2, 803.5		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


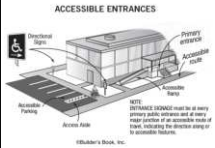
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
163	Lakeside Campground: Lakeside - Women's Restroom	[31.8887715 , -97.699792 2]	The bench is not deep enough or long enough or is missing. Benches shall be provided having seats that are 42 inches long minimum and 20 inches deep minimum and 24 inches deep maximum. The bench shall provide for back support or shall be affixed to a wall. Back support shall be 42 inches (1065 mm) long minimum and shall extend from a point 2 inches (51 mm) maximum above the seat surface to a point 18 inches (455 mm) minimum above the seat surface. Back support shall be 2½ inches (64 mm) maximum from the rear edge of the seat measured horizontally. The top of the bench seat surface shall be 17 inches (430 mm) minimum and 19 inches (485 mm) maximum above the finish floor or ground.	Women's restroom - bench 16.75" depth	Replace bench in dressing area with one having a seat depth of 20" to 24" deep, 42" long, affixed to the wall or having a back and mounted 17" to 19" aff.	2012 TAS Section: 903.4, 903.2, 903.3, 903.5 2010 ADAS Section: 903.4, 903.2, 903.3, 903.5		
164	Lakeside Campground: Lakeside - Women's Restroom	[31.8887943 , -97.699776 1]	Transfer type shower compartments shall be 36 inches (915 mm) by 36 inches (915 mm) clear inside dimensions measured at the center points of opposing sides and shall have a 36 inch (915 mm) wide minimum entry on the face of the shower compartment. Clearance of 36 inches (915 mm) wide minimum by 48 inches (1220 mm) long minimum measured from the control wall shall be provided.	Women's restroom - shower stall 40.5" d x 36" w	Correct transfer shower to compliant 36" by 36" clear inside dimension	2015 ABAAS Section: 608.2.1 2012 TAS Section: 608.2.1 2010 ADAS Section: 608.2.1		



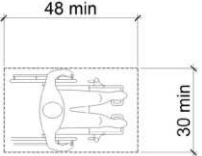
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
165	Lakeside Campground: Lakeside - Women's Restroom	[31.8887943 , -97.6997815]	The shower seat is located too far from the opening to the shower. A seat in a standard roll-in shower compartment shall be a folding type, shall be installed on the side wall adjacent to the controls, and shall extend from the back wall to a point within 3 inches of the compartment entry.	Women's restroom - seat installed 6" from stall entry	Remount shower bench so that the front edge is within 3" of the opening	2015 ABAAS Section: 610.3 2012 TAS Section: 610.3 2010 ADAS Section: 610.3		
166	Lakeside Campground: Lakeside - Women's Restroom	[31.8888034 , -97.6997761]	Door openings shall provide a clear width of 32 inches (815 mm) minimum. Clear openings of doorways with swinging doors shall be measured between the face of the door and the stop, with the door open 90 degrees. Openings more than 24 inches (610 mm) deep shall provide a clear opening of 36 inches (915 mm) minimum. There shall be no projections into the required clear opening width lower than 34 inches (865 mm) above the finish floor or ground. Projections into the clear opening width between 34 inches (865 mm) and 80 inches (2030 mm) above the finish floor or ground shall not exceed 4 inches (100 mm). Exterior doors are recommended to be maintained at 8.5 lbf as a smart practice. Force is to be measured at the operating hardware or 30 inches from the hinges, whichever is greater. Hand-activated door opening hardware, handles, pulls, latches, locks, and other operating devices on accessible doors shall have a shape that is easy to grasp with one hand and does not require tight grasping, tight pinching or twisting of the wrist to operate. Hardware shall be 34 inches minimum and 48 inches maximum above the finish floor or ground.	Women's restroom - 28" width, 18#, hardware requires pinch	For all doors along the public circulation route, replace doors with doors having 80" overhead clearance and 32" clear width For all doors along the public circulation route, inspect, adjust, and maintain 8.5 lbf to open exterior doors as a smart practice For all doors along the public circulation route, replace hardware with lever hardware or hardware operable without a tight pinch or grasp	2010 ADAS Section: 404.2.3, 404.2.7, 404.2.4, 404.2.11, 404.2.11 Exception		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665


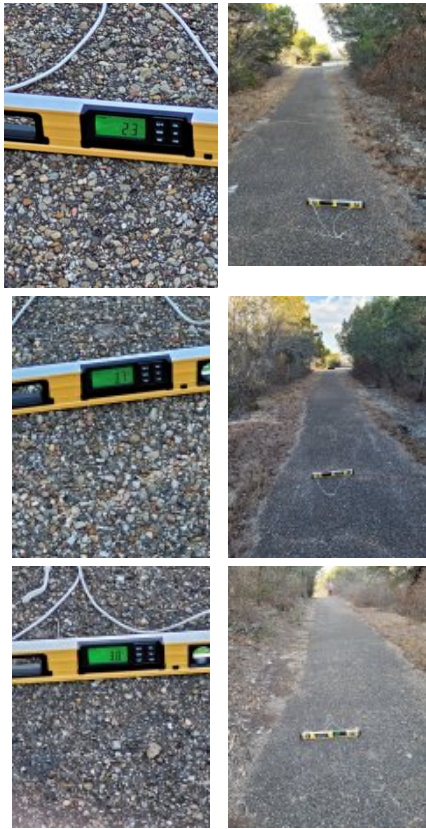
Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
167	Lakeside Campground: Lakeside - Boat Launch	[31.8887929 , -97.700213]	The operable part is positioned too high for either a side or front approach. Where a clear floor or ground space allows a parallel approach to an element and the side reach is unobstructed, the high side reach shall be 48 inches maximum and the low side reach shall be 15 inches minimum above the finish floor or ground. Where a forward reach is unobstructed, the high forward reach shall be 48 inches maximum and the low forward reach shall be 15 inches minimum above the finish floor or ground.	Lakeside day use - canoe rental hardware on storage lacks handles	Remount operable parts to be in reach range of 15" min to 48" max	2015 ABAAS Section: 308.1 2012 TAS Section: 308.1 2010 ADAS Section: 308.1		
168	Lakeside Campground: Lakeside - Fishing Pier	[31.8886576 , -97.700350 1]	The required edge protection is not provided. Where compliant railings, guards, or handrails are provided, edge protection shall also be provided. Curbs or barriers shall extend 2 inches minimum above the surface of the fishing pier or platform or The ground or deck surface shall extend 12 inches minimum beyond the inside face of the railing. Toe clearance shall be provided and shall be 30 inches wide minimum and 9 inches minimum above the ground or deck surface beyond the railing.	Lacks curb or barrier along edge, railing installed 5" above ground	Provide 2" high curb or 12" extended surface beyond railing for edge protection.	2015 ABAAS Section: 1005.3.1, 1005.3.2 2010 ADAS Section: 1005.3.1, 1005.3.2		


Meridian State Park - 173 Park Road #7 Meridian, TX 76665


Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
169	Shinnery Ridge West Campground: Shinnery Ridge West - Primitive Campsites	[31.8873185 , -97.706605]	There is no accessible route to the bench and overlook. At least one accessible route shall connect accessible buildings, accessible facilities, accessible elements, and accessible spaces that are on the same site.	Shinnery Ridge Trail - lacks accessible route to bench and overlook	Create an accessible route with crushed stone or other outdoor material from parking or walkway to bench and outlook	2015 ABAAS Section: F206.2.2 2012 TAS Section: 206.2.2 2010 ADAS Section: 206.2.2		
170	Shinnery Ridge West Campground: Shinnery Ridge West - Primitive Campsites	[31.8880746 , -97.7058701]	Camping facilities shall provide camping units with mobility features complying with F244.2 in accordance with Table F244.2. Where a camping facility provides different types of camping units, Table F244.2 shall apply to each type of camping unit provided. Total Number of Camping Units Provided in Camping Facility Minimum Number of Camping Units with Mobility Features Required 1 1 2 to 25 2 26 to 50 3 51 to 75 4 76 to 100 5 101 to 150 7 151 to 200 8 201 and over 8, plus 2 percent of the number over 200	0 of 8 primitive campsites accessible, each includes a table, fire ring, grill, and hook	Create the required number of accessible camp sites per table F244.2 as a smart practice	2015 ABAAS Section: F244.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
171	Trails: Trailhead	[31.8905251, -97.7050761]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Shinnery paved trailhead - loose gravel at entry, entire trail had loose gravel on top of blacktop.	Establish protocols for regular and frequent inspection and maintenance of accessible trail surface as a smart practice Frequently maintain trail surface in identified washout areas to assure CIL's remain 2" or less and gaps are filled as a smart practice	2015 ABAAS Section: 1017.2		
172	Trails: Trailhead	[31.890771, -97.7049742]	The 30 inches minimum by 48 inches minimum clear floor space required at the operable part is not flat (2% or 1:48 maximum slope) in all directions. Changes in level are not permitted at required clear floor or ground space except that slopes not steeper than 1:48 shall be permitted.	Shinnery paved trailhead section - bench without clear floor space and 18.2%	Correct or repair slope in CFS to max 2.08%	2015 ABAAS Section: 305.2 2012 TAS Section: 305.2 2010 ADAS Section: 305.2		

Meridian State Park - 173 Park Road #7 Meridian, TX 76665

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
173	Trails: Trail Surface	[31.8878377 , -97.706287 9]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	Bosque trail at campsite 24 entry point trail surface not firm a surface	Leave as is and designate other trails at the park accessible	2015 ABAAS Section: 1017.2		
174	Trails: Trail Surface	[31.8913426 , -97.706841]	The cross slope shall not be steeper than 1:48. EXCEPTION: Where the surface is other than concrete, asphalt, or boards, cross slopes not steeper than 1:20 shall be permitted when necessary for drainage.	Shinnery Ridge Trail- 2.3%, 3.7%, 3.8%, 3.7%, 7.5%, 8.2%, 5.2%, 5.7%,	Correct or repair pathway cross slope to max 2.08% or 5% depending on surface as a smart practice.	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
								

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
175	Trails: Trail Surface	[31.8931964 , -97.699929]	The surface of trails, passing spaces, and resting intervals shall be firm and stable	little forest junior trail and juniper ridge non compliant surface	Leave as is and designate other trails at the park accessible	2015 ABAAS Section: 1017.2		

Finding Number	Area Description	Lat/Long	Finding	As Built	Recommendation	Citation	Photos	Figure
176	Maintenance: Maintenance - Employee Spaces	[31.8906116 , -97.697372 8]	Spaces and elements within employee work areas shall only be required to comply with 206.2.8, 207.1, and 215.3 and shall be designed and constructed so that individuals with disabilities can approach, enter, and exit the employee work area. Employee work areas, or portions of employee work areas, other than raised courtroom stations, that are less than 300 square feet (28 m2) and elevated 7 inches (180 mm) or more above the finish floor or ground where the elevation is essential to the function of the space shall not be required to comply with these requirements or to be on an accessible route.	No AR to maintenance buildings, door to garage fails	For employee spaces, relocate storage, furniture, and other obstacles at doorways to provide approach, enter and exit at the employee space.	2015 ABAAS Section: F203.9 2012 TAS Section: 203.9 2010 ADAS Section: 203.9	